

Part 573 Safety Recall Report**16V-093****Manufacturer Name :** Daimler Vans USA, LLC**Submission Date :** FEB 16, 2016**NHTSA Recall No. :** 16V-093**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Daimler Vans USA, LLC

Address : 303Perimeter Center North

Suite 202 Atlanta GA 30346

Company phone : 7707052070

Population :

Number of potentially involved : 2,278

Estimated percentage with defect : 100

Vehicle Information :

Vehicle : 2015-2016 Mercedes-Benz Sprinter 2500 and 3500

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain sprinter vehicles were equipped with tire pressure labels which show an incorrect (higher) maximum load capacity.

Production Dates : APR 29, 2015 - DEC 15, 2015

VIN (Vehicle Identification Number) Range

Begin : NR

End : NR

☐ Not sequential VINs

Vehicle : 2015-2016 Freightliner Sprinter 2500 and 3500

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Certain sprinter vehicles were equipped with tire pressure labels which show an incorrect (higher) maximum load capacity.

Production Dates : APR 29, 2015 - DEC 15, 2015

VIN (Vehicle Identification Number) Range

Begin : NR

End : NR

☐ Not sequential VINs**Description of Defect :**

Description of the Defect : Certain sprinter vehicles were equipped with tire pressure labels which show an incorrect (higher) maximum load capacity.

FMVSS 1 : NR

FMVSS 2 :NR

Description of the Safety Risk : If the wheel load, the axle load and/or the permissible total vehicle weight is exceeded, vehicle safety may be affected. The handling characteristics such as braking response or neutral steer might deteriorate. This could increase the risk of a crash.

Description of the Cause : Incorrect data regarding the total vehicle weight was entered in the weighting device which determines the vehicle's maximum load capacity.

Identification of Any Warning that can Occur : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

On November 30, 2015 an assigned upfitter company of Daimler Vans stated that the maximum load capacity on the tire pressure label was printed incorrectly, with a higher load capacity than allowed. Investigations were launched immediately to determine the root cause of the subject error.

Description of Remedy :

Description of Remedy Program : DVUSA will conduct a voluntary recall to replace the tire pressure label of the potentially affected vehicles. Pursuant to 49 C.F.R. § 577.11(e), DVUSA does not plan to provide notice about pre-notice reimbursement to owners since all involved vehicles remain covered under the new vehicle warranty.

How Remedy Component Differs from Recalled Component : The remedying tire pressure label shows the correct maximum load capacity.

Identify How/When Recall Condition was Corrected in Production : On December 15, 2015 correct data regarding the total vehicle weight was entered in the weighting device which determines the maximum load capacity.

Recall Schedule :

Description of Recall Schedule : Dealers are expected to be notified in February 2016. Owners are expected to be notified in March 2016.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

* NR - Not Reported