OMB Control No.: 2127-0004

Part 573 Safety Recall Report

16V-231

Manufacturer Name : Kia Motors America

Submission Date: APR 19, 2016 NHTSA Recall No.: 16V-231 Manufacturer Recall No.: SC131



Manufacturer Information:

Manufacturer Name : Kia Motors America Address : 111 Peters Canyon Road

Irvine CA 92606

Company phone: 800-333-4542

Population:

Number of potentially involved: 17 Estimated percentage with defect: 100

Vehicle Information:

Vehicle: 2016-2016 Kia Optima Vehicle Type: LIGHT VEHICLES

Body Style : ALL Power Train : GAS

Descriptive Information: Certain 2016 MY Optima vehicles. The recall population was determined based on

manufacturing records. These vehicles were not produced in VIN order.

Production Dates: NOV 10, 2015 - FEB 12, 2016

VIN (Vehicle Identification Number) Range

Description of Defect:

Description of the Defect: A secondary chemical enhancer required for the proper deployment of second-

stage frontal airbag was not loaded during the airbag inflator build at the supplier.

As a result, the second stage of the driver's front airbag will not deploy.

FMVSS 1 :NR FMVSS 2 :NR

Description of the Safety Risk: If the vehicle is involved in a crash that triggers the second-stage deployment of

the driver frontal airbag, it will not deploy thereby increasing the risk of injury

to the driver.

Description of the Cause: N/A

Identification of Any Warning that can Occur: N/A

Supplier Identification:

Component Manufacturer

Name: Key Safety Systems

Address: 5300 Allen K. Breed Hwy

Lakeland FLORIDA 33811

Country: United States

Chronology:

See attached document titled "2016 MY Optima Driver's Frontal Airbag Chronology"

Description of Remedy:

Description of Remedy Program: All owners of the subject vehicles will be notified of the issue by telephone

and asked to bring their vehicle to a Kia dealer for repair. Owners will also be sent written notification by first class mail with instructions to bring their vehicles to a Kia dealer upon NHTSA's approval of the owner letter. Kia will instruct dealers to replace the driver frontal airbag module with a new one.

Pursuant to 49 C.F.R. \S 573.13 (d)(1), all covered vehicles are under

warranty so reimbursement is not offered.

How Remedy Component Differs from Recalled Component: The replacement airbag modules are not missing

the secondary chemical enhancer.

Identify How/When Recall Condition was Corrected in Production: The driver's airbag module supplier

corrected and improved their manufacturing process to ensure the presence and correct location of the secondary chemical enhancer.

Recall Schedule:

Description of Recall Schedule: NR

Planned Dealer Notification Date: APR 22, 2016 - APR 22, 2016

Planned Owner Notification Date: APR 22, 2016 - APR 22, 2016

* NR - Not Reported