

Part 573 Safety Recall Report**16V-282****Manufacturer Name :** Keystone RV Company**Submission Date :** MAY 06, 2016**NHTSA Recall No. :** 16V-282**Manufacturer Recall No. :** 16-251**Manufacturer Information :**

Manufacturer Name : Keystone RV Company

Address : PO Box 2000

2642 Hackberry Drive Goshen IN 46527

Company phone : 574-535-2100

Population :

Number of potentially involved : 88

Estimated percentage with defect : 100

Vehicle Information :

Vehicle : 2016-2017 Keystone Outback

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Outback 326RL manufactured in the production date range.

Production Dates : FEB 24, 2016 - APR 21, 2016

VIN (Vehicle Identification Number) Range

Begin : 4YDT32620GB453488

End : 4YDT32628GB453786

 Not sequential VINs

Begin : 4YDT32628HB450016

End : 4YDT32624HB450286

 Not sequential VINs**Description of Defect :**

Description of the Defect : It has been decided the vehicles in this recall population may have been manufactured with an interior TV bracket not properly secured to the wall.

FMVSS 1 :NR

FMVSS 2 :NR

Description of the Safety Risk : If the TV bracket breaks loose from the wall while a person is nearby, it will lead to an increased risk of personal injury.

Description of the Cause : The screws used for installing the bracket were too small.

Identification of Any Warning that can Occur : The TV bracket may be loose or partially separated from the wall.

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

April 26, 2016 – An Outback owner noticed TV bracket was loose. Investigation determined wrong screw used for TV bracket installation.

Description of Remedy :

Description of Remedy Program : The remedy is to re-install the TV bracket with larger screws.

How Remedy Component Differs from Recalled Component : Incorrect screw used was #8 x 3/4" self-drilling.
Correct screw for repair is 1/4" - 14 - 1" self-drilling screw.

Identify How/When Recall Condition was Corrected in Production : Units were quarantined, inspected then repaired as indicated by inspection.

Recall Schedule :

Description of Recall Schedule : Keystone will notify the dealers and owners of the recreational vehicles by letter. A final copy of the owner letter will be provided to NHTSA, along with the dealer repair procedures

Planned Dealer Notification Date : MAY 13, 2016 - MAY 13, 2016

Planned Owner Notification Date : MAY 13, 2016 - MAY 13, 2016

* NR - Not Reported