#### OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

# 16V-337

**Manufacturer Name:** Volkswagen Group of America, Inc.

Submission Date: MAY 20, 2016 NHTSA Recall No.: 16V-337

Manufacturer Recall No.: 01B5



#### **Manufacturer Information:**

Manufacturer Name: Volkswagen Group of America, Inc.

Address: 3800 Hamlin Road

Auburn Hills MI 48326

Company phone: 1-800-893-5298

# **Population:**

Number of potentially involved: 11 Estimated percentage with defect: 100 %

#### **Vehicle Information:**

Vehicle 1: 2016-2016 Volkswagen Golf R

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: Safety Certification Label

**Golf R: 11** 

Production Dates: MAR 17, 2016 - MAR 23, 2016

VIN Range 1: Begin: WVWUF7AUXGW275005 End: WVWUF7AU6GW279360 ☐ Not sequential

#### **Description of Noncompliance:**

Description of the The rear axle weight limit was incorrectly specified as 1234 lbs on the vehicle

Noncompliance: certification label. The correct specification is 2227 lbs.

FMVSS 1: NR

FMVSS 2: 567 - Certification

Description of the Safety Risk: Incorrect/implausible weight information could lead to overloading of the

vehicle as the customer may ignore the low value and is not able to determine

the correct maximum load. Overloading a vehicle could lead to vehicle

instability and may contribute to loss of vehicle control and result in a crash.

Description of the Cause: When new printing machines were installed in production, a programming

error caused the printer to use a default value instead of the correct weight

limit.

Identification of Any Warning NR

that can Occur:

### **Supplier Identification:**

# **Component Manufacturer**

Name: Volkswagen AG Address: Berliner Ring 2

Wolfsburg FOREIGN STATES 38436

**Country:** Germany

#### **Chronology:**

April 13, 2016: During routine quality inspection, misprinted labels were detected. April/Early May 2016: Issue was traced to new printer installation and affected population was determined. May 13, 2016: The issue was presented in Volkswagen's product safety committee and a determination of noncompliance was made.

#### **Description of Remedy:**

Description of Remedy Program: Vehicles will be recalled and the certification label will be corrected at no

cost to customers. Reimbursement program will not be required as no outof pocket expense for part repair/replacement is associated with this

action.

How Remedy Component Differs Labels corrected to show accurate weight information.

from Recalled Component:

Identify How/When Recall Condition Programming error was corrected on April 14, 2016.

was Corrected in Production:

#### **Recall Schedule:**

Description of Recall Schedule: Dealers: Anticipated May 2016

Customers: Anticipated May 2016

Planned Dealer Notification Date: NR - NR Planned Owner Notification Date: NR - NR

\* NR - Not Reported