OMB Control No.: 2127-0004

Part 573 Safety Recall Report

16V-376

Manufacturer Name: Volkswagen Group of America, Inc.

Submission Date: OCT 17, 2016 NHTSA Recall No.: 16V-376 Manufacturer Recall No.: 6901



Manufacturer Information:

Manufacturer Name: Volkswagen Group of America, Inc.

Address: 3800 Hamlin Road

Auburn Hills MI 48326

Company phone: 1-800-893-5298

Population:

Number of potentially involved : 8,381 Estimated percentage with defect : 100%

Vehicle Information:

Vehicle 1: 2009-2009 Audi A4 Sedan

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: A4 Sedan: 3,653

Production Dates: JUN 18, 2008 - SEP 13, 2008

VIN Range 1:Begin: WAULK78KX9A024137 End: WAUMK78K99A109362 Not sequential

Vehicle 2: 2009-2009 Audi A4 Avant

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: A4 Avant: 295

Production Dates: JUL 16, 2008 - SEP 22, 2008

Vehicle 3: 2009-2009 Audi Q5

Vehicle Type :
Body Style :
Power Train : NR
Descriptive Information : Q5: 412

Production Dates: NOV 15, 2008 - FEB 05, 2009

VIN Range 1:Begin: WA1KK78R39A006360 End: WA1KK78R69A028787 Not sequential

Vehicle 4: 2008-2009 Audi A5 Coupe

Vehicle Type : Body Style : Power Train : NR

Descriptive Information: A5 Coupe: 4,009

Production Dates: JUL 27, 2007 - FEB 10, 2009

VIN Range 1: Begin: WAURV78T68A005688 End: WAUDK78T09A042482 Not sequential

Vehicle 5: 2010-2010 Audi A5 Cabriolet

Vehicle Type : Body Style : Power Train : NR

Descriptive Information: A5 Cabriolet: 12

Production Dates: JUN 05, 2009 - JUN 15, 2009

VIN Range 1: Begin: WAUVGAFH4AN004879 End: WAULFAFH7AN005289 Not sequential

Description of Defect:

Description of the Defect: In certain vehicles, a power supply component in the airbag control unit may

corrode and cause the unit to fail.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: If the airbag control unit fails, safety systems such as seat belt pretensioners

and airbags may not deploy in the event of a crash, increasing the risk of

occupant injury.

Description of the Cause: Manufacturing defect of the airbag control unit power supply allows TiN

corrosion to develop and cause the airbag control unit to fail.

Identification of Any Warning Airbag indicator light illumination on instrument panel.

that can Occur:

Supplier Identification:

Component Manufacturer

Name: Continental Automotive Systems, Inc.

Address: 1 Continental Drive

Auburn Hills MICHIGAN 48326

Country: United States

Chronology:

February 03, 2016 - Continental Automotive Systems, Inc. filed 573 with NHTSA

February 23, 2016 - Provided presentation to the NHTSA in a face-to-face meeting to discuss this topic. NHTSA reviewed presentation.

April 05, 2016 - Presented additional information to NHTSA in a face-to-face meeting to discuss this topic. May 13, 2016 - Matter was presented to Audi AG Product Safety committee, and at that time a recall decision was made.

Description of Remedy:

Description of Remedy Program: At no cost to customers, Audi will replace the affected airbag control

module.

How Remedy Component Differs Power supply in the new airbag unit is not subject to TiN corrosion.

from Recalled Component:

Identify How/When Recall Condition Subsupplier ATMEL implemented a corrective action to prevent the

was Corrected in Production: corrosion from occurring.

Recall Schedule:

Description of Recall Schedule: NR

Planned Dealer Notification Date: OCT 25, 2016 - OCT 25, 2016 Planned Owner Notification Date: OCT 31, 2016 - OCT 31, 2016

^{*} NR - Not Reported