

Part 573 Safety Recall Report

16V-399

Manufacturer Name : WEST-MARK**Submission Date :** MAY 24, 2016**NHTSA Recall No. :** 16V-399**Manufacturer Recall No. :** 15E-017**Manufacturer Information :**

Manufacturer Name : WEST-MARK

Address : PO BOX 100

CERES CA 95307

Company phone : 999

Population :

Number of potentially involved : 7

Estimated percentage with defect : 3 %

Vehicle Information :

Vehicle 1 : 2014-2015 Semi Trailer Sugar Tank

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : Cargo Tank food grade trailer

Production Dates : OCT 01, 2014 - JUN 30, 2015

VIN Range 1 : Begin : 1W9TE4025FA488018 End : 1W9TE4029FA488023 Not sequentialVIN Range 2 : Begin : 1W9TE4029FA488121 End : 1W9TE4029FA488121 Not sequential**Description of Defect :**

Description of the Defect : Haldex Life seal Long stroke brake chamber replacement. Recall# 15E-017

FMVSS 1 : 121 - Air brake systems

FMVSS 2 : NR

Description of the Safety Risk : Increased risk of fire or overheating of brakes.

Description of the Cause : Rubber diaphragm is not completely attached in the park brake assembly of the brake chamber.

Identification of Any Warning that can Occur : discoloration of wheel ends identified during pre and post walk around inspections.

Supplier Identification :**Component Manufacturer**

Name : Haldex Brake Products Corporation
Address : 10930 N. Pamona Ave.
Kansas City MISSOURI 64153
Country : United States

Chronology :

Manufactured between 12-17-2013 & 2-18-2015

Description of Remedy :

Description of Remedy Program : The program for providing remedy without charge to Foster Farms for the defect is as follows; all defective Life Seal chambers long stroke chambers are to be replaced with Haldex Gold Seal 30/30 long stroke chambers. Haldex is providing the replacement chamber and will reimburse the labor to switch the part.

How Remedy Component Differs from Recalled Component : The defective part numbers on the Identification tag of the chamber are C-24165-2 or C24225-2 or C-30685-1

Identify How/When Recall Condition was Corrected in Production : This was corrected through our suspension supplier Hendrickson Turner on 6/30/2015.

Recall Schedule :

Description of Recall Schedule : Official owner letter sent out on 5-12-2016 certified mail.
Planned Dealer Notification Date : NR - NR
Planned Owner Notification Date : MAY 24, 2016 - MAY 31, 2016

* NR - Not Reported