

# Part 573 Safety Recall Report

# 16V-432

**Manufacturer Name :** KZRV, L.P.**Submission Date :** JUN 09, 2016**NHTSA Recall No. :** 16V-432**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : KZRV, L.P.

Address : 0985 N 900W

Shipshewana IN 46565

Company phone : 260-768-4016

**Population :**

Number of potentially involved : 61

Estimated percentage with defect : 100 %

**Vehicle Information :**

Vehicle 1 : 2016-2017 KZRV Spree

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : KZRV Spree Travel Trailer

Production Dates : MAR 13, 2015 - MAY 03, 2016

VIN Range 1 : Begin : 4EZTP3325G8034050 End : 4EZTP332XH8054988  Not sequential**Description of Defect :**

Description of the Defect : The affected vehicles are equipped with refrigerator vents installed in an improper location.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : An improperly located vent location may cause the refrigerator compartment to overheat which would trigger the high temperature sensor and result in the refrigerator shutting down. If the high temperature sensor on the refrigerator fails to shut the refrigerator down there could be a risk of fire.

Description of the Cause : When the units were ordered with an optional 12 cu. Foot refrigerator, the refrigerator exhaust vent was not repositioned and the upper internal baffle may be too low.

Identification of Any Warning that can Occur : None

**Supplier Identification :****Component Manufacturer**

Name : NR  
Address : NR  
NR  
Country : NR

**Chronology :**

June 1, 2016 – As a result of a call report from a dealership reporting shutdown of refrigerators on two units, it was determined the vent placement was improper.  
June 2, 2016 – An audit was completed reviewing models, prints and production records.  
June 6, 2106 – A decision was made to issue a recall to remedy the defect on the affected trailers.

**Description of Remedy :**

Description of Remedy Program : A larger refrigerator vent will be installed on the affected units, in addition the internal baffle will be extended, if necessary. This will be done at no cost to the owner.

How Remedy Component Differs from Recalled Component : The larger vent and proper baffle placement will correct the venting and risk of overheating.

Identify How/When Recall Condition was Corrected in Production : N/A

**Recall Schedule :**

Description of Recall Schedule : KZ RV will notify the dealers and owners of the recreational vehicles by letter. A final copy of the owner letter will be provided to NHTSA, along with the dealer repair procedures.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

\* NR - Not Reported