The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

| Hyundai Motor America |
|-----------------------|
| MAR 03, 2017 |
| 16V-615 |
| 148 |
| |

Manufacturer Information :

Manufacturer Name : Hyundai Motor America Address : 10550 Talbert Avenue Fountain Valley CA 92708 Company phone : 800-633-5151

Vehicle Information :

| | 2016-2016 Hyundai Sonata | | |
|---------------------------|--|--|--|
| Vehicle Type : | LIGHT VEHICLES | | |
| Body Style : | 4-DOOR | | |
| Power Train : | GAS | | |
| Descriptive Information : | Certain Model Year 2016 Hyundai Sonata vehicles manufactured at Hyundai Motor Manufacturing Alabama produced beginning on March 28, 2016 through April 12, 2016. | | |
| Production Dates : | MAR 28, 2016 - APR 12, 2016 | | |
| VIN Range 1: | Begin : NR End : NR Not sequential | | |

Population :



Number of potentially involved : 1,031

Estimated percentage with defect :

NR

16V-615

Part 573 Safety Recall Report

Description of Noncompliance :

| Description of the | The 2016 model year Hyundai Sonata is equipped with an airbag system that is |
|----------------------------------|---|
| Noncompliance : | designed to meet the advanced airbag requirements of FMVSS No. 208. During |
| | NHTSA's Office of Vehicle Safety Compliance evaluations of 2016 model year |
| | Hyundai Sonata, some results exceeded the Nte (tension-extension) component |
| | of the Nij neck injury parameter as defined in S26.3 when tested under the |
| | procedures of S26.3 (the driver position fifth percentile female unbelted low |
| | risk deployment). |
| | This condition affects airbag modules produced for and equipped in certain |
| | model year 2016 Hyundai Sonata vehicles produced at Hyundai Motor |
| | Manufacturing Alabama beginning on March 28, 2016 through April 12, 2016. |
| FMVSS 1 : | 208 - Occupant crash protection |
| FMVSS 2 : | NR |
| Description of the Safety Risk : | Noncompliance with FMVSS No. 208, S26.3. |
| Description of the Cause : | Testing by Hyundai and its suppliers has confirmed the Nij neck injury readings observed during the subject testing are due to a specific lot of airbag inflator modules. |
| Identification of Any Warning | None |
| that can Occur : | |
| | |

Supplier Identification :

Component Manufacturer

| Name : | Hyundai Mobis USA |
|-----------|---------------------------------|
| Address : | 7000 19 Mile Road |
| | Sterling Heights MICHIGAN 48314 |
| Country : | United States |

Part 573 Safety Recall Report

16V-615

Chronology:

From July 11, 2016 through August 9, 2016, NHTSA's Office of Vehicle Safety Compliance tested a 2016 model year Hyundai Sonata. NHTSA's testing produced inconsistent Nte results described by FMVSS 208 S26.3.

On August 19, 2015, Hyundai filed an initial noncompliance report for Sonata vehicles produced at Hyundai Motor Manufacturing Alabama beginning on February 25, 2016 through May 11, 2016. Due to limited FMVSS 208 S26.3 test data availability at the time the initial noncompliance report was filed, a larger group of vehicles were identified as being potentially noncompliant. This was because a detailed investigation into potentially suspect airbag inflator lots had not been completed. Subsequent testing has since been conducted by Hyundai and its suppliers, and modules with inflators from a specific lot has been identified as being noncompliant. Other inflator lots were tested and are compliant with S26.3 of FMVSS No. 208. Therefore, the affected Sonatas produced at Hyundai Motor Manufacturing Alabama from March 28, 2016 through April 12, 2016 are being recalled. Hyundai is amending this noncompliance report to reflect the updated test data and correct the affected units.

Hyundai is not aware of any accidents or injuries related to this condition.

Description of Remedy :

| Description of Remedy Program : | Hyundai Motor America will notify all owners of affected vehicles to return to their Hyundai dealer to replace the driver's front airbag module. | |
|--|---|--|
| | Hyundai will provide reimbursement to owners for repairs according to the plan submitted on November 2, 2014. | |
| How Remedy Component Differs from Recalled Component : | | |
| dentify How/When Recall Condition was Corrected in Production : | | |
| | | |

Recall Schedule :

1

| Description of Recall Schedule : | NR |
|------------------------------------|-----------------------------|
| Planned Dealer Notification Date : | OCT 14, 2016 - OCT 14, 2016 |
| Planned Owner Notification Date : | OCT 14, 2016 - OCT 14, 2016 |

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573