

Part 573 Safety Recall Report

16V-616

Manufacturer Name : Eldorado National-Kansas**Submission Date :** AUG 22, 2016**NHTSA Recall No. :** 16V-616**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Eldorado National-Kansas

Address : 1655 Wall Street

Salina KS 67401

Company phone : (913) 392-2171

Population :

Number of potentially involved : 320

Estimated percentage with defect : NR

Vehicle Information :

Vehicle 1 : 2011-2016 Ford/Navistar Aero Elite 300/320

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style :

Power Train : NR

Descriptive Information : The affected vehicles may be assembled with an Intermediate Side Marker Lamp that does not meet the device activation requirements as outlined in FMVSS 108 Table I-a-Required Lamps and Reflective Devices; specifically Additional Lamps and Reflective Devices Required on All Passenger Cars, Multipurpose Passenger Vehicles (MPV), Trucks, and Buses, 30 Feet and Longer. Intermediate Side Marker Lamps per FMVSS 108 must be:

> Steady Burning.

> Must be activated when the headlamps are activated in a steady burning state.

Production Dates : JUN 27, 2011 - JUN 09, 2016

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Noncompliance :**

Description of the Noncompliance : The Intermediate Side Lamp may not be steady burning when the headlamps are activated, as required by FMVSS 108.

FMVSS 1 : 108 - Lamps, reflective devices, and assoc. Equipment

FMVSS 2 : NR

Description of the Safety Risk : If an Intermediate Side Marker Lamp is not illuminated when the headlamps are activated, vehicle visibility can be decreased to other drivers, increasing the risk of a crash.

Description of the Cause : A single element Intermediate Side Lamp may have been installed and wired to operate as a turn signal.

Identification of Any Warning that can Occur : The Intermediate Side Lamp may not illuminate when the headlamps are activated.

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

June 9, 2016:

EIDorado quality inspection identified that the intermediate side lamp installed may not be a dual filament lamp when a side turn signal lamp option is ordered by the customer.

June 17, 2016:

Completed an inspection of completed vehicle inventory and in-production vehicle inventory, and results indicated no further inventory demonstrated the intermediate side marker lamp was not functioning as required.

June 20, 2016 to July 22, 2016:

EIDorado completed further investigation and determined that an FMVSS 108 non-compliance may exist and decided to conduct a non-compliance recall campaign.

July 27, 2016:

As of July 27, 2016, EIDorado has received no warranty claims, no field reports, and no reports of injury related to this non-compliance.

Description of Remedy :

Description of Remedy Program : EIDorado will notify Dealers and vehicle owners. Dealers will inspect the Intermediate Side Lamps, replacing the lamps as necessary, free of charge. The recall is expected to begin in September 2016.

How Remedy Component Differs from Recalled Component : If the Intermediate Side Lamps are replaced, the lamps will be a surface mount dual filament lamp.

Identify How/When Recall Condition was Corrected in Production : Completed an inspection of completed vehicle inventory and in-production vehicle inventory from June 10, 2016 - June 17, 2016. Inspection results indicated no further inventory demonstrated the intermediate side marker lamp not functioning as required by FMVSS 108.

Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

* NR - Not Reported