#### OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

# 16V-726

Manufacturer Name: Hyundai Motor America

NHTSA Recall No.: 16V-726

Manufacturer Recall No.: 152



#### **Manufacturer Information:**

Manufacturer Name: Hyundai Motor America

Address: 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone: 800-633-5151

# **Population:**

Number of potentially involved: 62,811 Estimated percentage with defect: NR

#### **Vehicle Information:**

Vehicle 1: 2015-2016 Hyundai Sonata Hybrid

Vehicle Type: LIGHT VEHICLES

Body Style: 4-DOOR

Power Train: HYBRID ELECTRIC

Descriptive Information: Certain Model Year 2015 and 2016 Hyundai Sonata hybrid sedans produced at

Hyundai Motor Company beginning on December 08, 2014 through August 18, 2015.

Production Dates: DEC 08, 2014 - AUG 18, 2015

Vehicle 2: 2015-2016 Hyundai Sonata

Vehicle Type: LIGHT VEHICLES

Body Style: 4-DOOR Power Train: GAS

Descriptive Information: Certain Model Year 2015 and 2016 Hyundai Sonata sedans produced at Hyundai

Motor Manufacturing Alabama beginning on May 28, 2014 through March 18, 2016.

Production Dates: MAY 28, 2014 - MAR 18, 2016

VIN Range 1 : Begin : NR End : NR Not sequential

#### **Description of Defect:**

Description of the Defect: Potential detachment of the tempered glass sunroof panel on Hyundai Sonatas

equipped with the panoramic sunroof option.

Hyundai is not aware of any reports of accidents or injuries related to this

condition.

FMVSS 1: NR FMVSS 2: NR Description of the Safety Risk: If the sunroof panel detaches while the vehicle is in motion, the panel could

become an obstacle to other drivers, increasing the risk of a crash.

Description of the Cause: The sunroof assembly incorporates a wind deflector at the front of the sunroof

to reduce wind noise in the passenger compartment when the sunroof is open. Certain vehicles may have insufficient bonding of the wind deflector anchor plate. If the wind deflector becomes partially detached from its mounting points after the sunroof is opened, it can interfere with the moveable sunroof panel while the sunroof is being closed. The tempered glass sunroof panel can detach from the sunroof assembly due to interference with the wind deflector,

or if the customer tries to force the sunroof panel closed.

Identification of Any Warning a. Increased noise due to a loose wind deflector

that can Occur: b. Inability to fully close the sunroof

## **Supplier Identification:**

## **Component Manufacturer**

Name: Webasto Donghee

Address: 6, Cheoyongsanup-ro Onsan-eup

Ulju-gun, Ulsan-city FOREIGN STATES 44993

Country: Korea, Republic of

#### **Chronology:**

See attached document: "2015-2016 Sonata Panoramic Sunroof Chronology."

# **Description of Remedy:**

Description of Remedy Program: Hyundai Motor America will notify all owners of affected vehicles by first

class mail to return to their Hyundai dealer to repair the wind deflector

anchor plate.

Notification letters will be mailed while the affected vehicles are covered by Hyundai's New Vehicle Limited Warranty. All affected vehicle owners

for this recall would have been provided a repair at no cost under

Hyundai's warranty.

How Remedy Component Differs Revised bonding of the wind deflector anchor plate. from Recalled Component:

Identify How/When Recall Condition Application of the revised bonding of the wind deflector anchor plate.

was Corrected in Production: Application dates vary by trim level and color.

## **Recall Schedule:**

Description of Recall Schedule: NR

Planned Dealer Notification Date : DEC 02, 2016 - DEC 02, 2016 Planned Owner Notification Date : DEC 02, 2016 - DEC 02, 2016

<sup>\*</sup> NR - Not Reported