

# Part 573 Safety Recall Report

# 16V-796

**Manufacturer Name :** Jaguar Land Rover North America, LLC

**Submission Date :** OCT 27, 2016

**NHTSA Recall No. :** 16V-796

**Manufacturer Recall No. :** J077



## Manufacturer Information :

## Population :

**Manufacturer Name :** Jaguar Land Rover North America, LLC

**Number of potentially involved :** 5,081

**Address :** 555 MACARTHUR BOLULEVARD

**Estimated percentage with defect :** 100 %

MAHWAH NJ 07430

**Company phone :** 201-760-8534

## Vehicle Information :

**Vehicle 1 :** 2013-2015 JAGUAR XF

**Vehicle Type :** LIGHT VEHICLES

**Body Style :** 4-DOOR

**Power Train :** GAS

**Descriptive Information :** 2013-2015 MY Jaguar XF Vehicles in select VIN range

**Production Dates :** MAY 22, 2013 - JUN 15, 2015

**VIN Range 1 : Begin :** SAJWA0ES1DPS92130 **End :** SAJWA0FS7FPU88784  Not sequential

## Description of Defect :

**Description of the Defect :** A concern has been identified where the installation of the fuel delivery line assembly on Jaguar XF 2.0L GTDi 2013 to 2015MY vehicles does not meet the intended fuel delivery line clearances as stated in Jaguar Land Rover's design rule standard. This has resulted in insufficient clearance between the underfloor fuel delivery lines and vehicle under shield and body leading to a chafe condition.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** The customer may detect a fuel smell inside the vehicle and when the vehicle is parked the customer may notice a pooling of fuel underneath the vehicle, which in the presence of an ignition source could lead to a fire.

**Description of the Cause :** NR

**Identification of Any Warning that can Occur :** NR

**Supplier Identification :****Component Manufacturer**

Name : Coopers Standard  
Address : NR  
FOREIGN STATES  
Country : Czech Republic

**Chronology :**

See Document "JLR J077 Chronology".

**Description of Remedy :**

Description of Remedy Program : Owners will be notified and instructed to take their vehicle to an approved Jaguar dealer who will inspect the condition of the fuel delivery lines. On certain vehicles, the presence of an anti-abrasion sleeve will be checked. Where a sleeve is not present the dealer will replace the fuel delivery line assembly for one that includes an anti-abrasion sleeve and install two additional clips to ensure the correct clearance is achieved.

If no chafing damage is noted on fuel lines with the anti-abrasive sleeve, the dealer will install two additional clips to ensure correct fuel delivery line clearances are maintained. If damage is noted, the dealer will install a new fuel delivery line assembly and add two additional clips to ensure the correct clearance is achieved.

There will be no charge to owners for this repair.

Customers who have paid for a repair of this defect will be subject to the Jaguar Land Rover's reimbursement plan, dependant on certain terms and conditions.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : Distribution of owner notification letters will occur on or before December 19, 2016. Notifications to dealers will occur on November 1, 2016.

Planned Dealer Notification Date : NOV 01, 2016 - NOV 01, 2016

Planned Owner Notification Date : DEC 19, 2016 - DEC 19, 2016

\* NR - Not Reported