

Part 573 Safety Recall Report

16V-843

Manufacturer Name : Hyundai Motor America

Submission Date : NOV 16, 2016

NHTSA Recall No. : 16V-843

Manufacturer Recall No. : 154



Manufacturer Information :

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 800-633-5151

Population :

Number of potentially involved : 41,264

Estimated percentage with defect : NR

Vehicle Information :

Vehicle 1 : 2007-2008 Hyundai Entourage

Vehicle Type : LIGHT VEHICLES

Body Style : VAN

Power Train : GAS

Descriptive Information : Model Year 2007 and 2008 Hyundai Entourage vehicles produced beginning on February 16, 2006 through June 30, 2008.

Production Dates : FEB 16, 2006 - JUN 30, 2008

VIN Range 1 : Begin :

NR

End : NR

Not sequential

Description of Defect :

Description of the Defect : The subject vehicles are equipped with a secondary hood latch. This latch may become corroded over time and cause the latch to remain in the open position when the hood is closed.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the hood is not securely closed or the primary hood latch is released while driving, the hood may open and obscure the driver's vision, increasing the risk of a crash.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :

Component Manufacturer

Name : Pyeong Hwa Automotive
Address : 392, Seongseo 4cha cheomdan-Ro
Dalseo-Gu Daegu FOREIGN STATES 42724
Country : Korea, Republic of

Chronology :

Refer to attached "2007-2008 Hyundai Entourage Secondary Hood Latch Chronology.pdf"

Description of Remedy :

Description of Remedy Program : Hyundai Motor America will notify all owners of affected vehicles via first class mail to return to their Hyundai dealers. Dealers will be instructed to replace the secondary latch in those vehicles originally sold in or currently registered in Alaska, Connecticut, Delaware, Illinois, Indiana, Iowa, Kansas, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, Nebraska, New Hampshire, New Jersey, New York, North Dakota, Ohio, Pennsylvania, Rhode Island, South Dakota, Utah, Vermont, West Virginia, Wisconsin, and the District of Columbia with a revised component.

The secondary latches in vehicles that were not originally sold or are not currently registered in one of the states above will be inspected and replaced if necessary. If a replacement is not warranted, the dealer will clean and lubricate the secondary latch.

Hyundai will provide reimbursement to owners for repairs according to the plan submitted on November 16, 2016.

How Remedy Component Differs from Recalled Component : The revised component incorporates enhanced corrosion coating.

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : NR
Planned Dealer Notification Date : NOV 23, 2016 - NOV 23, 2016
Planned Owner Notification Date : DEC 09, 2016 - DEC 09, 2016

* NR - Not Reported