

Part 573 Safety Recall Report

16V-865

Manufacturer Name : Livin' Lite Recreational Vehicles**Submission Date :** NOV 23, 2016**NHTSA Recall No. :** 16V-865**Manufacturer Recall No. :** NR**Manufacturer Information :****Population :**

Manufacturer Name : Livin' Lite Recreational Vehicles

Number of potentially involved : 86

Address : 1025 E. Waterford

Estimated percentage with defect : 100 %

WAKARUSA IN 46573

Company phone : 999

Vehicle Information :

Vehicle 1 : 2017-2017 Livin Lite Camplight

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : 2017 Livin Lite RV Trailers, Toyhaulers, and Truck Campers

Production Dates : MAY 19, 2016 - NOV 18, 2016

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Vehicle 2 : 2017-2017 Livin Lite Quick Silver

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : 2017 Livin Lite Quick Silver RV Trailers, Toyhaulers, and Truck Campers.

Production Dates : MAY 19, 2016 - NOV 18, 2016

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : The rubber LP gas line that connects to the range is hooked up directly through the cook top fire box to the pilot, there should have been a 12" hard pipe between the rubber flex hose and the pilot connection.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : There is a risk of the rubber LP gas line getting too hot and melting which could start a fire.

Description of the Cause : Livin Lite had switched to a new style of cook top from Suburban versus a Dometic product. The Dometic product came standard with a hard pipe from

the pilot to outside the fire box whereas the modeled ordered from Suburban did not. A 12" copper tail piece was not added as required.

Identification of Any Warning that can Occur : There could be a smell of gas at the cook top or excessive flame up from under the cook top.

Supplier Identification :

Component Manufacturer

Name : NR
Address : NR
NR
Country : NR

Chronology :

On 11/18/16, production was installing counter tops, the Group Leader from floors was helping and noticed that the rubber line did not have a 12" hard pipe going into the cook top as required. The rest of the line and also the yard was checked for missing hard piping. All units onsite that were checked and found to be wrong were corrected and re-tested.

On 11/19/16 - The issue was reviewed and the decision to recall the field units was made.

Description of Remedy :

Description of Remedy Program : A 12" copper extension will be made up with fittings on both ends so that rubber gas line can be disconnected then reconnected properly. Then the system will then be rechecked for LP leaks.

How Remedy Component Differs from Recalled Component : The presence of a 12" copper LP gas line in the cook top.

Identify How/When Recall Condition was Corrected in Production : Once found, all units onsite were inspected and corrected. The 12" copper line has been implemented online as of 11/19/16.

Recall Schedule :

Description of Recall Schedule : Livin Lite will notify the dealers and owners of the recreational vehicles by letter. A final copy of the owner letter will be provided to NHTSA, along with the dealer repair procedures.

Planned Dealer Notification Date : DEC 19, 2016 - NR

Planned Owner Notification Date : DEC 19, 2016 - NR

* NR - Not Reported