

Part 573 Safety Recall Report

16V-897

Manufacturer Name : Triple E Recreational Vehicles

Submission Date : DEC 12, 2016

NHTSA Recall No. : 16V-897

Manufacturer Recall No. : CA #8495-1



Manufacturer Information :

Manufacturer Name : Triple E Recreational Vehicles

Address : PO Box 1230 Winkler MB

Canada 00 R6W 4C4

Company phone : 204-325-4361

Population :

Number of potentially involved : 18

Estimated percentage with defect : 100 %

Vehicle Alterer Information :

Vehicle 1 : 2017-2017 SERENITY S24CB

Descriptive Information : THE CIRCUIT LEADING FROM THE COACH POWER SYSTEM TO THE BATTERY IS A 4AWG WIRE AND IS CONNECTED TO A 150 AMP FUSE WHILE IT IS ONLY RATED TO CARRY A POTENTIAL LOAD MAXIMUM OF 120 AMPS.

Production Dates : JUN 01, 2016 - NOV 23, 2016

Description of Defect :

Description of the Defect : THE CIRCUIT LEADING FROM THE COACH POWER SYSTEM TO THE BATTERY IS A 4AWG WIRE AND IS CONNECTED TO A 150 AMP FUSE WHILE IT IS ONLY RATED TO CARRY A POTENTIAL LOAD MAXIMUM OF 120 AMPS.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : IF THERE IS AN OVERLOAD ON THE COACH POWER SYSTEM WIRE, THERE IS A RISK OF POTENTIAL FIRE.

Description of the Cause : THE WIRES HAVE BEEN SWITCHED AT THE FUSE BLOCK.

Identification of Any Warning that can Occur : NR

Supplier Identification :**Component Manufacturer**

Name : NR
Address : NR
NR
Country : NR

Chronology :

AN IN-HOUSE INSPECTION OF QUALITY CONTROL WAS PERFORMED AND WAS NOTICED IN THE PRODUCTION STAGES.

Description of Remedy :

Description of Remedy Program :	DEALERS & RETAIL OWNERS ARE ASKED TO FOLLOW THE INSTRUCTIONS PROVIDED TO SWITCH THE WIRES AT THE FUSE HOLDER. RETAIL OWNERS WILL HAVE THE OPTION TO HAVE AN RV SERVICE CENTER PERFORM THIS RECALL. THEY MAY POSSIBLY BE CHARGED A FEE TO HAVE THIS COMPLETED, THE OWNER INTURN WILL BE REIMBURSED BY TRIPLE E RV OR THE RV SERVICE CENTER WILL BE PAID DIRECTLY BY TRIPLE E RV.
How Remedy Component Differs from Recalled Component :	THE 4AWG WIRE WILL BE ON THE POLE 2ND FROM THE RIGHT AND THE 1/0AWG WIRE WILL BE ON THE POLE ON THE FURTHIEST RIGHT SIDE.
Identify How/When Recall Condition was Corrected in Production :	IMMEDIATE CHANGE ON PRODUCTION UNITS TOOK PLACE AND FURTHER EDUCATION WAS GIVEN TO NEW EMPLOYEES.

Recall Schedule :

Description of Recall Schedule : NR
Planned Dealer Notification Date : DEC 21, 2016 - DEC 21, 2016
Planned Owner Notification Date : DEC 21, 2016 - DEC 21, 2016

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name :

Address :

Country :

Company Phone :

* NR - Not Reported