

Part 573 Safety Recall Report**16V-905****Manufacturer Name :** Jayco, Inc.**Submission Date :** DEC 13, 2016**NHTSA Recall No. :** 16V-905**Manufacturer Recall No. :** 9903340**Manufacturer Information :**

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

Population :

Number of potentially involved : 680

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2016-2016 Class A Motor home Alante and Precept

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style :

Power Train : NR

Descriptive Information : 2016 Alante G1AY0065-0110 G1AX0070-0150 G1AL0098-0131 G1AV0119-0180
G1AN0051 G1AM0052-00552016 Precept G1UL0142-0395 G1UR0083-0148 G1UP0071-00852 G1US0056-0197
G1UN0077-0088

Production Dates : AUG 10, 2015 - MAR 15, 2016

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : Wiring installation for the entrance step may be incorrect creating the possibility the step could retract on its own.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Occupant exiting motorhome with out steps present, may fall, resulting in personal injury.

Description of the Cause : Incrct routing of the step wiring under the door threshold, positions the wires in area that may allow them to be pinched/cut by the sharp edge of the door threshold - creating a ground connection that would activate the step to retract on its own.

Identification of Any Warning NR
that can Occur :

Supplier Identification :**Component Manufacturer**

Name : NR
Address : NR
NR
Country : NR

Chronology :

9-29-16 Jayco Consumer Affairs Group opened investigation regarding report of an entrance step retracting on its own. Internal Investigation did not find any other contacts, claims , reports of steps retracting on there own. 10-13-16 LCI (vondor of step) was contacted - no cause or correction was determined through vendor response 12-8-2016 LCI and Jayco Consumer Affairs inspected motorhome step reported to retracting on its own - inspection found installation of step wiring was incorrect, not as specified on production line 12-9-16 Jayco decided that a recall is required to inspect other motorhomes for incorrect wiring of the step.

Description of Remedy :

Description of Remedy Program : Jayco Dealers will inspect the entrance step for correct wiring, if found to be under the door threshold, the wiring will be removed and step will be rewired routing the wires 1-2 inches above the floor. All at no charge to the current owner of the motorhome.

How Remedy Component Differs from Recalled Component : Incrct route of wiring is under the door threshold.. correct route of wiring for the entrance step is through hole 1-2 inches above the floor and through the sidewall of the motor home.

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : NR
Planned Dealer Notification Date : NR - NR
Planned Owner Notification Date : NR - NR

* NR - Not Reported