Next Unread Message

View Message

Sent on	05 16 2017 Expires on 08 13 2017		
From	Brad Ortloff, Manager of Campaign Administration		
Subject	07-11 CR-V Passenger's Airbag Inflator Kit-INSPECT BEFORE INSTALLATION-UPDATE		

Date: May 16, 2017

To: All Honda Parts & Service Managers, Advisors and Personnel

From: Brad Ortloff, Manager of Campaign Administration

Subject: 2007-11 CR-V Front Passenger's Airbag Inflator Kit - INSPECT BEFORE INSTALLATION-UPDATE

Yesterday, May 15th, American Honda identified a concern with the following airbag inflator kit:

Part Number	Part Description	Action
		Inspect Before
04790-SWA-407	2007-11 CR-V Front Passenger's Airbag Inflator Kit	Installation

This kit is part of service bulletins:

16-048: Safety Recall: Takata Front Passenger's Airbag Inflator (Phase 1); and

17-002: Safety Recall: Takata Front Passenger's Airbag Inflator (Phase 2)

Prior to beginning repair on any 2007-11 CR-V vehicle with part number 04790-SWA-407, ensure that the wire harness included in the kit is correct according to the attached image.

Today, we are requesting an additional inspection procedure to ensure that you are using a good inflator kit.

- The yellow wire should measure 225mm and the red wire should be 530mm (image attached).
- The incorrect wire harness will also have a black felt tape around the red wire near the 2 pin prong that is in the center of the wire harness (image attached).
- Do **not** replace the incorrect harness with a harness from another kit; you **must** keep the incorrect harness within the inflator kit packaging that it was originally shipped.
- If the harness does not match the correct images, keep the kit separate from your other stock and email the following information to ahm_inflator_swap@ahm.honda.com with the subject line "PN 04790-SWA-407 Harness Issue":
 - Dealer #
 - Dealer Contact Info
 - Part Number (should be 04790-SWA-407)
 - Kit Lot Date (on Honda Label on outside of box)
 - Kit Serial # (on white label on outside of box)
- If the wire harness is correct, you may proceed accordingly and install the inflator kit per the applicable service

INTERACTIVE NETWORK

bulletin. Please continue to repair vehicles using good inflator kits.

Please click here for the attached image.

Thank you very much for your understanding and cooperation!





This is the incorrect wiring harness. The yellow wire was INCORRECTLY installed.
(DO NOT USE!)





