

[Next Unread Message](#)[View Message](#)

Sent on	05	26	2016	Expires on	06	17	2016
From	Motorcycle National Field Service						
Subject	STOP SALE NOTICE: 2006-2010 GL1800-8A (Airbag Type)						

STOP SALE NOTICE

Dear Honda Dealer:

Honda is launching a SAFETY RECALL on certain model year 2006-2010 GL1800-8A (Airbag type) motorcycles to replace the airbag module. The airbag module in affected motorcycles includes a potentially defective inflator manufactured by Takata.

According to National Highway Transportation Administration (NHTSA) equipment defect notifications (16E-042 and 16E-043) filed by Takata, the propellant in some of the subject inflators may degrade over time, which could lead to over-aggressive combustion in the event the airbag is activated during a crash. Overly aggressive combustion creates excessive internal pressure within the inflator, which may cause the inflator body to rupture. In the event of an inflator rupture, metal fragments could pass through the airbag cushion material possibly causing serious injury or fatality to the motorcycle rider or passenger.

Effective immediately, YOU MUST NOT SELL any NEW or USED 2006-2010 GL1800-8A (Airbag type) motorcycles.

AFFECTED UNITS

Certain 2006-2010 GL1800-8A (Airbag type)

Use *Unit Information* on *iN* to determine if this recall applies to a specific unit.

CUSTOMER NOTIFICATION

AHM intends to mail recall notification letters to owners of affected motorcycles as early as possible, subject to State registration information.

- The customer will be informed that parts are not currently available to replace the airbag module. If the customer is not comfortable riding their motorcycle in its normal configuration, they will be offered an alternative solution until repair parts become available.
- AHM will mail a second recall notification letter to customers with affected motorcycles when the redesigned airbag modules become available in the fall of 2016.

DEALER INVENTORY

Use *Unit Information* on *iN* to determine if this recall applies to a specific unit.

Until redesigned parts become available for repairs, affected units cannot be sold.

- An alternative solution will be available late June 2016.

PARTS INFORMATION

Redesigned airbag modules to repair affected motorcycles will be available in the fall of 2016.

SERVICE BULLETIN

Service Bulletin GL1800 #24, which includes the affected VIN information and an alternative solution, will be published late June 2016.

Make sure all departments in your dealership are aware of this action.

If you have any questions, please contact AHM TechLine through TechLine Connect on *iN* or contact your District Service Manager.

Sincerely,
American Honda Motor Co., Inc.

Bradley Little
Manager, National Field Service
Motorcycle Division
Bulletin #: 16-0162