

TECHNICAL BULLETIN

J061NAS1

09 JUN 2016



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 303-05

Safety Recall: Accessory Drive Belt Idler Pulley

AFFECTED VEHICLE RANGE:

XF (X250)

Model Year: 2013-2015

VIN: S51675-U88784

Assembly Plant: Castle Bromwich

GTDi 2.0L Petrol

MARKETS:

NAS

CONDITION SUMMARY:

Situation: An issue has been identified on a limited number of vehicles fitted with the 2.0L GTDi engine within the Affected Vehicle Range where a bolt retaining the accessory drive belt idler pulley may fail leading to a loss of accessory drive. As a result, the driver may experience battery charge warning lamp illumination, air conditioning failure, and engine overheat warnings through coolant pump loss of drive. They may also notice an engine Malfunction Indicator Light (MIL) on the Instrument Cluster followed by a reduction in steering assistance; however, vehicle steering will remain functional with increased steering effort required.

If the driver experiences a sudden increase in steering effort they may not be able to react to a manoeuvre as quickly as required. This could increase the risk of a vehicle crash.

Action: Retailers are required to **HOLD** affected new vehicles that are within your control and refrain from releasing the vehicles for **new vehicle sale** pending completion of the Service Instruction detailed in this Technical Bulletin. Unsold vehicles should have this performed as part of the Pre-Delivery Inspection (PDI) process but **must** have it completed prior to vehicle handover to the customer.

Affected vehicles already in the hands of customers should be updated at the next available opportunity.

PARTS:



NOTE: Retailers are requested to place orders following the restricted parts order guidelines by providing VIN numbers for parts orders. Jaguar will be temporarily managing restricted parts orders to help maintain parts availability for all retailers.

DESCRIPTION	PART No./SUNDRY CODE	QTY./VALUE	EXPECTED % of VEHICLES REQUIRING PARTS
Accessory drive belt idler pulley	C2D51409	1	100

SPECIAL TOOLS:

Refer to Workshop Manual/Service Instruction for any required tools.

WARRANTY:



NOTE: Check DDW to ensure that a vehicle is affected by this program prior to undertaking any rework action.

At the time of confirming a booking for vehicle repair, ensure that all outstanding Recalls and Service Actions are identified to ensure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Warranty claims must be submitted quoting Program Code **J061** together with the relevant Option Code from the table. SRO and parts information is included for information only. The Option Code(s) that allows for the drive in / drive out allowance can only be claimed if the vehicle is brought back into the workshop for this action alone to be undertaken.

Warranty claims must be submitted or payment within 30 calendar days of completion of the repair.

Repair procedures are under constant review and therefore times / prices are subject to change; those quoted here must be taken as guidance only. Refer to TOPIx to obtain the latest repair time.

PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)	PARTS/SUNDRY CODE	QTY./VALUE
J061	B	Renew the accessory drive belt idler pulley - Right	12.10.39	0.10	C2D51409	1
J061	C	Renew the accessory drive belt idler pulley - Right Drive in/drive out	12.10.39 10.10.10	0.10 0.20	C2D51409	1

Normal Warranty policies and procedures apply.

SERVICE INSTRUCTION:

1. Install a new Accessory Drive Belt Idler Pulley - Right (see TOPIx Workshop Manual section 303-05E / -05F: Accessory Drive).