
	<b>GROUP</b> <b>Safety Recall Campaign</b>	<b>MODEL</b> <b>2015~2016MY K900 (KH)</b>
	<b>NUMBER</b> <b>SC 130</b>	<b>DATE</b> <b>May 2016</b>
<b>VOLUNTARY SAFETY RECALL CAMPAIGN</b>		
<b>SUBJECT:           MULTI-FUNCTION SWITCH REPLACEMENT (SC 130)</b>		

This bulletin provides the procedure to replace the Multi-Function Switch (see below) in certain 2015~2016MY K900 (KH) Luxury V8 vehicles, equipped with LED Headlights, and produced from December 18, 2013 through January 11, 2016. Use of the headlights in AUTO mode over time may result in increased electrical resistance of the contact points, which in turn may affect the operation of the Electronic Control Unit located inside the Multi-Function Switch. If this occurs, the headlights may flicker and/or intermittently turn off while driving. To correct this condition, follow the procedure outlined in this bulletin. Before conducting the procedure, verify the vehicle is included in the list of affected VINs.

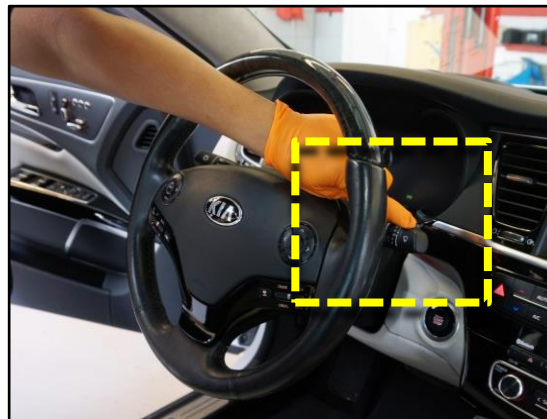

**\* NOTICE**

There is no charge to the vehicle owner for this repair. Under applicable law, you may not sell or otherwise deliver any affected vehicle until it has been repaired pursuant to the procedures set forth in this bulletin.

**\* NOTICE**

To assure complete customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service > Warranty Coverage >Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.

File Under: <Voluntary Safety Recall>

- 
- Circulate To:       General Manager       Service Manager       Parts Manager
- Service Advisor(s)       Technician(s)       Body Shop Manager       Fleet Repair

**Service Procedure:**

1. Remove one (1) screw (A) securing the left side of the steering column shroud.



**\* TIP**

Removal of the steering wheel/clock spring assembly is **NOT** required.



**CAUTION**

- Wear disposable gloves to avoid damaging interior components.
- To avoid scratching interior components, use caution when removing the screws securing the steering column shroud.

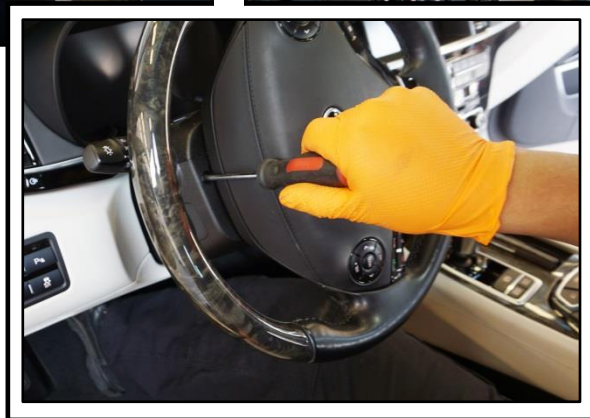
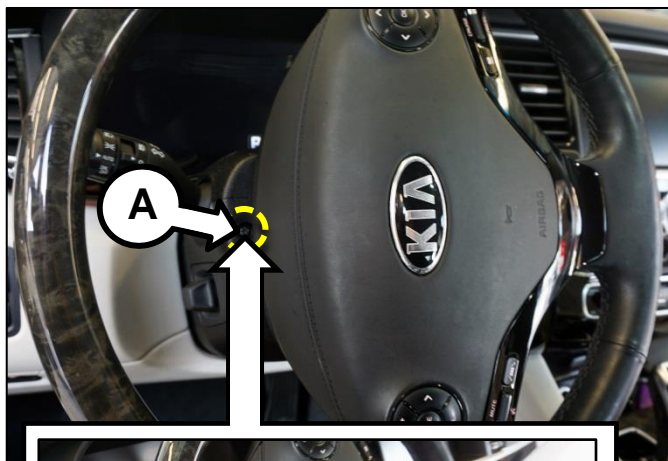


2. Remove one (1) screw (B) securing the right side of the steering column shroud.



**CAUTION**

To avoid scratching interior components, use caution when removing the screws securing the steering column shroud.

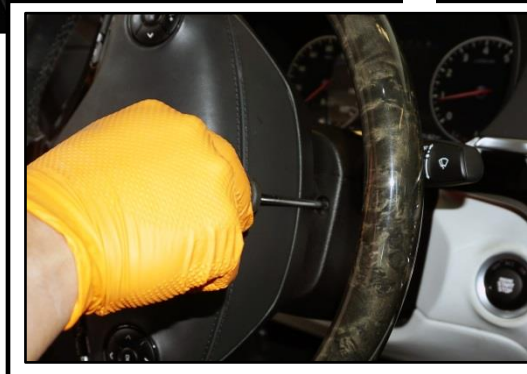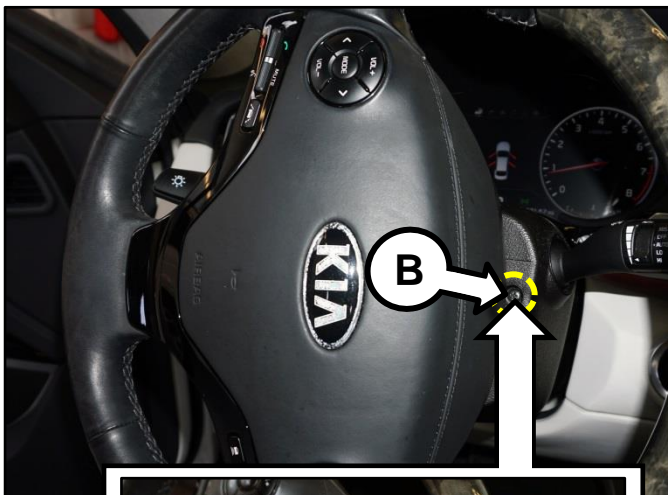


SUBJECT:

## MULTI-FUNCTION SWITCH REPLACEMENT (SC 130)

- Remove one (1) bolt (C) from the lower steering column shroud, as shown.

**⚠ CAUTION**


To avoid scratching interior components, use caution when removing the screws securing the steering column shroud.

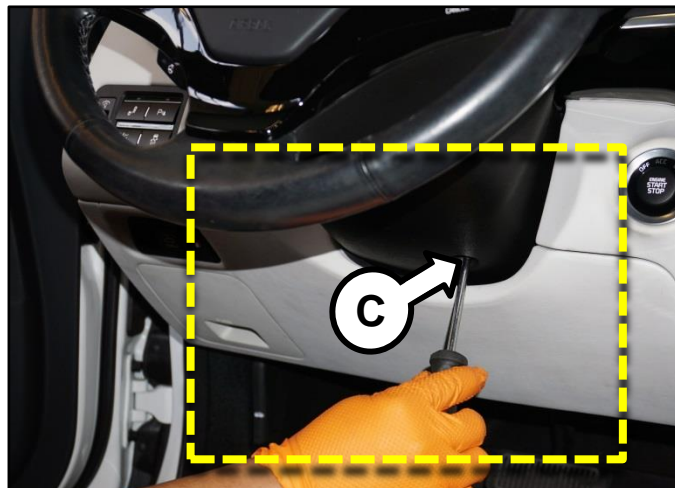

- Use a plastic panel remover to separate the upper steering column shroud (D) from the lower section, as shown.

**⚠ CAUTION**


Use a non-marring trim removal tool (such as Snap-on® P/N PBN5 or equivalent) to avoid damaging trim pieces.

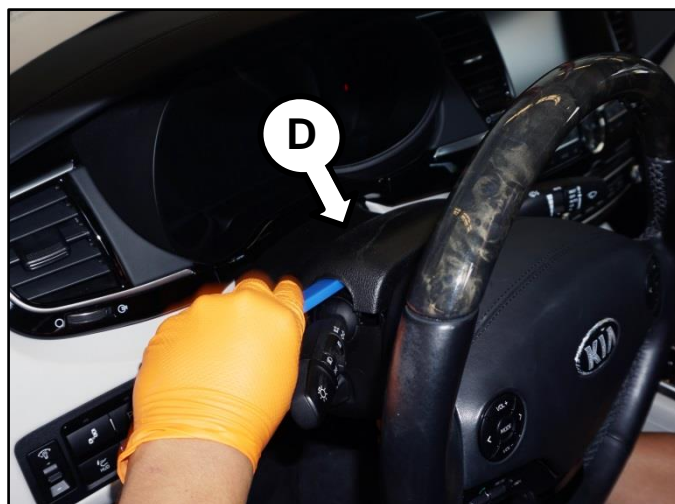

- Remove the lower steering column shroud (E), as shown.


**★ TIP**

If the lower steering column shroud (E) is difficult to remove, raise the steering column and then pull the lower shroud panel out.

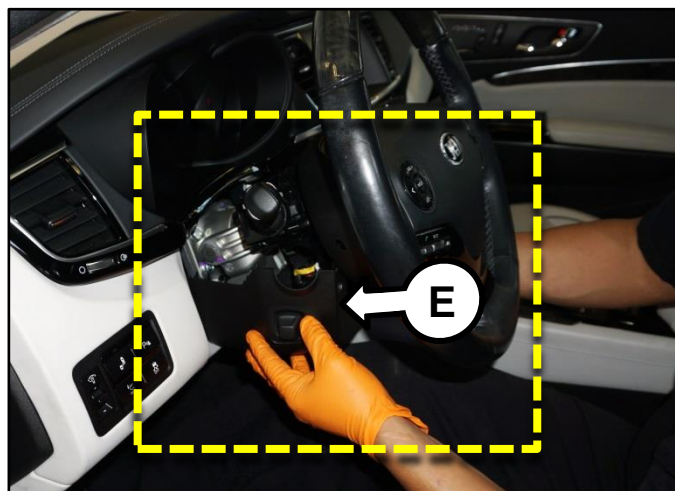



6. Disconnect the steering column position adjuster knob connector (F) to finish removing the lower steering column shroud.

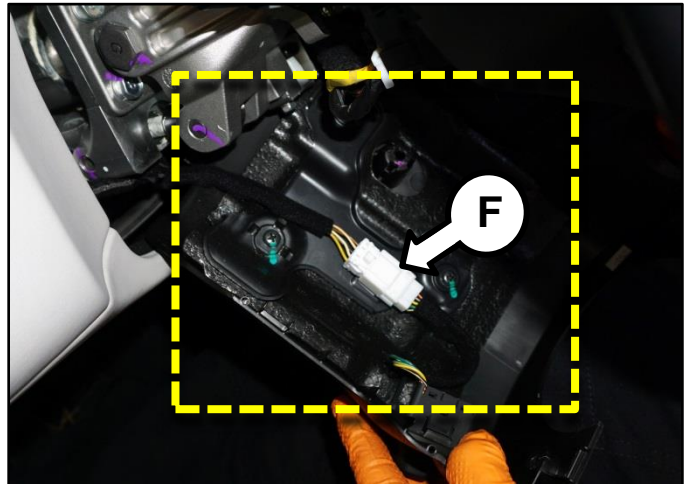


7. Remove the Multi-Function Switch connector (G), as shown.



8. Use a prying tool to press the Multi-Function Switch detent (H), as shown, while applying outward force to the Multi-Function Switch (I).

- 8A. Remove and discard the multi-function switch and replace it with a new one.

9. Reinstall all removed components by reversing the order of removal.

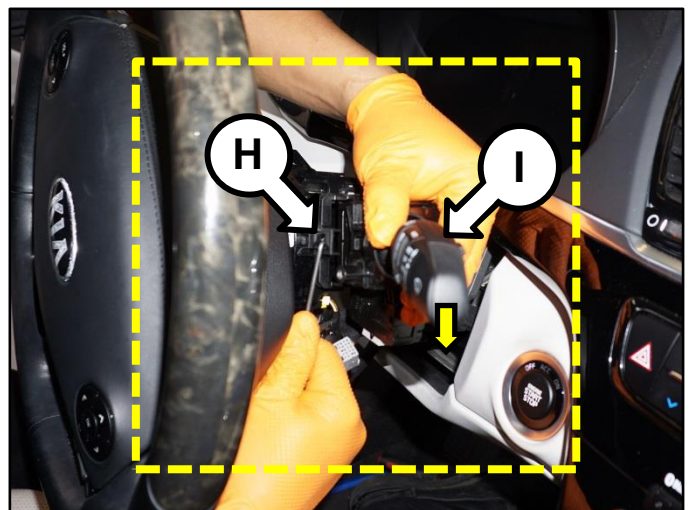


10. Verify proper Multi-Function Switch and head lamp operation.

**SUBJECT: MULTI-FUNCTION SWITCH REPLACEMENT (SC 130)**

## AFFECTED VEHICLE PRODUCTION RANGE:

Model	Production Date Range
K900 (KH)	From December 18, 2013 through January 11, 2016

## PARTS INFORMATION:

Part Name	Part Number	Figure
Multi-Function Switch	93420 3T000QQK	

## WARRANTY INFORMATION:

Claim Type	Causal P/N	Qty.	N Code	C Code	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
R	93400 3T140	0	N99	C99	(SC 130) Multi-Function (Wiper) Switch Replace	161012R0	0.3 M/H	93420 3T000QQK	1

**\* NOTICE**

To assure complete customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service > Warranty Coverage >Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.