

# Recall Bulletin 160429REV



**RECALL BULLETIN:**  
160429REV

**YEAR(S) AFFECTED:**  
2016-2017

**PRODUCT(S) AFFECTED:**  
Holiday Rambler Brand Endeavor and Endeavor XE manufactured between 11/17/2015 and 4/7/2016

**MODEL(S) AFFECTED:**  
All

**SUBJECT:**  
Providing Front Passenger's Side Tire Clearance

**KEYWORDS:**  
tire, tires, mud flaps

**ISSUE DATE:**  
June 2016

The purpose of this Bulletin is to inform REV Recreation Group dealers of the need to modify a wheel well support framework component near the front passenger's side tire on certain Holiday Rambler brand Endeavor and Endeavor XE motor homes. Affected motor home serial numbers are listed at the end of this Bulletin.

**CONDITION:**

On motor homes affected by this recall, a diagonally-oriented section of tube steel, designed as a support framework component for the fiberglass wheel-well skirt, has the potential to contact the front passenger-side tire, or force the front passenger-side mud flap into contact with the tire.

**Note: Read this entire Bulletin before proceeding.**

Follow the steps below to inspect the wheel well support framework forward of the front passenger's side tire and mud flap, and correct as necessary to prevent contact with the tires.

**INSPECTION:**

1. Park the motor home on a dry, level, paved hard surface. Place the transmission into Neutral. Engage the parking brake.
2. Turn off ignition and remove the keys. Maintain control of keys until all repairs are performed.



## WARNING

- DO NOT WORK UNDER A MOTOR HOME WITH AN INFLATED AIR SUSPENSION SYSTEM. BODILY INJURY OR DEATH COULD RESULT FROM A SUDDEN DROP IN THE MOTOR HOME AIR SUSPENSION SYSTEM.
- KEEP CLEAR OF ALL PINCH POINTS WHEN WORKING UNDER A MOTOR HOME.
- LEVELERS MUST BE FULLY RETRACTED AND THE MOTOR HOME PARK BRAKE ENGAGED.
- USE WHEEL CHOCKS TO PREVENT MOVEMENT OF THE VEHICLE.
- PLACE A JACK STAND UNDER THE BOTTOM ENTRY STEP TO PREVENT THE POTENTIAL FOR AUTOMATIC RETRACTION.

© 2016 REV Recreation Group, Inc.

*This bulletin is supplied for technical information only and is not an authorization for repairs.*

Federal law (section 154 of the national traffic and motor vehicle safety act of 1966) requires that: If you have received a notice of recall or failure to comply from REV Recreation Group or any component Manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

3. If necessary to gain access the repair area, use a heavy duty floor jack and heavy duty safety support jack stands to elevate and support the front of the vehicle while work is performed.
4. Referring to Figures 1 and 2, locate the angled section of tube forward of the front passenger's side front tire, near the entry step assembly. Use a metal cutting tool to remove this tube. **DO NOT REMOVE ANY COMPONENTS OTHER THAN THE TUBE IDENTIFIED BY THE ARROWS IN FIGURE 2.**
5. Using a pneumatic grinding tool to remove any burrs or sharp edges.
6. Touch up the area with black spray paint.
7. Inspect the front passenger's side mud flap; it may require one or two additional self-tapping screws to properly secure it in position.
8. Remove the jack stands and lower the vehicle.
9. Have an assistant turns the steering wheel from side to side. Observe the front passenger's side tire to ensure it does not make contact with anything. Correct if necessary.



Figure 1

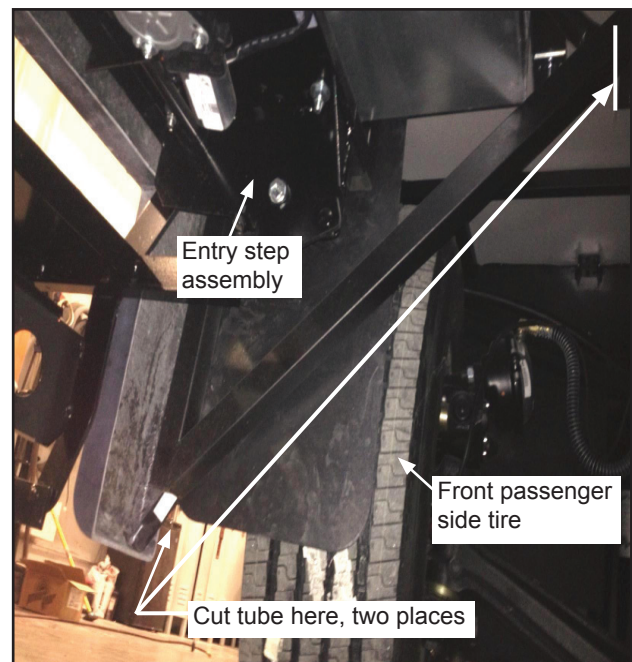


Figure 2

*This bulletin is supplied for technical information only and is not an authorization for repairs.*

Federal law (section 154 of the national traffic and motor vehicle safety act of 1966) requires that: If you have received a notice of recall or failure to comply from REV Recreation Group or any component Manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

**TOOLS:**

Heavy Duty Floor Jack  
Heavy Duty Jack Stands (6000 lbs. minimum each)  
Reciprocating Saw (e.g., "Sawzall")  
Grinder, 4", with 80 grit pad

**PARTS:**

Obtain locally

Screw, self-tapping

Black spray paint

Qty.

1-2 (as required)

1 can

**Warranty Labor Allowance:**

Use Flat Rate Codes:

Recall 160429REV Providing Front Passenger's Side Tire Clearance

6047 - 11 0.10 hr. Inspected/Not Defective

6047 - 12 0.50 hr. Inspected/Defective/Repaired

*If you have any questions concerning this bulletin,  
contact REV Recreation Group Dealer Support at: 1-800-816-9825*

*Service Literature is available at: <http://www.revrvdealers.com>*

*This bulletin is supplied for technical information only and is not an authorization for repairs.*

Federal law (section 154 of the national traffic and motor vehicle safety act of 1966) requires that: If you have received a notice of recall or failure to comply from REV Recreation Group or any component Manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."