

Keystone RV Company

5/11/2016

SAFETY ADVISORY # 16-251

Outback 326RL TV Bracket Screws

Keystone is conducting a voluntary **RECALL** notification campaign in accordance with the National Highway Transportation and Safety Act. It has been decided the vehicles in this recall population may have been manufactured with an interior TV bracket not properly secured to the wall. If the TV bracket breaks loose from the wall while a person is nearby, it will lead to an increased risk of personal injury.

Model and Serial Numbers Included:

2016 Outback – Model 326RL – Serial Number Range: GB453488 - GB453786

2017 Outback – Model 326RL – Serial Number Range: HB450016 - HB450286


Parts Required per Unit: Purchase locally: (4) 1/4" - # 14 - 1" self-drilling screw

Tools Required: Screw Gun

REPAIR INSTRUCTIONS

Step 1

Locate the trailer on a level, flat and hard surface. Chock the wheels.

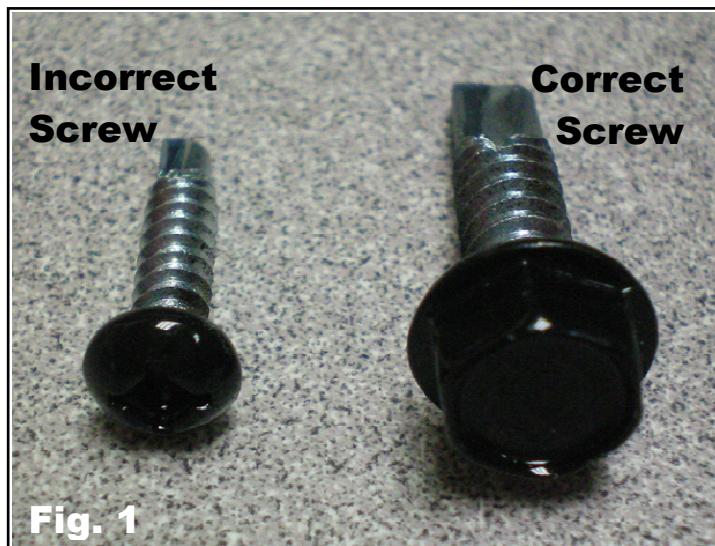

Step 2

Loosen the existing screws (#8 x 3/4" self-drilling) on the TV wall bracket. Keeping the parts together, remove the TV wall bracket and TV.

Step 3

Remove TV wall bracket screws (#8 x 3/4" self-drilling). Using existing holes, re-install TV wall bracket and TV with 1/4" - #14 - 1" self-drilling screws, Fig. 1.

WARRANTY REIMBURSEMENT

Claims for Safety Advisories must be on a separate claim.

Submit the claim on Key Express with **Flat Rate Code # 7125142A** and **Safety Advisory # 16-251** noted in the customer complaint section of the form. Please note in correction replaced TV wall bracket screws. The amount of time authorized .5 hours.

If you have questions please contact us at: **(866) 273-1456**.