

SAFETY ADVISORY # 16-255 Kodiak 291 LED Countertop Lights

Keystone RV Company is conducting a voluntary **RECALL** notification campaign in accordance with the National Traffic and Motor Vehicle Safety Act. It has been decided the vehicles in this recall population may have been manufactured with 2 separate LED rope lights as back lighting for the countertop that can touch at the unprotected ends. If this condition exists it will lead to an increased risk of fire if an electrical short should occur.

Models Included: 2016 - 2017 Dutchmen Kodiak 291RESL Travel Trailers

Serial Number Ranges:

2016 Kodiak 291RESL GJ970552 – GJ972186

2017 Kodiak 291RESL HJ970002 – HJ970025

Parts Required:

Purchase locally: 5/16 Heat Shrink Tube

Tools Required: Heat gun

REPAIR INSTRUCTIONS



Step 1

Extend kitchen slide room to gain access to the kitchen sink base, Fig 1. Locate the 2 wire ends above the cabinet door in Fig. 2.



Step 2

Locate and remove one of the two ends from the countertop. Cover the one end with 5/16 heat shrink tube, apply heat to the heat shrink tube following the manufacturer's instructions, Fig. 3.



WARRANTY REIMBURSEMENT

Claims for Safety Advisories must be on a separate claim.

Submit the claim on Key Express using **Flat Rate Code # 7125542A** with **Safety Advisory # 16-255** noted in the customer complaint section of the form. Please note in correction applied heat shrink tube. The amount of time authorized for this repair is 0.3 hours.

Please call Customer Service at **(855) 895-4422** if you have any questions.