

Service Bulletin

16-032

July 20, 2016 04206 Version 2

Safety Recall: 2015–16 MDX Fuel Tank

Supersedes 16-051, dated June 4, 2016, to revise the information highlighted in yellow

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2015–16	MDX	ALL	Check the iN VIN status for eligibility

REVISION SUMMARY

Under REPAIR PROCEDURE, a step was added.

BACKGROUND

During vehicle assembly, some fuel tanks with improper welds were incorrectly included in parts stock. Clients may notice a fuel smell or a leak. A fuel leak in the presence of an ignition source could result in a fire.

CLIENT NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

Some vehicles affected by this campaign may be in your new or used vehicle inventory. Federal law requires that all affected new vehicles be repaired before sale. In addition, failure to repair a vehicle subject to a recall or campaign may subject your dealership to claims or lawsuits from the client or anyone else harmed as a result of such failure. In addition, state law may provide American Honda with the right to seek indemnification in any such claim or lawsuit. To see if a vehicle in inventory is affected by this recall, do a VIN status inquiry before selling it.

CORRECTIVE ACTION

Replace the fuel tank.

PARTS INFORMATION

NOTE: The number of affected vehicles is small. Order fuel tanks only after confirming that a replacement part is needed.

Part Name	Part Number	Quantity
Fuel Tank Set (Includes green and natural retainer, fuel lock nut and gasket set, fuel tube clips, and fuel tank)	17044-TZ5-A00	1
Pre-Chamber Gasket	18393-SDB-A00	1
Bolt (12-point, 8 x 29 mm) (SH-AWD only)	90113-S10-000	8
Nut (10 mm)	90212-SA5-003	3
Flange Bolt (10 x 29 mm) (SH-AWD only)	90382-SH9-003	2

CLIENT INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

NOTE: For dealers experiencing a strong fuel smell from storing a fuel tank replaced under this Service **Bulletin**, the fuel tank may be disposed of immediately in accordance with local regulations. This only applies to the fuel tank replaced under this Service Bulletin. The published retention policy remains in effect for all other parts. If you have any questions to this exception or other parts retention issues please contact the WPI Administrative Office at 937-642-2737.


WARRANTY CLAIM INFORMATION

NOTE: Make sure to enter the fuel tank serial number in the DTC field of the warranty claim.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
3101FQ	MDX 2WD: Replace the fuel tank (2WD).	2.5 hrs.	6FT00	KB000	16-032N	17044-TZ5-A00
3101FQ	MDX SH-AWD: Replace the fuel tank.	2.9 hrs.	6FT00	KB000	16-032P	17044-TZ5-A00

REPAIR PROCEDURE

- 1. Replace the fuel tank. Refer to service information.
- 2. Refill the fuel tank with the fuel that was drained from the original fuel tank.
- 3. Write the fuel tank serial number on the RO, then give the warranty clerk the RO. For the warranty claim to be paid, the fuel tank serial number must be included in the DTC field of the warranty claim.
- 4. **For California residents only:** Fill out a Vehicle Emissions Recall Proof of Correction certificate, and use KB0 as the recall number. Give the certificate to your client, and advise him or her to keep it as proof that the product update was completed. Your client will need to submit this certificate to the DMV only if the DMV requests it. If you need more certificates, use reorder number Y0657.

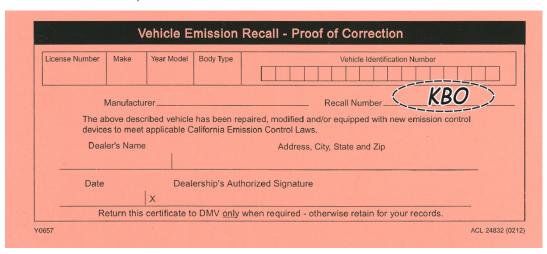

END