

July 15, 2016

04427 Version 2

Safety Recall: Rear Side Marker Light Is Not Working

Supersedes 16-058, dated July 9, 2016, to revise the information highlighted in yellow

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2016	Civic	2-Door	Check the VIN status inquiry

REVISION SUMMARY

The CUSTOMER NOTIFICATION was added.

BACKGROUND

Certain taillight assemblies may have a LED side marker light circuit board that was damaged during transit from a parts supplier, making the marker light inoperable.

CUSTOMER NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

Some vehicles affected by this campaign may be in your new or used vehicle inventory. These vehicles must be repaired before they are sold.

Should your dealership sell an unrepaired vehicle that subsequently causes injury or damage because of the recalled item, the dealership will be solely responsible to the damaged party and will be required to defend and indemnify American Honda for any resulting claims. To see if a vehicle in inventory is affected by this recall, do a VIN status inquiry before selling it.

CORRECTIVE ACTION

Inspect and replace as needed the rear taillight assembly.

PARTS INFORMATION

NOTE: American Honda expects very few vehicles will have damaged LED lights and very few will require taillight replacement. Replacement parts for 16-058 should be ordered after LED lights are inspected and are confirmed to not illuminate. Replaced parts will be on warranty call in to validate damage to LED lights.

Part Name	Part Number	Quantity
Right Taillight Assembly	33500-TBG-A01	1 (as needed)
Left Taillight Assembly	33550-TBG-A01	1 (as needed)

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
7205A0	Inspect rear side marker lights. No damage found.	0.2 hr	6ML00	KB800	16-058A	33500-TBG-A01
7201B5	Inspect. Replace damaged left rear side marker light.	0.3 hr	6ML00	KB800	16-058B	33500-TBG-A01
7201B6	Inspect. Replace damaged right rear side marker light.	0.3 hr	6ML00	KB800	16-058C	33500-TBG-A01
7201B7	Inspect. Replace damaged right and left rear side marker lights.	0.4 hr	6ML00	KB800	16-058D	33500-TBG-A01


Skill Level: Repair Technician

INSPECTION

1. Turn the ignition to ON.
2. Turn the headlight switch to ON and check the left and right rear side marker lights.
 - If the lights are on, the vehicle is ok.
 - If one or both rear side marker lights are not on, go to REPAIR PROCEDURE.

REPAIR PROCEDURE

1. Remove the trunk rear side trim panel.
2. Disconnect the connector.

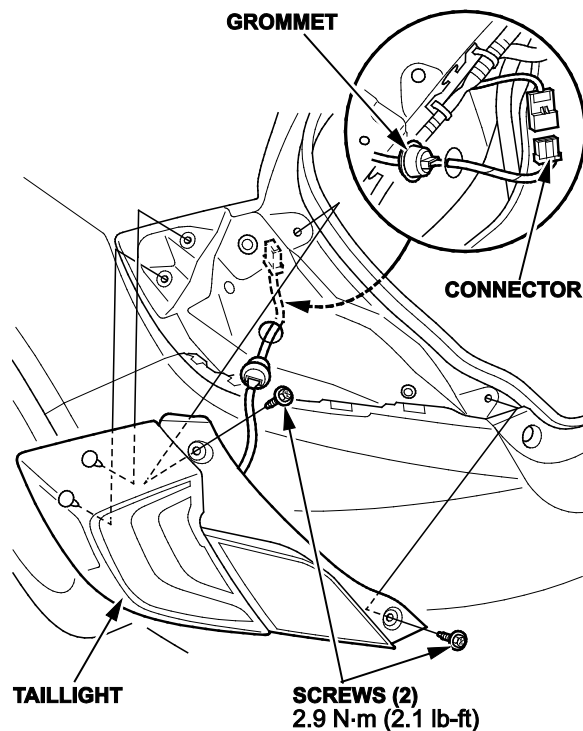

3. Remove the grommet.
4. Remove the taillight.
5. Install the grommet and connect the connector.
6. Install a new taillight, then torque the screws to **2.9 N-m (2.1 lb-ft)**.

7. Install the trunk rear side trim panel.
8. If necessary, repeat steps 1 thru 7 for the opposite side.

END