



## Safety Notice

<b>Affected Models</b>	MV800 units with T14MV trailer, see attached list for serial numbers
<b>Attention</b>	Dealership Owners, Managers, Parts and Service Managers
<b>Description</b>	Please see the attached customer notice.
<b>Parts Required</b>	N/A
<b>Estimated Repair Time</b>	30 minutes
<b>Compensation</b>	parts/labor/mileage
<b>Dealership Notes</b>	<p>URGENT: Please perform this update as soon as possible in the interest of safety. Ditch Witch requests that you update all machines in your area by January 31, 2016.</p> <p>A notification will be mailed to owners of affected models in one week. A list of units in your area is included. Please note "What You Should Do" section of the attached customer notice. If you have any questions, contact the Trenchless Product Support Group.</p>

1. Pry harness bar (shown) up enough to remove harness and disconnect trailer harness (215-0018) from tongue harness (215-0030).

**IMPORTANT:** Remove ring and washer (not shown) from trailer harness to fit through hole in trailer footboard.



inmv800001s.jpg

**Safety Notice 2**

---

2. Remove rubber grommet from hole in trailer footboard (shown).



inmv800002s.jpg

3. Remove harness from clip (shown) and pull harness through hole in trailer footboard.



inmv800003s.jpg

- Use yellow tool (259-439) to move black/white wire from pin F to pin H (shown).




inmv800004s.jpg



inmv800005s.jpg

- Route trailer harness back through hole in trailer footboard.
- Reconnect trailer harness to tongue harness (shown).
- Secure harness into harness clip and harness bar and reinsert grommet.
- Test to ensure proper function.

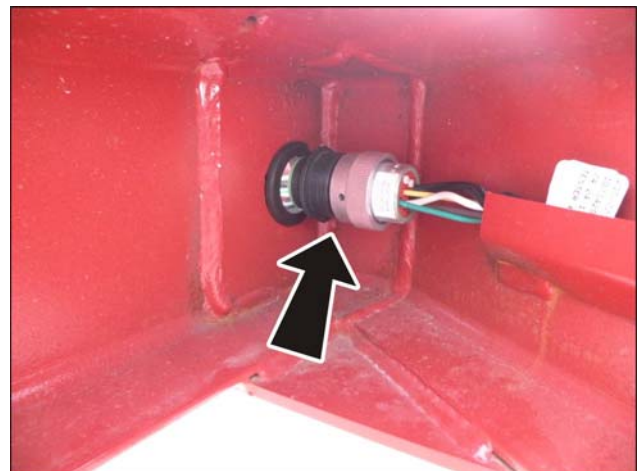

inmv800006s.jpg