



Technical Journal

TITLE:

Recall R89708 – Front Passenger Seatbelt Buckle

| | | | |
|--|---|--|-----------------------------------|
| REF NO: TJ 32058.1.1 | ISSUING DEPARTMENT: Technical Service | CAR MARKET: United States and Canada | |
| PARTNER: 3 US 7510 Volvo Car USA | | ISSUE DATE: 2016-10-27 | STATUS DATE: 2016-10-28 |
| FUNC GROUP: 8841 | FUNC DESC: Seat belt, front | Page 1 of 4 | |

“Right first time in Time”

Attachment

| File Name | File Size |
|---|-----------|
| Port_Action_Completed.jpg | 0.0273 MB |
| TJ Instruction_32058_Seat Belt Inspection.pdf | 0.0894 MB |

Vehicle Type

| Type | Eng | Eng Desc | Sales | Body | Gear | Steer | Model Year | Plant | Chassis range | Struc Week Range |
|------|-----|----------|-------|------|------|-------|------------|-------|-----------------|------------------|
| 134 | | | | | | | 2016-2017 | | 0394830-0425806 | 201546-201632 |
| 137 | | | | | | | 2016-2017 | | 0001302-0003890 | 201546-201632 |
| 138 | | | | | | | 2016-2017 | | 0103382-0134161 | 201550-201634 |
| 155 | | | | | | | 2016-2017 | | 0298786-0340121 | 201546-201633 |
| 156 | | | | | | | 2016-2017 | | 0000007-0928330 | 201616-201617 |
| 157 | | | | | | | 2016-2017 | | 0012413-0027328 | 201546-201633 |
| 234 | | | | | | | 2017-2017 | | 0000358-0004089 | 201617-201632 |
| 256 | | | | | | | 2016-2017 | | 0000516-0126232 | 201506-201633 |

CSC Customer Symptom Codes

| Code | Description |
|------|---|
| XW | Service action/Recall/Service action/Recall |



VST Operation Number

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Text

DESCRIPTION:

Volvo Car USA LLC and Volvo Car Canada LTD (Volvo) on behalf of Volvo Car Group has decided to launch Recall R89708 on certain model year 2016 - 2017 XC90, S90, XC60, V60CC, V60, S60, S60CC, S60 Inscription vehicles.

The affected vehicles may have not had the front passenger seatbelt buckle stud punched correctly. This may result in a separation between the buckle and the seat belt bracket. If this were to occur, it could increase the risk of injury to a front passenger seat occupant in a vehicle crash.

SERVICE:

Authorized Volvo retailers will inspect the front passenger seatbelt buckle stud by pushing/rotating the passenger seatbelt buckle forward, and checking if the seatbelt buckle stud is punched according to the illustrations in the attached instruction titled "**TJ Instruction_32058_Seat Belt Inspection.pdf**"

If the inspection procedure indicates an incorrectly manufactured seatbelt buckle, Volvo retailers must replace the seatbelt buckle.

NOTE: Vehicles completed at ports will have a "Green" dot on the inside of the fuel filler door identifying the completion of this recall. Please see the attachment titled "**Port_Action_Completed.jpg**"

VEHICLE REPORT:

Not Required

To view TJ attachment continue to next page. This TJ has two attachments.



| | |
|-----------------------------------|---|
| Volvo Car Customer Service | |
| TJ Instruction | |
| TJ No 32058 | |
| Date October-2016 Issue 01 | |
| Title | Recall R89708 – Front Passenger Seatbelt Buckle |

