

**Action Required**

Correct Orientation of OnGuard Collision Mitigation System on specific Jayco Motorized - Entegra - Cornerstone Class A Motorhomes


**Affected Units**

2017 Cornerstone Class A Motorhomes


H16A8051-8065  
H16B8051-8126  
H16J8051-8054  
H16K8051-8070  
H16W8052-8063  
H16X8051  
H16Y8051

**Instructions for Spartan Service Centers to correct orientation of OnGuard system**

- Fig 1:** Open generator compartment.  
Locate the OnGuard Radar System computer.

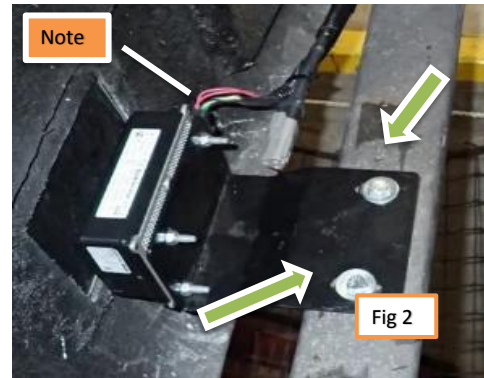



- Fig 2:** Remove bolts connecting the computer system to the compartment door (save bolts for reinstall).  
**Note:** Wiring harness is on the passenger side of the system. Confirms incorrect orientation.

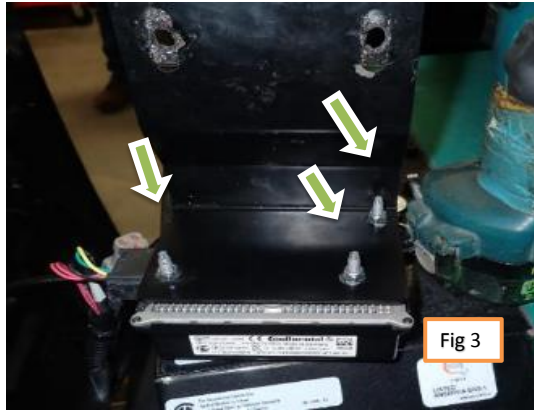

3 Fig 3-4: Remove the bracket from the back of the computer system and discard bracket.



Fig 5: New replacement bracket.

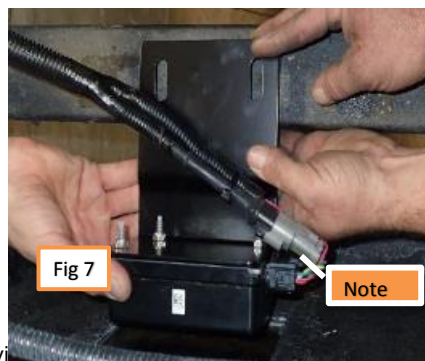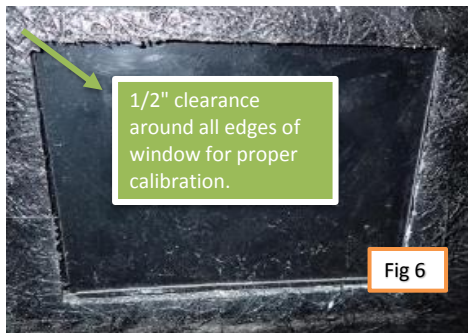

4 Fig 6: Reinstall computer system in compartment, protective window, leaving 1/2" clearance around all edges of window for proper calibration. System requires 1/4" distance between OnGuard system and ABS.

Fig 7: **Note** Wiring harness now on the drivers side of system. Confirms correct orientation.

Fig 8 & 9: Reinstall with shims (if needed) to get proper 1/2" clearance from bottom.



- 5 Replace PDC fuse, replace PDC cover and tighten thumb screws.
- 6 Restore power to coach.
- 7 Recalibrate OnGuard system.