

May 14, 2019

Version 6

Safety Recall: 2011-16 Odyssey Second Row (Both Outer) SeatsSupersedes 16-108, dated April 24, 2018, to revise the information highlighted in **yellow****AFFECTED VEHICLES**

Year	Model	Trim	VIN Range
2011-16	Odyssey	ALL	Check the iN VIN status for eligibility.

REVISION SUMMARY**Notes were added and images were updated in REPAIR PROCEDURE.****BACKGROUND**

The seat slide cam may get stuck in the open position after using the walk-in feature. If the seat cam does get stuck in the open position, the seat will not properly lock into position, allowing it to slide while the vehicle is in motion. An unlocked second row outer seat increases the risk of injury to the seat occupant during a crash.

CUSTOMER NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

Some vehicles affected by this campaign may be in your used vehicle inventory.

Failure to repair a vehicle subject to a recall or campaign may subject your dealership to claims or lawsuits from the customer or anyone else harmed as a result of such failure. To see if a vehicle in inventory is affected by this safety recall, do a VIN status inquiry before selling it.

CORRECTIVE ACTION

Install the four brackets and four springs to both sides of the two second row outer seats.

PARTS INFORMATION

Part Name	Part Number	Quantity
Seat Rail Bracket and Spring Kit (includes four brackets and four springs)	81360-TK8-305	1

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
8511L4	Install the four new brackets and springs on the two second row outer seats.	0.4 hr	6SR00	KD500	16-108A	81360-TK8-A01

Skill Level: Repair Technician

REPAIR PROCEDURE

NOTES


- Before completing this repair, make sure the second row seat striker brackets are installed. Refer to service bulletin 18-021, *Safety Recall: Second Row Outer Seat Striker Bracket (Seat Tipping)*.
 - If the VIN status inquiry indicates that the vehicle is subject to any open safety recalls, make sure to also complete those recall repairs before returning the vehicle to the customer. If you are unable to complete any open recall, advise the customer of the recall status and when the recall could be completed.
1. Remove any child or booster seats that are installed in the second row center and left seats, and place them in the cargo area for the customer to install. Note which position the seat is installed: standard (inner), or wide (outer) position. For customer convenience, install it in the same position before returning the vehicle.
 2. Remove the second row outer seat headrest, and fold the seat-back down.
 3. Release the second row outer seat from the floor. Position the seat in the door opening as shown to access the seat slide rails.

NOTE


Use shop towels or a disposable mat to protect the seat cover from any dirt or grime that may be on the vehicle's floor.



4. Remove the 12 mm nut on the back of the seat rail.

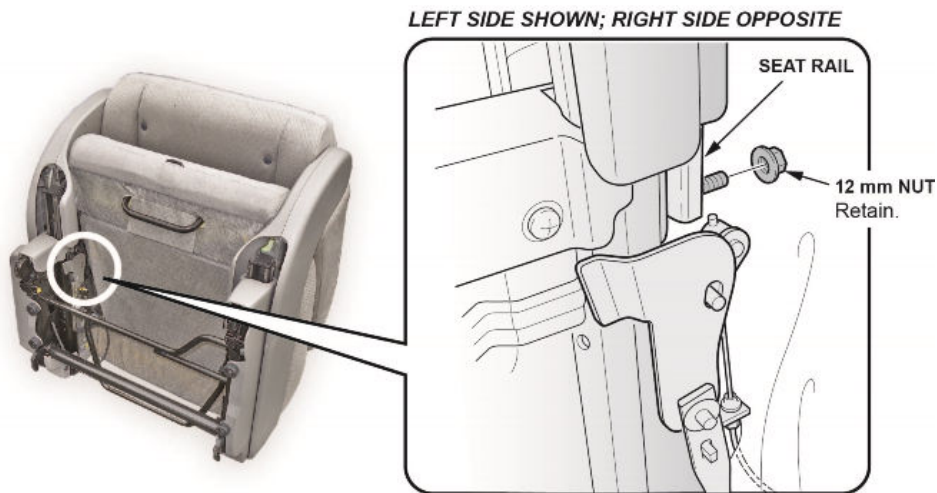

5. Install a bracket from the kit over the stud as shown. Make sure the hook part of the bracket faces the back of the seat and the anti-rotation tab contacts the seat rail.

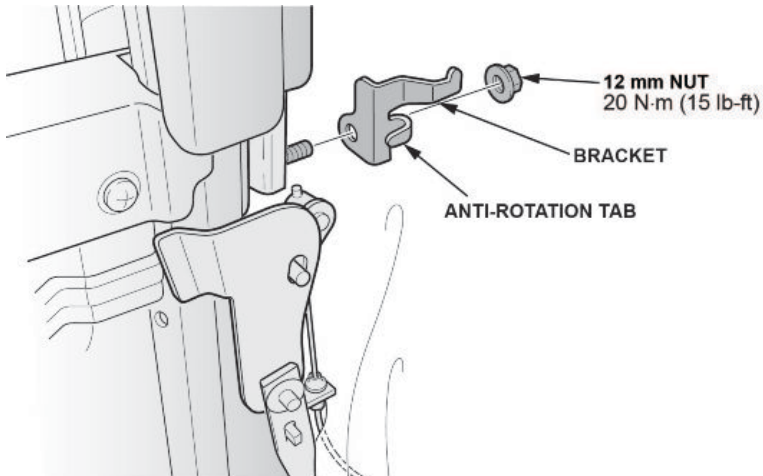


6. Install the original 12 mm nut using a 3/8 in. drive flexible head torque wrench. Torque the nut to **20 N·m (15 lb-ft)**.



7. Install the spring from the kit through the back of the seat cam as shown.

NOTE

Make sure the spring is attached to the seat cam, **not** the slide rail bracket.

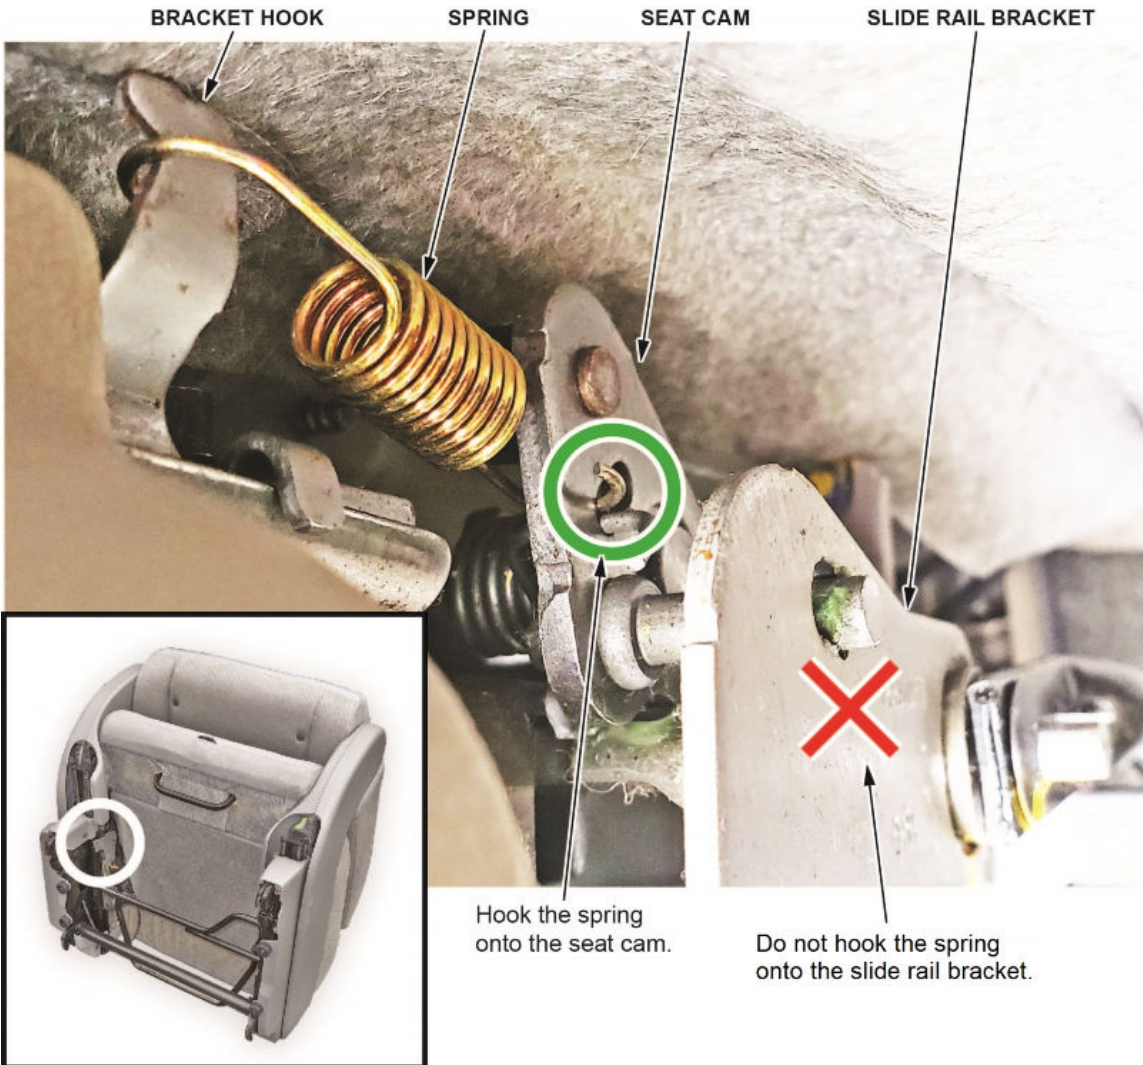


8. Hook the other end of the spring over the bracket hook as shown.

9. Repeat steps 2 through 8 on the opposite slide rail.


NOTE

Make sure the spring is attached to the seat cam, **not** the slide rail bracket.

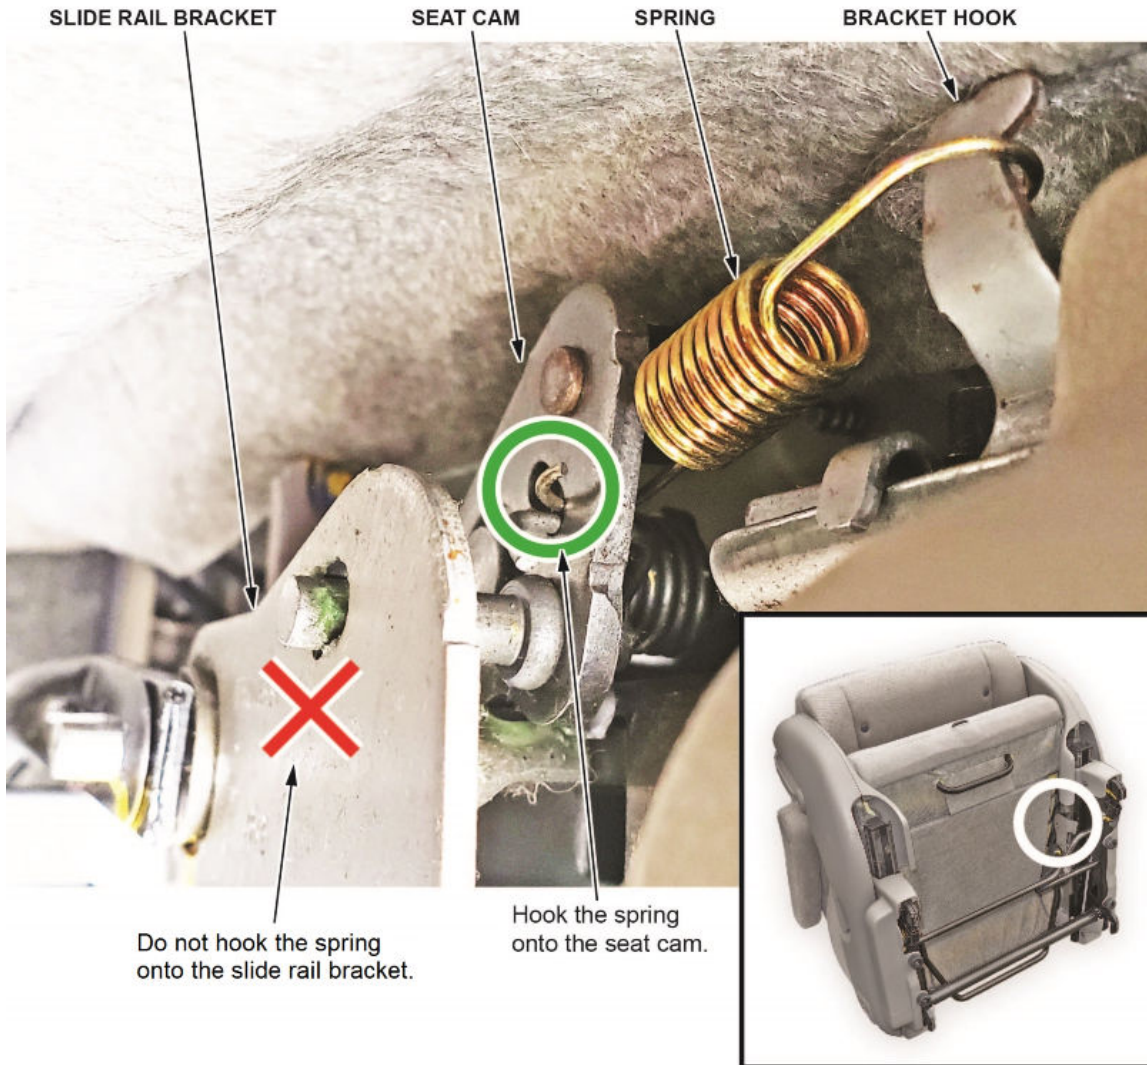


10. Install the seat in the same position (standard or wide) that you noted in step 1, and do the following to make sure it is properly secured:


10.1. With the seat-back folded down and adjusted to the rearmost position, insert the hooks into the floor strikers with the outer hook in the standard or wide position.

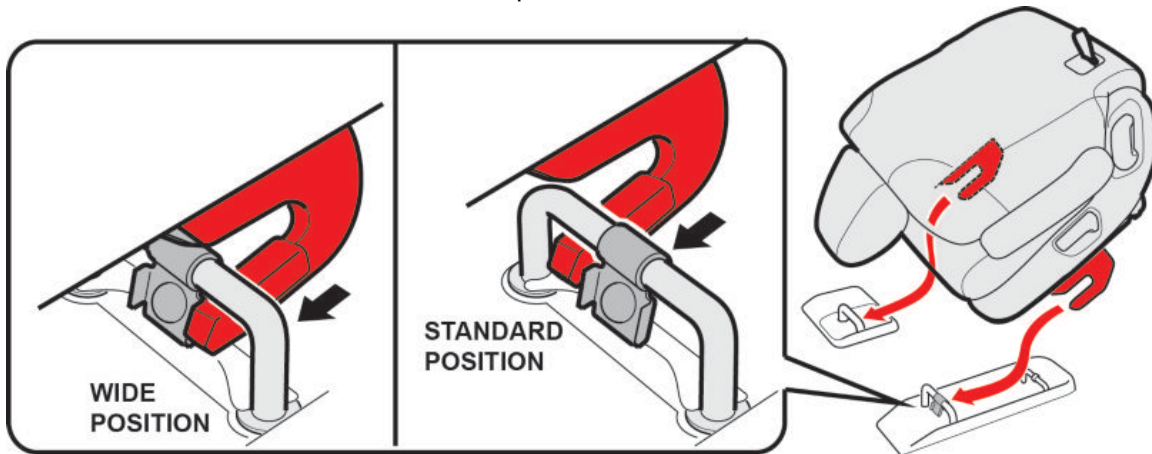

10.2. After confirming both front hooks are fully inserted into the front strikers, begin to lower the seat then allow it to drop and lock to the rear floor strikers.

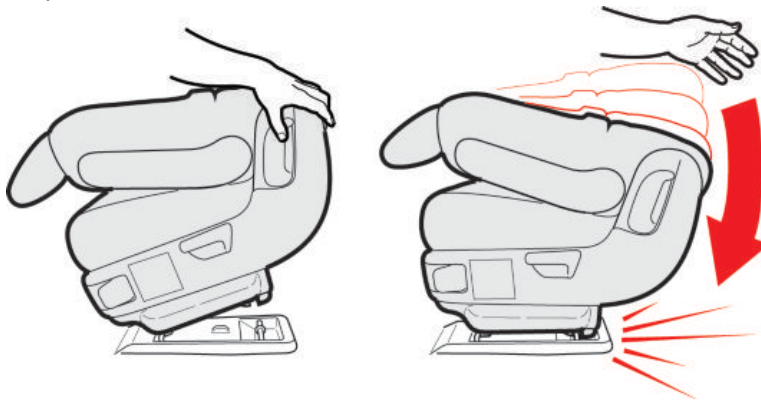

10.3. Raise the seat-back to an upright position, then rock it back and forth, and make sure both the inner and outer latches are locked in position.

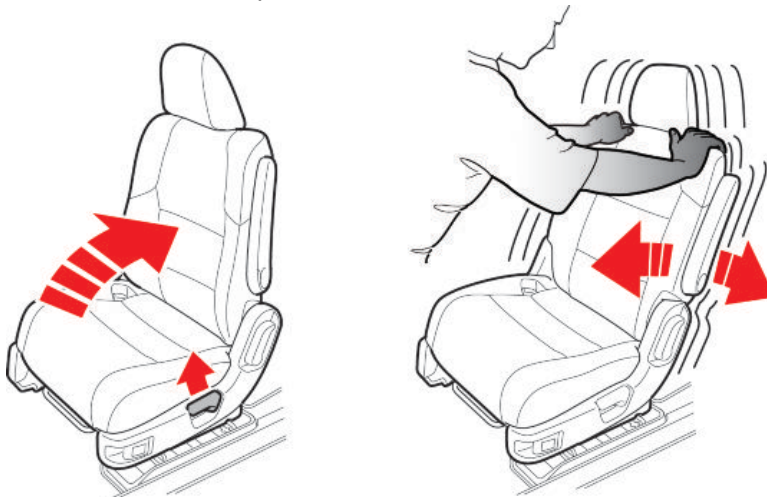

11. Repeat steps 1 through 10 on the other second row outer seat.

END