

May 23, 2016

DEFECT INFORMATION REPORT

1. Vehicle Manufacturer Name:

Toyota Motor Corporation ["TMC"]
1, Toyota-cho, Toyota-city, Aichi-pref., 471-8571, Japan

Toyota Motor Manufacturing, Indiana, Inc. ["TMMI"]
4000 Tulip Tree Drive, Princeton, IN 47670-4000

Toyota Motor Manufacturing Canada Inc. ["TMMC"]
1055 Fountain Street North, Cambridge, Ontario, Canada N3H 5K2

Toyota Motor Manufacturing Mississippi, Inc. ["TMMMS"]
1200 Magnolia Way, Blue Springs, MS 38828

New United Motor Manufacturing, Inc. ["NUMMI"]
45500 Fremont Boulevard, Fremont, CA 94538-6368

Affiliated U.S. Sales Company

Toyota Motor Sales, USA, Inc. ["TMS"]
19001 South Western Avenue, Torrance, CA 90501

General Motors Corporation Global Headquarters ["GM"]
100 Renaissance Center Drive, P. O. Box 100 Detroit, MI 48265

Manufacturer of Front Passenger Inflator:

TK HOLDINGS INC. ("Takata")
2500 Takata Drive, Auburn Hills, MI 48326
Phone: 248-373-2897

Country of Origin: Mexico

2. Identification of Involved Vehicles:

| Make/ Car Line | Model Year | Manufacturer | Production Period |
|---------------------------|---------------|----------------------------|--|
| Toyota/ Scion xB | 2008 - 2011 | TMC | January 17, 2007 through June 3, 2011 |
| Toyota/ Corolla | 2009 - 2011 | TMC, TMMC, TMMMS, NUMMI | July 31, 2007 through December 20, 2011 |
| Toyota/ Corolla Matrix | 2009 - 2011 | TMMC | December 12, 2007 through December 8, 2011 |
| Toyota/ Yaris | 2006 - 2011 | TMC | July 12, 2005 through August 3, 2011 |
| Toyota/ 4Runner | 2010 - 2011 | TMC | May 11, 2009 through October 5, 2011 |
| Toyota/ Sienna | 2011 | TMMI | January 4, 2010 through September 12, 2011 |
| Lexus/ IS250/350 | 2006 - 2011 | TMC | May 27, 2005 through August 31, 2011 |
| Lexus/ IS250C/350C | 2010 - 2011 | TMC | November 25, 2008 through August 29, 2011 |
| Lexus/ IS-F | 2008 - 2011 | TMC | July 18, 2007 through August 27, 2011 |
| Lexus/ ES350 | 2007 - 2011 | TMC | November 24, 2005 through September 12, 2011 |
| Lexus/ GX460 | 2010 - 2011 | TMC | July 28, 2009 through August 1, 2011 |
| Pontiac/ Vibe | 2009 - 2010 | NUMMI | January 22, 2008 through January 5, 2010 |

- NOTE: (1) Although the involved vehicles are within the above VIN range, not all vehicles in this range were sold in the U.S.
- (2) The involved vehicles are equipped with Takata-designated PSPI-6 inflators. Vehicles with other inflators (Takata-designated SPI, PSPI, and PSPI-L) noted in the Part 573 reports submitted by Takata on May 16, 2016 have already been included in Toyota recalls 15V-285 and 15V-286. Other inflators specified by Takata are not used in Toyota vehicles.

| Applicability | Part Number | Part Name | Component Description |
|---------------|-------------|---|-------------------------------|
| All | 73980-52170 | Inflator Assembly, Passenger Air Bag | Passenger Air Bag Inflator |

3. Total Number of Vehicles Potentially Involved:

| | | |
|-----------------------|---|-----------|
| Toyota Scion xB | : | 93,266 |
| Toyota Corolla | : | 523,244 |
| Toyota Corolla Matrix | : | 39,244 |
| Toyota Yaris | : | 326,254 |
| Toyota 4Runner | : | 45,138 |
| Toyota Sienna | : | 74,078 |
| Lexus IS250/350 | : | 201,799 |
| Lexus IS250C/350C | : | 12,704 |
| Lexus IS-F | : | 3,673 |
| Lexus ES350 | : | 251,924 |
| Lexus GX460 | : | 12,580 |
| Pontiac Vibe | : | 70,809 |
| Total | : | 1,654,713 |

4. Percentage of Vehicles Estimated to Actually Contain the Defect:

Not available.

5. Description of Problem:

The subject vehicles are equipped with front passenger air bag inflators (Takata-designated PSPI-6) which contain a non-desiccated, phase stabilized ammonium nitrate propellant. According to the Part 573 Reports submitted by Takata on May 16, 2016, a defect related to motor vehicle safety may arise in the inflators due to propellant degradation occurring after prolonged exposure to high absolute humidity, high temperatures, and high temperature cycling. Activation of a non-desiccated ammonium nitrate inflator with degraded propellant may result in an inflator rupture. An inflator rupture may cause metal fragments to pass through the air bag and into the vehicle interior at high speed, which may result in injury or death to vehicle occupants.

6. Chronology of Principal Events:

May 16, 2016 – Takata filed Part 573 reports in accordance with terms specified in the May 4, 2016 Amendment to the November 3, 2015 Consent Order between Takata and the National Highway Traffic Safety Administration (NHTSA).

May 19, 2016 – Based on Takata's Part 573 Reports. Toyota decided to conduct a voluntary safety recall to identify the subject vehicles and replace the air bag inflator or assembly. In doing so, Toyota does not fully endorse the content of Takata's Part 573 Reports.

7. Description of Corrective Repair Action:

All known owners of the affected Toyota, Scion, and Lexus vehicles will be notified by first class mail to return their vehicles to a Toyota or Lexus dealer, as applicable. Depending on the vehicle model, dealers will replace the front passenger air bag inflator, or replace the air bag assembly.

General Motors will notify NHTSA separately of its repair and notification schedule.

Reimbursement Plan for pre-notification remedies

The owner letter will instruct vehicle owners who have paid to have this condition remedied prior to this campaign to seek reimbursement pursuant to Toyota's General Reimbursement Plan.

Reimbursement Plan for pre-notification remedies for General Motors Vehicles (Pontiac Vibe)

Pursuant to 49 C.F.R. § 577.11, GM will reimburse owners for repairs according to the plan submitted on May 20, 2015.

8. Recall Schedule:

Interim notifications to owners of the affected vehicles will occur by July 22, 2016. A copy of the draft owner notification letter will be submitted as soon as available.

Remedy notifications will be made consistent with NHTSA's Coordinated Remedy Program Order and the availability of replacement parts.

9. Distributor/Dealer Notification Schedule:

Notifications to distributors/dealers will be sent on May 23, 2016. Copies of dealer communications will be submitted as they are issued.

10. Manufacturer's Campaign Number:

| | [Interim] | | [Final] | |
|---------|---------------|---------------|---------------|---------------|
| | <u>Zone A</u> | <u>Zone B</u> | <u>Zone A</u> | <u>Zone B</u> |
| Toyota: | G1P | G1R | G0P | G0R |
| Lexus: | G2G | G2H | GLG | GLH |