OMB Control No.: 2127-0004

Part 573 Safety Recall Report

17V-014

Manufacturer Name: Subaru of America, Inc.

Submission Date: MAR 13, 2017 NHTSA Recall No.: 17V-014 Manufacturer Recall No.: TKA-17



Manufacturer Information:

Manufacturer Name: Subaru of America, Inc.

Address: P.O. Box 6000

Cherry Hill NJ 08034-6000

Company phone: 856-488-8500

Population:

Number of potentially involved: 53,480 Estimated percentage with defect: NR

Vehicle Information:

Vehicle 1: 2009-2012 Subaru Forester

Vehicle Type: LIGHT VEHICLES

Body Style : SUV Power Train : GAS

Descriptive Information: Not all vehicles in the specified production date range are affected by this recall. This

recall affects Takata Non-Desiccated Frontal Passenger-side Air Bag Inflators Containing Phase Stabilized Ammonium Nitrate for Zone A, for vehicles not already

covered under NHTSA Campaign Numbers 14V763, 15V323, and 16V358.

Zone A includes states and U.S. territories with the greatest temperature cycling and

absolute humidity. It includes: Alabama, California, Florida, Georgia, Hawaii,

Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam,

the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

Production Dates: JAN 11, 2008 - MAY 16, 2012

Production Dates : JUL 06, 2011 - JUN 27, 2012

NR

VIN Range 1: Begin:

■ Not sequential

Vehicle 2:	2005-2006 Subaru B	aja				
	LIGHT VEHICLES					
Body Style :						
Power Train:	GAS					
Descriptive Information :	Not all vehicles in the specified production date range are affected by this recall. This recall affects Takata Non-Desiccated Frontal Passenger-side Air Bag Inflators Containing Phase Stabilized Ammonium Nitrate for Zone A, for vehicles not already covered under NHTSA Campaign Numbers 14V763, 15V323, and 16V358. Zone A includes states and U.S. territories with the greatest temperature cycling and absolute humidity. It includes: Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.					
Production Dates :	MAY 01, 2004 - APR	11. 2006				
VIN Range 1:			NR	■ Not sequential		
	GAS Not all vehicles in the recall affects Takata Containing Phase State covered under NHTS Zone A includes state absolute humidity. It	e specified product Non-Desiccated Fro bilized Ammonium A Campaign Numb es and U.S. territori includes: Alabama	ion date range are affected ontal Passenger-side Air E n Nitrate for Zone A, for ve ers 14V763, 15V323, and es with the greatest temp n, California, Florida, Georg Texas, Puerto Rico, Americ	Bag Inflators Chicles not already 16V358. Erature cycling and gia, Hawaii,		

End: NR

VIN Range 1: Begin:

■ Not sequential

Vehicle 4:	2012-2012 Subaru WRX					
Vehicle Type :	LIGHT VEHICLES					
Body Style :	STATIONWAGON					
Power Train:						
Descriptive Information:	Not all vehicles in the specified production date range are affected by this recall. This recall affects Takata Non-Desiccated Frontal Passenger-side Air Bag Inflators Containing Phase Stabilized Ammonium Nitrate for Zone A, for vehicles not already covered under NHTSA Campaign Numbers 14V763, 15V323, and 16V358. Zone A includes states and U.S. territories with the greatest temperature cycling and absolute humidity. It includes: Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.					
Production Dates :	JUL 06, 2011 - JUN 2	27, 2012				
VIN Range 1:	Begin: N	R	End: NR	☐ Not sequential		
	Begin : N 2006-2012 Subaru		End: NR	☐ Not sequential		
Vehicle 5:			End: NR	☐ Not sequential		
Vehicle 5:	2006-2012 Subaru LIGHT VEHICLES		End: NR	☐ Not sequential		
Vehicle 5 : Vehicle Type :	2006-2012 Subaru LIGHT VEHICLES SUV		End: NR	☐ Not sequential		
Vehicle 5 : Vehicle Type : Body Style : Power Train :	2006-2012 Subaru LIGHT VEHICLES SUV GAS Not all vehicles in the recall affects Takata Containing Phase St covered under NHT Zone A includes state absolute humidity. Louisiana, Mississip	Tribeca he specified ja Non-Desico tabilized Am TSA Campaigutes and U.S. t It includes: A	production date range are affected Frontal Passenger-side Amonium Nitrate for Zone A, for Numbers 14V763, 15V323, atterritories with the greatest terdalabama, California, Florida, Gerolina, Texas, Puerto Rico, Amediapan), and the U.S. Virgin Islanda	cted by this recall. This ir Bag Inflators recall to the r		

End: NR

NR

Vehicle 6: 2006-2011 Subaru Impreza Vehicle Type: LIGHT VEHICLES **Body Style: STATIONWAGON** Power Train: GAS Descriptive Information: Not all vehicles in the specified production date range are affected by this recall. This recall affects Takata Non-Desiccated Frontal Passenger-side Air Bag Inflators Containing Phase Stabilized Ammonium Nitrate for Zone A, for vehicles not already covered under NHTSA Campaign Numbers 14V763, 15V323, and 16V358. Zone A includes states and U.S. territories with the greatest temperature cycling and absolute humidity. It includes: Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands. Impreza includes WRX and STI. Production Dates: JUL 04, 2005 - AUG 30, 2011 VIN Range 1 : Begin : End: NR Not sequential Vehicle 7: 2009-2012 Subaru Legacy Vehicle Type: LIGHT VEHICLES Body Style: 4-DOOR Power Train: GAS Descriptive Information: Not all vehicles in the specified production date range are affected by this recall. This recall affects Takata Non-Desiccated Frontal Passenger-side Air Bag Inflators Containing Phase Stabilized Ammonium Nitrate for Zone A, for vehicles not already covered under NHTSA Campaign Numbers 14V763, 15V323, and 16V358. Zone A includes states and U.S. territories with the greatest temperature cycling and absolute humidity. It includes: Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam,

Production Dates: MAY 01, 2008 - JUN 04, 2012

the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

Vehicle 8: 2009-2012 Subaru Outback

Vehicle Type: LIGHT VEHICLES

Body Style: SUV Power Train: GAS

Descriptive Information: Not all vehicles in the specified production date range are affected by this recall. This

recall affects Takata Non-Desiccated Frontal Passenger-side Air Bag Inflators Containing Phase Stabilized Ammonium Nitrate for Zone A, for vehicles not already

covered under NHTSA Campaign Numbers 14V763, 15V323, and 16V358.

Zone A includes states and U.S. territories with the greatest temperature cycling and

absolute humidity. It includes: Alabama, California, Florida, Georgia, Hawaii,

Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam,

the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

Production Dates: MAY 02, 2008 - JUN 04, 2012

VIN Range 1 : Begin : NR End : NR Not sequential

Vehicle 9: 2006-2011 Subaru Impreza

Vehicle Type: LIGHT VEHICLES

Body Style: 4-DOOR Power Train: GAS

Descriptive Information: Not all vehicles in the specified production date range are affected by this recall. This

recall affects Takata Non-Desiccated Frontal Passenger-side Air Bag Inflators

Containing Phase Stabilized Ammonium Nitrate for Zone A, for vehicles not already

covered under NHTSA Campaign Numbers 14V763, 15V323, and 16V358.

Zone A includes states and U.S. territories with the greatest temperature cycling and

absolute humidity. It includes: Alabama, California, Florida, Georgia, Hawaii,

Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam,

the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

Impreza includes WRX and STI.

Production Dates: JUL 04, 2005 - AUG 30, 2011

VIN Range 1 : Begin : NR End : NR Not sequential

Description of Defect:

Description of the Defect: Takata has submitted DIR 17E-002 (Zone A) in accordance with the terms

specified in the May 4, 2016 Amendment to the November 3, 2015 Consent

Order in EA15-001.

Subaru is submitting this DIR in accordance with section 46 of Coordinated

Remedy Order.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: Activation of a non-desiccated ammonium nitrate inflator with degraded

Description of the Safety Risk:

propellant may result in an inflator rupture. An inflator rupture may cause metal fragments to pass through the air bag and into the vehicle interior at

high speed, which may result in injury or death to vehicle occupants.

Description of the Cause: Based upon Takata's investigation to date, the propellant wafers in some of the subject inflators may degrade over time, which could lead to overaggressive combustion in the event the air bag is activated. Overly aggressive combustion creates excessive internal pressure when the inflator is activated, which may

cause the inflator body to rupture.

Identification of Any Warning None

that can Occur:

Supplier Identification:

Component Manufacturer

Name: Takata Corporation

Address: Tokyo Front Terrace 19F

2-3-14 Higashishinagawa Shinagawa-ku, Tokyo FOREIGN STATES 140-0002

Country: Japan

Chronology:

November 3, 2015 - NHTSA and Takata entered into a Consent Order in EA15-001 to resolve issues raised in that investigation, to mitigate and control risks of harm, and to promote public safety.

May 4, 2016 - NHTSA and Takata entered into an Amendment to the November 3, 2015 Consent Order. As stated in that Amendment, on the basis of testing and analysis conducted by Takata and by independent research organizations, NHTSA has concluded that, "at some point in the future all non-desiccated frontal Takata PSAN inflators will reach a threshold level of degradation that could result in the inflator becoming unreasonably dangerous." As a result of this conclusion, and pursuant to Paragraph 29 of the November 3, 2015 Consent Order, NHTSA ordered Takata to file certain defect information reports ("DIR"), in accordance with the schedule set forth in Paragraph 14 of the Amendment.

May 16, 2016 - As specified in that schedule, Takata submitted the DIR.

May 20, 2016 - Subaru has determined to launch recall according to Section 46 of Coordinated Remedy Order. January 3, 2017 - As specified in that schedule, Takata submitted the DIR.

January 10, 2017 - Subaru has determined to launch recall according to Section 32 of 3rd amended Coordinated Remedy Order.

Description of Remedy:

Description of Remedy Program: The remedy plan calls for dealers to replace the passenger airbag inflator.

How Remedy Component Differs NR

from Recalled Component:

Identify How/When Recall Condition NR was Corrected in Production :

Recall Schedule:

Description of Recall Schedule: If parts supply is sufficient, Subaru will send owner notification letters

advising the customer to schedule a repair. If parts supply is insufficient, Subaru will send interim notification letters advising the customer they

are affected and will be re-notified when parts supply improves.

On March 6, 2017, owner notification letters were mailed to affected owners of 2009 Legacy and Outback vehicles advising parts are available.

All other affected owners were mailed interim notification letters advising the owners that they are affected and will be re-notified when

parts supply improves.

Planned Dealer Notification Date: JAN 13, 2017 - JAN 13, 2017 Planned Owner Notification Date: MAR 06, 2017 - MAR 06, 2017

^{*} NR - Not Reported