

# Part 573 Safety Recall Report

# 17V-015

**Manufacturer Name :** Jaguar Land Rover North America, LLC**Submission Date :** JAN 10, 2017**NHTSA Recall No. :** 17V-015**Manufacturer Recall No. :** P082**Manufacturer Information :****Population :**

Manufacturer Name : Jaguar Land Rover North America, LLC

Number of potentially involved : 8,769

Address : 555 MACARTHUR BOULEVARD

Estimated percentage with defect : 100 %

MAHWAH NJ 07430

Company phone : 8188500

**Vehicle Information :**

Vehicle 1 : 2007-2009 LAND ROVER RANGE ROVER

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : 2007-2009 MY Land Rover Range Rover Vehicles in select VIN range

Production Dates : AUG 16, 2006 - MAY 08, 2009

VIN Range 1 : Begin : SALMF15497A239092 End : SALME15469A306625  Not sequential

Vehicle 2 : 2012-2012 LAND ROVER RANGE ROVER

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : 2012 MY Land Rover Range Rover Vehicles in select VIN range

Production Dates : FEB 01, 2011 - JUL 26, 2012

VIN Range 1 : Begin : SALMP1E4XCA345963 End : SALMF1E45CA393633  Not sequential**Description of Defect :**

Description of the Defect : Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2012 Model Year (MY) Land Rover Range Rover vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Unless included in "Zone A" above, Land Rover is recalling certain 2009 MY Land Rover Range Rover vehicles, originally sold, or ever registered, in

Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, Land Rover is recalling certain 2007 and 2008 MY Land Rover Range Rover vehicles, originally sold, or ever registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming, or "Zone C".

FMVSS 1 : NR

FMVSS 2 : NR

**Description of the Safety Risk :** These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

**Description of the Cause :** NR

**Identification of Any Warning that can Occur :** NR

## Supplier Identification :

### Component Manufacturer

Name : TK Holdings

Address : Bahnweg 1  
Aschaffenburg FOREIGN STATES 63742

Country : Germany

**Chronology :**

On May 18, 2016, Takata notified Jaguar Land Rover that they had submitted DIR's to NHTSA for the subject inflators. Jaguar Land Rover opened an investigation on May 20, 2016 and reviewed the concern at the Product Safety and Compliance Committee (PSCC) meeting on May 24, 2016. The committee concluded that certain Land Rover Range Rover passenger airbags have been fitted with non-desiccated inflators containing ammonium nitrate. The issue was progressed to the Senior Review Panel (SRP) for determination.

On May 26, 2016 the SRP concluded that, despite Jaguar Land Rover not being aware of any field incidents with the subject Takata inflators, based on the information above provided by Takata and in an abundance of caution, Jaguar Land Rover will conduct a voluntary recall of the vehicles equipped with non-desiccated inflators containing ammonium nitrate in the United States as identified by Takata in their DIR - Equipment Reports 16E-042, 16E-043 and 16E-044.

There have been no reported injuries in Jaguar Land Rover vehicles as a result of this concern.

As part of Jaguar Land Rover's commitment to the co-ordinated remedy program initiated by NHTSA, this notification commences the next stage of the recall campaign to target certain Range Rover 2007, 2008, 2009 and 2012 MY vehicles.

**Description of Remedy :**

Description of Remedy Program : Land Rover will notify owners, and dealers will replace the passenger frontal air bag assemblies. Parts will be available during quarter 1 2017.

There will be no charge to owners for this repair.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : Distribution of interim notification letters will occur on or before March 3, 2017. Notifications to dealers will occur on January 13, 2017.

Planned Dealer Notification Date : JAN 13, 2017 - JAN 13, 2017

Planned Owner Notification Date : MAR 03, 2017 - MAR 03, 2017

\* NR - Not Reported