

# Part 573 Safety Recall Report

# 17V-040

**Manufacturer Name :** Nissan North America, Inc.**Submission Date :** JAN 18, 2017**NHTSA Recall No. :** 17V-040**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Nissan North America, Inc.

Address : P. O. BOX 685001

Franklin TN 37068-5009

Company phone : 800-647-7261

**Population :**

Number of potentially involved : 341,005

Estimated percentage with defect : NR

**Vehicle Information :**

Vehicle 1 : 2015-2017 Nissan Altima

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

Descriptive Information : No other Nissan (or Infiniti) vehicles are affected by this issue because the assembly error occurred during the specified manufacturing period above.

Production Dates : SEP 17, 2015 - OCT 06, 2016

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : During the trim panel installation process in the subject Altima vehicles, the latch-lock cable may not have been routed properly in the rear door. The slit orientation increased the potential for the cable to load the sealing screen (vapor barrier) outboard into the travel path of the window regulator. In certain situations, the cable may interfere with the window regulator causing the rear passenger door to unlatch and inadvertently open when the mechanism is lowered to open the window.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the rear passenger doors inadvertently open while the vehicle is in motion, it may increase the risk of injury to the rear passengers.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

**Supplier Identification :****Component Manufacturer**

Name : NR  
Address : NR  
NR  
Country : NR

**Chronology :**

To be supplemented at a later date

**Description of Remedy :**

Description of Remedy Program : Dealers will modify the door sealing screen using a harness protector patch to allow proper cable routing. If necessary, the latch-lock cable assembly and sealing screen will be replaced with current production level screen.

Nissan will not include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy as the subject vehicles are under warranty.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : Nissan will notify all owners of potentially affected vehicles within sixty (60) days.

Planned Dealer Notification Date : JAN 19, 2017 - NR

Planned Owner Notification Date : NR - NR

\* NR - Not Reported