

# Part 573 Safety Recall Report

# 17V-056

**Manufacturer Name :** Jayco, Inc.

**Submission Date :** JAN 26, 2017

**NHTSA Recall No. :** 17V-056

**Manufacturer Recall No. :** 9903342



## Manufacturer Information :

**Manufacturer Name :** Jayco, Inc.

**Address :** 903 South Main Street

PO Box 460 Middlebury IN 46540

**Company phone :** 800-283-8267

## Population :

**Number of potentially involved :** 25

**Estimated percentage with defect :** 100 %

## Vehicle Information :

**Vehicle 1 :** 2017-2017 Fifth Wheels Eagle

**Vehicle Type :** LIGHT VEHICLES

**Body Style :**

**Power Train :** NR

**Descriptive Information :** 2017 Eagle 360QBOK (WJ) w dry camping option H1WJ0083-0107

**Production Dates :** SEP 09, 2016 - OCT 12, 2016

**VIN Range 1 : Begin :**

NR

**End :** NR

Not sequential

## Description of Defect :

**Description of the Defect :** LP manifold was mounted to fifth wheel frame directly above the axle assembly and U-bolts.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** Impact from the axle can crack the LP manifold, and break free the LP lines and fittings . Damage caused by the axle may not be readily noticeable and could cause ignition of LP gas that could result w personal injury and/or property damage when LP system is tested, filled and/or used.

**Description of the Cause :** When the dry camping option was specified for the 2017 WJ fifth wheel, there was a change made to the axle orientation - went from an over slung to under slung axle. The location specified for the LP manifold was not changed for the under slung axle - this placed the LP manifold vulnerable to damage from the axle.

**Identification of Any Warning that can Occur :** NR

**Supplier Identification :****Component Manufacturer**

Name : NR  
Address : NR  
NR  
Country : NR

**Chronology :**

1-19-2017 Jayco Service Group Reported two WJ Fifth Wheels that noted damage to the LP manifold, lines and fittings at a Dealership. - Investigation started immediately with Operations. Investigation confirmed that an error was made with the manifold location when axle orientation was changed, left the manifold directly above the under slung axle assembly 1-24-17 Decision made a Safety recall was required.

**Description of Remedy :**

Description of Remedy Program : Relocation of the LP Manifold and Inspection of Manifold, LP lines, fittings for replacement when damaged.

How Remedy Component Differs from Recalled Component : Location of LP Manifold

Identify How/When Recall Condition was Corrected in Production : Only one run of WJ Fifth Wheels were produced prior to the model being cancelled. -All units in this single production run are affected by this recall.

**Recall Schedule :**

Description of Recall Schedule : NR  
Planned Dealer Notification Date : MAR 17, 2017 - MAR 17, 2017  
Planned Owner Notification Date : MAR 17, 2017 - MAR 17, 2017

\* NR - Not Reported