

Part 573 Safety Recall Report

17V-092

Manufacturer Name : Daimler Vans USA, LLC**Submission Date :** OCT 30, 2017**NHTSA Recall No. :** 17V-092**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Daimler Vans USA, LLC
Address : 303Perimeter Center North
 Suite 202 Atlanta GA 30346
Company phone : 8548883214

Population :

Number of potentially involved : 2
Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2015-2015 Mercedes-Benz Sprinter
Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES
Body Style : VAN
Power Train : DIESEL

Descriptive Information : 2015 Mercedes-Benz Van**Production Dates :** SEP 26, 2014 - OCT 09, 2014**VIN Range 1 : Begin :** NR **End :** NR Not sequential**Description of Noncompliance :**

Description of the Noncompliance : Daimler AG ("DAG"), the manufacturer of Mercedes-Benz Sprinter Vans, has determined that certain SPRINTER 4x4 market introduction vehicles for the US market were built with a fuel tank, which does not comply with the safety standards. The fuel tank is not equipped with a protective plate at the front and the foam ring at the filler neck. Fulfilment of the FMVSS 301 crash safety requirements has only be confirmed in tests in which the protective plate at the front part of the tank and foam ring were fitted to the vehicle. Fulfilment of the FMVSS 301 without these parts cannot be guaranteed.

FMVSS 1 : NR**FMVSS 2 :** 301 - Fuel system integrity**Description of the Safety Risk :** NR

Description of the Cause : The affected vehicles were built prior to the official start of series production. At that point in time the certification was not yet complete and the vehicles were equipped with pre-series fuel tanks.

Identification of Any Warning that can Occur : NR

Supplier Identification :**Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

Chronology :

DAG was aware that as of December 2014 several market introduction vehicles reached Mercedes-Benz USA Vehicle Preparation Centers (VPC). The purpose of these vehicles was the use for exhibitions, sales pictures and showroom presentations and these vehicles should remain in possession of MB USA until re-work to final series configuration was carried out properly. In March 2016 DAG received unconfirmed information that some vehicles were probably sold to customers without completion of the required re-work. DAG started investigation and identification of explicit configuration of each vehicle. Moreover, DAG checked the complete population of the market introduction vehicles with respect to their current location. The remaining vehicles in the VPC were instantly blocked to prevent sale/dispatch and to start the required re-work accordingly. In December 2016 DAG received the final information on the exact number of affected vehicles in customers' hands.

Daimler AG is not aware of any complaints from customers concerning this matter.

Description of Remedy :

Description of Remedy Program : Topic
Fuel tank
Line/Model name
Sprinter 2500, 3500
VIN Range
5972758 - 5975026
If noncompliance, FMVSS
FMVSS 301
Estimated percentage of affected
The percentage of vehicles that are projected to be actually affected by the issue described below is 100%.

Daimler AG ("DAG"), the manufacturer of Mercedes-Benz Sprinter Vans, has determined that certain SPRINTER 4x4 market introduction vehicles for the US market were built with a fuel tank, which does not comply with the safety standards. The fuel tank is not equipped with a protective plate at the front and the foam ring at the filler neck. Fulfilment of the FMVSS 301 crash safety requirements has only be confirmed in tests in which the protective plate at the front part of the tank and foam ring were fitted to the vehicle. Fulfilment of the FMVSS 301 without these parts cannot be guaranteed.

Descriptive Information
NR

The affected vehicles were built prior to the official start of series production. At that point in time the certification was not yet complete and the vehicles were equipped with pre-series fuel tanks.

Supplier Information
NR

Remedy Program

An authorized Mercedes-Benz Sprinter dealer will replace the fuel tank on affected vehicles. Pursuant to 49 C.F.R. § 577.11(e), Daimler Vans does not plan to provide notice about pre-notice reimbursement to owners since all involved vehicles remain covered under the new vehicle warranty.

How Remedy Component Differs from Recalled Component : The remedy component is a fuel tank built according to the certified configuration with the protective plate and the foam ring´.

Identify How/When Recall Condition was Corrected in Production : From the start of series production all manufactured vehicles were equipped with the correct fuel tank and are thus built according to the certified configuration.

Recall Schedule :

Description of Recall Schedule : Dealers will be notified of the pending voluntary recall campaign. A copy of all communications will be provided when available.

Planned Dealer Notification Date : JUN 06, 2017 - JUN 06, 2017

Planned Owner Notification Date : JUN 06, 2017 - JUN 06, 2017

Owners will be notified one week after the recall launch to the dealers.

* NR - Not Reported