Part 573 Safety Recall Report

Manufacturer Name :Volvo Car USA LLCSubmission Date :FEB 16, 2017NHTSA Recall No. :17V-104Manufacturer Recall No. :R89714

Image: Constraint of the state of the

17V-104

Manufacturer Inform	ation :	Population :	
Manufacturer Name :	Volvo Car USA LLC	Number of potentially involved : 5,52	29
Address :	AUTOMOTIVE SAFETY & COMPLIANCE 1 VOLVO DRIVE, BUILDING B ROCKLEIGH NJ 07647	Estimated percentage with defect : N	R
Company phone :	201-768-7300		

Vehicle Information :

Vehicle 1:	2017-2	2017 Volvo XC90, S90, V9	0CC		
Vehicle Type :	LIGHT	VEHICLES			
Body Style :	ALL				
Power Train :	GAS				
Descriptive Information :	be affe		error tl	olts holding the inflatable hat may cause the bolt hea e curtain in place.	
Production Dates :	NOV 1	4, 2016 - JAN 31, 2017			
VIN Range 1:	Begin :	YV1102AK0H1011080	End :	YV1PSA2MCH1015538	Not sequential
VIN Range 2:	Begin :	YV1PZA8ACH1000098	End :	YV1PZA8BCH1002644	Not sequential
VIN Range 3:	Begin :	PNVLFBAADH5132519	End :	YV4A22PL6H1166052	☐ Not sequential

Description of Defect :

Manufacturing error in the surface treatment process leading to hydrogen embrittlement within some bolts due to process variability at the supplier. The bolts are used to assemble the inflatable curtain (IC). When affected bolts are used and assembled an internal chemical process within the bolt may start. This may after a certain time period (about 48 hours) result in a bolt breakage. If the bolt has not broken after this time, it is fully functional.
226 - Ejection mitigation
NR
If the vehicle has been assembled with one or more of the affected bolt, the customer may notice noise over time. However in the event of a crash, passengers may have less protection from the IC than intended hence increasing the risk of injury to the vehicle occupants.
mation contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

Page 2

Description of the Cause :	Manufacturing error in the surface treatment process leading to hydrogen embrittlement within some bolts due to process variability at the supplier. The bolts are used to assemble the inflatable curtain (IC).
<i>.</i>	If the vehicle has been assembled with one or more of the affected bolt, the customer may notice noise over time. However in the event of a crash, passengers may have less protection from the IC than intended hence increasing the risk of injury to the vehicle occupants.

Supplier Identification :

Component Manufacturer

Name : Autoliv Poland Sp. Z O.o.

Address : Ul. Belgijska 2 55-200, JELCZ-LASKOWICE FOREIGN STATES Country : Poland

Chronology:

In the beginning of February Volvo Cars received a Vehicle Report (VR) containing one vehicle. During repair of the courtesy handle a detached bolt head was found, further investigation showed that the bolt head came from the IC installation.

Due to the severity of the issue, an investigation started at Volvo Cars together with the sub supplier to analyze the root cause of the problem.

On the 10th of February the Critical Concern Management Team (CCMT) at Volvo Cars considers this potentially critical, CCMT decides to start recall preparation.

A port investigation was issued on the 13th of February to block and check vehicles in port to further investigate the fault frequency.

The 16th of February CCMT approves the initial Part 573 notification to NHTSA. Investigation still ongoing to identify concerned vehicles together with the supplier from the concerned batch numbers.

Volvo Cars will file an updated Part 573 when the vehicles have been identified.

Description of Remedy :

Description of Remedy Program : Inspect and if necessary replace affected bolts.

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

How Remedy Component Differs from Recalled Component :	NR
Identify How/When Recall Condition was Corrected in Production :	NR
Recall Schedule :	
Netan Scheuure.	NR
Description of Recall Schedule .	
Description of Recall Schedule : Planned Dealer Notification Date :	

The information contained in this report was submitted pursuant to 49 CFR §573