

Part 573 Safety Recall Report

17V-142

Manufacturer Name : Hyundai Motor America**Submission Date :** MAR 06, 2017**NHTSA Recall No. :** 17V-142**Manufacturer Recall No. :** 159**Manufacturer Information :**

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 800-633-5151

Population :

Number of potentially involved : 190

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2017-2017 Hyundai Santa Fe Sport

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : Certain Model Year 2017 Hyundai Santa Fe Sport vehicles manufactured at Kia Motor Manufacturing Georgia (KMMG) produced beginning on February 01, 2016 through November 15, 2016.

Production Dates : FEB 01, 2016 - NOV 15, 2016

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Noncompliance :**

Description of the Noncompliance : The 2017 model year Hyundai Santa Fe Sport is equipped with a Tire Pressure Monitoring System (TPMS) that is designed to meet the requirements of FMVSS No. 138; Tire pressure monitoring systems. The affected vehicle may have TPMS sensors which were not set in the correct mode at the vehicle assembly plant and therefore will not provide an appropriate warning in the event of an underinflated tire for which the warning is required.

This condition affects certain model year 2017 Hyundai Santa Fe Sport vehicles produced at Kia Motor Manufacturing Georgia beginning on February 01, 2016 through November 15, 2016.

FMVSS 1 : 138 - Tire pressure monitoring systems

FMVSS 2 : NR

Description of the Safety Risk : Noncompliance with FMVSS No. 138; Tire pressure monitoring systems. An improperly inflated tire may increase the risk of a crash.

Description of the Cause : TPMS sensors not programmed correctly during wheel/tire assembly.

Identification of Any Warning NR
that can Occur :

Supplier Identification :

Component Manufacturer

Name : NR
Address : NR
NR
Country : NR

Chronology :

See attached "Santa Fe Sport TPMS Chronology.pdf."

Description of Remedy :

Description of Remedy Program : Hyundai Motor America will notify all owners of affected vehicles by first class mail to return to their Hyundai dealer to replace the affected tire pressure sensor(s).

The tire pressure sensor for the vehicles affected by this recall is covered for 5 years or 60,000 miles under Hyundai's new vehicle limited warranty. As owners of these vehicles would not have incurred expenses for the warranted repair as a result of this condition, no notification regarding reimbursement under section 577.11 is necessary.

How Remedy Component Differs NR
from Recalled Component :

Identify How/When Recall Condition Revised tire/wheel assembly process.
was Corrected in Production :

Recall Schedule :

Description of Recall Schedule : NR
Planned Dealer Notification Date : MAR 06, 2017 - MAR 06, 2017
Planned Owner Notification Date : MAR 31, 2017 - MAR 31, 2017

* NR - Not Reported