

Part 573 Safety Recall Report

17V-153

Manufacturer Name : Jaguar Land Rover North America, LLC**Submission Date :** MAR 09, 2017**NHTSA Recall No. :** 17V-153**Manufacturer Recall No. :** H009**Manufacturer Information :****Population :**

Manufacturer Name : Jaguar Land Rover North America, LLC

Number of potentially involved : 25

Address : 555 MACARTHUR BOULEVARD

Estimated percentage with defect : 100 %

MAHWAH NJ 07430

Company phone : 8188500

Vehicle Information :

Vehicle 1 : 2017-2017 JAGUAR F-PACE

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : NR

Descriptive Information : 2017 MY Jaguar F-PACE Vehicles in select VIN range

Production Dates : APR 13, 2016 - APR 13, 2016

VIN Range 1 : Begin : SADCK2BV3HA054429 End : SAD CJ2BV2HA054568 Not sequential**Description of Defect :**

Description of the Defect : Jaguar Land Rover has identified a concern with certain 2017 Model Year (MY) Jaguar F-PACE vehicles specified with automatic transmissions where the vehicle may have been fitted with the incorrect specification rear driveshaft. Vehicles may have had a driveshaft specified for an XE vehicle instead of for an F-PACE vehicle. The driveshaft length is different with XE having a shorter shaft. Where an F-PACE vehicle is fitted with an XE rear driveshaft the customer may experience underbody noise and/or notice an oil leak. In extreme cases, the driveshaft may detach from the differential and as a result, the vehicle would lose drive.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Sudden loss of drive while the vehicle is in motion could increase the risk of a vehicle crash.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :**Component Manufacturer**

Name : GKN Driveline Birmingham
Address : Chester Road
Erdington Birmingham FOREIGN STATES B24 ORB
Country : United Kingdom

Chronology :

See Document "JLR H009 Chronology".

Description of Remedy :

Description of Remedy Program : Owners will be notified and instructed to take their vehicle to an approved Jaguar dealer who will inspect and identify if the incorrect rear driveshaft is fitted. If the incorrect rear driveshaft is fitted, it will be replaced. If the correct rear driveshaft is fitted no further action is required and the vehicle will be returned to the customer.

There will be no charge to owners for this repair.

How Remedy Component Differs
from Recalled Component : NR

Identify How/When Recall Condition
was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Distribution of notification letters will occur on or before May 1, 2017.
Notifications to dealers will occur on March 14, 2017.

Planned Dealer Notification Date : MAR 14, 2017 - MAR 14, 2017

Planned Owner Notification Date : MAY 01, 2017 - MAY 01, 2017

* NR - Not Reported