

Part 573 Safety Recall Report

17V-226

Manufacturer Name : Hyundai Motor America**Submission Date :** AUG 22, 2017**NHTSA Recall No. :** 17V-226**Manufacturer Recall No. :** 162**Manufacturer Information :**

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 800-633-5151

Population :

Number of potentially involved : 572,000

Estimated percentage with defect : 2 %

Vehicle Information :

Vehicle 1 : 2013-2014 Hyundai Santa Fe Sport

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : Model Year 2013 through 2014 Hyundai Santa Fe Sport vehicles produced at Kia Motor Manufacturing Georgia equipped with 2.0 liter and 2.4 liter Gasoline Direct injection engines produced beginning on June 28, 2012 through May 31, 2014.

Production Dates : JUN 28, 2012 - SEP 12, 2014

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Vehicle 2 : 2013-2014 Hyundai Sonata

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

Descriptive Information : Model Year 2013 through 2014 Hyundai Sonata sedans produced at Hyundai Motor Manufacturing Alabama equipped with 2.0 liter and 2.4 liter Gasoline Direct injection engines produced beginning on March 21, 2012 through May 29, 2014.

Production Dates : MAR 21, 2012 - MAY 29, 2014

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : The subject engines may contain residual debris from factory machining operations, potentially restricting oil flow to the main bearings and leading to premature bearing wear. A worn connecting rod bearing will produce a cyclic knocking noise from the engine and may also result in the illumination of the oil pressure lamp in the instrument panel. Over time, the bearing may fail and the vehicle could lose motive power while in motion.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : An engine stall at higher speeds can increase the risk of a crash.

Description of the Cause : NR

Identification of Any Warning that can Occur :

1. Knocking noise from engine
2. Reduced power and/or hesitation
3. Illumination of the "Check Engine" warning lamp
4. Illumination of engine oil pressure warning lamp

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

In September, 2015 Hyundai initiated a recall for Model Year 2011 and 2012 Hyundai Sonata vehicles manufactured at Hyundai Motor Manufacturing Alabama (HMMA) equipped with 2.0 liter and 2.4 liter Gasoline Direct injection engines based on the number of engine replacements in those model years. At the same time, Hyundai initiated a warranty extension for the engine short block assembly for all 2011 through 2014 MY Sonata ("YF" platform) vehicles manufactured at HMMA. Hyundai continued to monitor engine-related field data during 2016 and into 2017, noting an increase in claims relating to the subsequent model years. Although the majority of the claims for engine replacement indicated that customers were responding to substantial noise or the vehicle's check engine or oil pressure warning lights (and bringing their vehicles to service as a result of those warnings), in certain instances customers reported stalling events, including some at higher speeds. Some customers mention being able to restart their vehicles and/or to move the vehicles to the side of the road.

After further discussions, on March 24, 2017, Hyundai decided to convert the extended warranty for the remaining 2013 and 2014 Model Year Sonatas to a safety recall, and to add the corresponding population of "AN" platform Santa Fe Sport vehicles manufactured at HMMA, which have exhibited a similar field experience.

There have been no reports of accidents or injuries attributed to this condition.

Description of Remedy :

Description of Remedy Program : Hyundai Motor America plans to notify owners of affected vehicles to return their vehicles to their Hyundai dealers to inspect, and if necessary, replace the engine sub-assembly (or “short block”).

Hyundai will provide reimbursement to owners for repairs according to the plan submitted on November 20, 2016.

How Remedy Component Differs from Recalled Component : As a regular part of its process improvement, Hyundai has routinely implemented revisions to its manufacturing and assembly processes to reduce the potential for bearing damage. Claim data indicates a corresponding reduction in related field claims.

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Hyundai will begin notifying dealers and owners on May 19, 2017. Interim notices will be sent to owners who have been notified within 60 days of submission of this report. Final notifications are expected to be completed by the end of September. Copies of all communications will be sent to ODI when available.

Planned Dealer Notification Date : MAY 19, 2017 - MAY 19, 2017

Planned Owner Notification Date : MAY 19, 2017 - SEP 30, 2017

* NR - Not Reported