

Part 573 Safety Recall Report

17V-268

Manufacturer Name : Nissan North America, Inc.**Submission Date :** AUG 28, 2017**NHTSA Recall No. :** 17V-268**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Nissan North America, Inc.

Address : P. O. BOX 685001

Franklin TN 37068-5009

Company phone : 800-647-7261

Population :

Number of potentially involved : 44,264

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2016-2017 Nissan Titan XD Crew Cab

Vehicle Type : LIGHT VEHICLES

Body Style : PICKUP TRUCK

Power Train : DIESEL

Descriptive Information : No other Nissan models are affected.

Production Dates : AUG 07, 2015 - FEB 24, 2017

VIN Range 1 : Begin : NR End : NR

 Not sequential

Vehicle 2 : 2016-2017 Nissan Titan Crew Cab

Vehicle Type : LIGHT VEHICLES

Body Style : PICKUP TRUCK

Power Train : GAS

Descriptive Information : No other Nissan models are affected.

Production Dates : SEP 29, 2015 - FEB 24, 2017

VIN Range 1 : Begin : NR End : NR

 Not sequential**Description of Noncompliance :**

Description of the Noncompliance : The rear seat belt assembly may not meet S7 of FMVSS No. 201. More specifically, the HIC(d) value for target RP2 specified in S10.4(b)(2) was 1,007.9 during NHTSA test conducted at MGA (MGA Test Report Mo. G17I7-001.6). This HIC(d) value for target RP2 exceeds the maximum of 1,000 specified in S7.

FMVSS 1 : 201 - Occupant protection in interior impact

FMVSS 2 : NR

Description of the Safety Risk : Due to the slightly higher HIC(d) value, if the occupant's head were to impact the D-ring bolt trim cap in the event of an accident, there is an increased risk

Description of the Cause : NR of injury.
Identification of Any Warning that can Occur : NR

Supplier Identification :

Component Manufacturer

Name : NR
Address : NR
NR
Country : NR

Chronology :

See attached 573 for chronology.

Description of Remedy :

Description of Remedy Program : Nissan dealers will apply energy absorbing material to the existing C-Pillar Finisher and replace the Seatbelt Bolt and Bolt Cap.

We will not include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy as the subject vehicles are under warranty.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Nissan plans to notify dealers on July 31, 2017 and will notify all affected owners within 60 days of NCIR submission to bring their vehicle into a Nissan dealer.

Planned Dealer Notification Date : JUL 31, 2017 - NR

Planned Owner Notification Date : SEP 11, 2017 - NR

* NR - Not Reported