

# Part 573 Safety Recall Report

# 17V-341

**Manufacturer Name :** Jaguar Land Rover North America, LLC**Submission Date :** JUN 20, 2017**NHTSA Recall No. :** 17V-341**Manufacturer Recall No. :** H026**Manufacturer Information :****Population :**

Manufacturer Name : Jaguar Land Rover North America, LLC

Number of potentially involved : 19

Address : 555 MACARTHUR BOULEVARD

Estimated percentage with defect : 100 %

MAHWAH NJ 07430

Company phone : 8188500

**Vehicle Information :**

Vehicle 1 : 2018-2018 Jaguar F-TYPE

Vehicle Type : LIGHT VEHICLES

Body Style : 2-DOOR

Power Train : GAS

Descriptive Information : 2018 Model Year Jaguar F-TYPE vehicles in stated VIN range with Highline headlamps.

Production Dates : MAR 09, 2017 - APR 18, 2017

VIN Range 1 : Begin : SAJDZ1FE1JCK48419 End : SAJDZ1FEXJCK50184  Not sequential**Description of Noncompliance :**

Description of the Noncompliance : A non-compliance has been identified where, in the event of a front turn signal indicator lamp Light Emitting Diode (LED) failure or failure of the headlamp module which affects operation of the front turn signal indicator lamps, the required warning needed to comply with Federal Motor Vehicle Safety Standard (FMVSS) 108 Lamps, Reflective Devices and Associated Equipment is not provided.

The frequency tell-tale illumination and audible "tick-tock" are unchanged and the driver will not be alerted to a failure of one or both of the front turn signal indicator lamps.

FMVSS 1 : 108 - Lamps, reflective devices, and assoc. Equipment

FMVSS 2 : NR

Description of the Safety Risk : If a turn signal is not illuminating other driver's may not be aware that the affected vehicle is turning, increasing the risk of a crash.

Description of the Cause : NR

Identification of Any Warning NR  
that can Occur :

## Supplier Identification :

### Component Manufacturer

Name : Automotive Lighting Reutlingen GmbH  
Address : P.O. Box 1161  
72701 Reutlingen FOREIGN STATES  
Country : Germany

## Chronology :

A Product Safety and Compliance Committee (PSCC) Investigation was opened on May 9, 2017, following report of a concern from a development vehicle during testing, where a front turn signal indicator lamp LED failure did not trigger the required failure warning.

At the PSCC on May 16, 2017, Engineering stated that this issue was only identified on Highline F-TYPE 2018MY vehicles. The PSCC concluded that this concern should be progressed to the Recall Determination Committee (RDC).

The RDC reviewed all information on May 18, 2017 and concluded that the issue represented a compliance concern to Federal Motor Vehicle Safety Standard (FMVSS) 108 Lamps, Reflective Devices and Associated Equipment regulation and that a voluntary non-compliance recall be conducted.

Jaguar Land Rover is not aware of any reports of accidents or injuries attributed to this condition.

## Description of Remedy :

Description of Remedy Program : Owners will be notified and instructed to take their vehicles to an approved Jaguar dealer who will update the vehicle with the latest software.

How Remedy Component Differs NR  
from Recalled Component :

Identify How/When Recall Condition NR  
was Corrected in Production :

## Recall Schedule :

Description of Recall Schedule : Mailing of owner notification letters will occur on or before July 17, 2017.  
Notifications to dealers will occur on June 1, 2017.

Planned Dealer Notification Date : JUN 01, 2017 - JUN 01, 2017

Planned Owner Notification Date : JUL 17, 2017 - JUL 17, 2017

\* NR - Not Reported