

Part 573 Safety Recall Report

17V-357

Manufacturer Name : Polaris Industries, Inc.**Submission Date :** OCT 23, 2017**NHTSA Recall No. :** 17V-357**Manufacturer Recall No. :** T-17-04**Manufacturer Information :**

Manufacturer Name : Polaris Industries, Inc.

Address : 2100 Highway 55

Medina MN 55340

Company phone : 800-765-2747

Population :

Number of potentially involved : 8,962

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2015-2017 Polaris Slingshot

Vehicle Type : LIGHT VEHICLES

Body Style : OTHER

Power Train : GAS

Descriptive Information : The affected vehicles were identified based on manufacturing records. The VINs identified contain all of the potentially affected machines.

Production Dates : APR 21, 2014 - SEP 07, 2016

VIN Range 1 : Begin : 57XAASFA4F5100019 End : 57XAARFA7H8120002 Not sequential**Description of Defect :**

Description of the Defect : During performance of the repair prescribed in NHTSA Recall No. 16V-755, service kits were shipped to servicing dealers without two dust plug grommets. Without dust plug grommets, debris can contaminate or foul the rear wheel speed sensor. If the speed sensor becomes inoperative, ABS and Traction/Stability control dash lights will activate.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : ABS and Traction/Stability Control failure can increase the risk of a crash.**Description of the Cause :** Without dust plug grommets, debris can contaminate or foul the rear wheel speed sensor.**Identification of Any Warning that can Occur :** If the speed sensor becomes inoperative, ABS and Traction/Stability control dash lights will activate.**Supplier Identification :**

Component Manufacturer

Name : Polaris Industries
Address : 2100 Highway 55
Medina 55340
Country : NR

Chronology :

On 5/25/2017, Polaris determined that the incorrect performance of NHTSA Recall No. 16V-755 created a secondary defect that created a risk to motor vehicle safety.

Description of Remedy :

Description of Remedy Program : Polaris will issue a Safety Recall Bulletin with instructions to a) inspect for the presence or absence of the grommets and b) if necessary, install the grommets.

How Remedy Component Differs from Recalled Component : The remedy component contains the dust plug grommets that were not included in the 16V-755 repair kit.

Identify How/When Recall Condition was Corrected in Production : For units undergoing factory rework for NHTSA Recall No. 16V-755, grommets are being added to the repair kit in service.

Recall Schedule :

Description of Recall Schedule : Upon review and approval from NHTSA, Polaris will contact dealers and consumers advising them of the voluntary safety recall bulletin regarding the issue.

Planned Dealer Notification Date : JUN 16, 2017 - NR

Planned Owner Notification Date : JUN 20, 2017 - NR

* NR - Not Reported