

Part 573 Safety Recall Report

17V-424

Manufacturer Name : Honda (American Honda Motor Co.)**Submission Date :** JUN 30, 2017**NHTSA Recall No. :** 17V-424**Manufacturer Recall No. :** KF8**Manufacturer Information :**

Manufacturer Name : Honda (American Honda Motor Co.)

Address : 1919 Torrance Blvd.

Torrance CA 90501

Company phone : 1-888-234-2138

Population :

Number of potentially involved : 193

Estimated percentage with defect : NR

Vehicle Information :

Vehicle 1 : 2017-2017 Acura MDX Sport Hybrid

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined based on manufacturing records. The VIN range reflects all possible vehicles that could potentially experience the problem.

Production Dates : MAR 23, 2017 - MAY 18, 2017

VIN Range 1 : Begin : 5FRYD7H77HB000106 End : 5FRYD7H79HB000673 Not sequential**Description of Defect :**

Description of the Defect : The engine fuel feed hose and fuel purge hose in certain vehicles, were misrouted during vehicle assembly. Engine vibration can cause the fuel feed hose to rub against the breather pipe, and, over time, the fuel feed hose can sustain damage.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If either hose becomes damaged, a fuel leak can occur, which in the presence of an ignition source increases the risk of a fire.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :

Component Manufacturer

Name : NR
Address : NR
NR
Country : NR

Chronology :

June 7, 2017 A misrouted fuel feed hose and fuel purge hose was found during a routine quality check at the factory.

June 7 – June 16, 2017 Honda launched an investigation, including a review of manufacturing processes, yard inspection of available vehicles, and the potential consequences of this misrouting.

June 29, 2017 Honda made the determination that a defect related to motor vehicle safety exists and decided to conduct a safety recall.

As of June 29, 2017, Honda has not received any field reports, warranty claims, nor reports of fire or injuries related to this issue.

Description of Remedy :

Description of Remedy Program : Registered owners of all affected vehicles will be contacted by mail and asked to take their vehicle to an Acura dealer. The dealer will inspect the fuel feed hose and fuel purge hose and, if misrouted, will replace and install the hoses correctly. This inspection and, if necessary, repair will be completed free of charge.

How Remedy Component Differs NR
from Recalled Component :

Identify How/When Recall Condition NR
was Corrected in Production :

Recall Schedule :

Description of Recall Schedule : NR
Planned Dealer Notification Date : JUN 30, 2017 - NR
Planned Owner Notification Date : JUL 31, 2017 - NR

* NR - Not Reported