

Part 573 Safety Recall Report

17V-556

Manufacturer Name : KZRV, L.P.**Submission Date :** SEP 07, 2017**NHTSA Recall No. :** 17V-556**Manufacturer Recall No. :** KZ-2017-06**Manufacturer Information :**

Manufacturer Name : KZRV, L.P.

Address : 0985 N 900W

Shipshewana IN 46565

Company phone : 260-768-4016

Population :

Number of potentially involved : 2,382

Estimated percentage with defect : 75 %

Vehicle Information :

Vehicle 1 : 2017-2018 KZ RV Sport Trek

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : Production records were reviewed to determine last installation of the missing fuse.
The recalled products do not contain the required fuse.

Production Dates : NOV 22, 2016 - SEP 01, 2017

VIN Range 1 : Begin : 4EZT12527H8111320 End : 4EZT13228J8082667 Not sequential

Vehicle 2 : 2017-2018 KZ RV Spree

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : Production records were reviewed to determine last installation of the missing fuse.
The recalled products do not contain the required fuse.

Production Dates : NOV 22, 2016 - SEP 01, 2017

VIN Range 1 : Begin : 4EZT12527H8111320 End : 4EZT13228J8082667 Not sequential

Vehicle 3 : 2017-2018 KZ RV Connect

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : Production records were reviewed to determine last installation of the missing fuse.
The recalled products do not contain the required fuse.

Production Dates : NOV 22, 2016 - SEP 01, 2017

VIN Range 1 : Begin : 4EZT12527H8111320 End : 4EZT13228J8082667 Not sequential

Description of Defect :

Description of the Defect : A 2 amp fuse may not have been installed in the circuit for the awning lights in recreational vehicle trailers manufactured in KZ-RV Plant 8. This fuse provides over current protection to the wire supplying DC power to the awning lights.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Without the proper over current protection, in an overload situation the wiring for the awning could heat up resulting in a fire.

Description of the Cause : New personnel on the manufacturing floor were not properly trained.

Identification of Any Warning that can Occur : None

Supplier Identification :**Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

Chronology :

8-31-2017 New equipment was being installed in plant 8 product. Upon reviewing the requirements, it was discovered the previous awning installations did not include the required 2 amp fuse protection.

9-1-2017 Investigation determined the last confirmed fuse was in place on 11-22-2016. A meeting of the KZRV, LP Safety Committee was held and the decision was made to conduct a safety recall to correct the affected product.

Description of Remedy :

Description of Remedy Program : Identified product will be inspected for the presence of the described fuse. If not present, the fuse assembly will be added.

How Remedy Component Differs from Recalled Component : A remedied vehicle contains the required 2 amp fuse.

Identify How/When Recall Condition was Corrected in Production : The proper fuse is now installed on all recreational vehicle trailers manufactured in KZ-RV Plant 8 as of 9/1/2017.

Recall Schedule :

Description of Recall Schedule : KZ RV will notify the dealers and owners of the recreational vehicles by letter. A final copy of the owner letter will be provided to NHTSA, along with the dealer repair procedures.

Planned Dealer Notification Date : NOV 02, 2017 - NOV 02, 2017

Planned Owner Notification Date : NOV 02, 2017 - NOV 02, 2017

* NR - Not Reported