#### OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

# 17V-725

**Manufacturer Name:** Honda (American Honda Motor Co.)

Submission Date: NOV 21, 2017 NHTSA Recall No.: 17V-725 Manufacturer Recall No.: SOG



Manufacturer	Information :	

Manufacturer Name: Honda (American Honda Motor Co.)

Address: 1919 Torrance Blvd.

Torrance CA 90501

Company phone: 1-888-234-2138

# **Population:**

Number of potentially involved: 806,936 Estimated percentage with defect: 100 %

#### **Vehicle Information:**

Vehicle 1: 2011-2011 Honda Odyssey

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: The recall population was determined based on manufacturing records. The VIN

range reflects all possible vehicles that could potentially experience the problem.

All 2011-2017 model year Odyssey vehicles are being recalled. Prior and later model

year Odyssey vehicles have different second row seat attachment mechanisms.

Production Dates: MAR 02, 2010 - SEP 22, 2011

Vehicle 2: 2012-2012 Honda Odyssey

Vehicle Type : Body Style : Power Train : NR

Descriptive Information : The recall population was determined based on manufacturing records. The VIN

range reflects all possible vehicles that could potentially experience the problem.

All 2011-2017 model year Odyssey vehicles are being recalled. Prior and later model  $\,$ 

year Odyssey vehicles have different second row seat attachment mechanisms.

Production Dates: AUG 23, 2011 - SEP 12, 2012

Vehicle 3: 2013-2013 Honda Odyssey

Vehicle Type:

Body Style :								
Power Train :	NR							
Descriptive Information :	The recall population was determined based on manufacturing records. The VIN range reflects all possible vehicles that could potentially experience the problem.							
	All 2011-2017 model year Odyssey vehicles are being recalled. Prior and later model year Odyssey vehicles have different second row seat attachment mechanisms.							
Production Dates :	AUG 28, 2012 - JUN 07, 2013							
VIN Range 1:	Begin: 5FNRL5H24DB001001 End: 5FNRL5H68DB092311 ☐ Not sequential							
VIN Range 2:	Begin: 5FNRL5H62DB001372 End: 5FNRL5H64DB076882 Not sequential							
8								
Vehicle 4:	2014-2014 Honda Odyssey							
Vehicle Type :	, ,							
Body Style :								
Power Train :								
Descriptive information :	The recall population was determined based on manufacturing records. The VIN							
	range reflects all possible vehicles that could potentially experience the problem.							
	All 2011-2017 model year Odyssey vehicles are being recalled. Prior and later model							
	year Odyssey vehicles have different second row seat attachment mechanisms.							
Production Dates :	MAY 28, 2013 - SEP 08, 2014							
	Begin: 5FNRL5H96EB001001 End: 5FNRL5H40EB139671 Not sequential							
· ·	Begin: 5FNRL5H62EB001275 End: 5FNRL5H61EB121181 Not sequential							
VIIV Range Σ.	begiii. 5170kL51102Eb001275 Elid. 5170kL51101Eb121101							
Vehicle 5:	2015-2015 Honda Odyssey							
Vehicle Type :	, ,							
<b>0 1</b>								
Body Style :								
Power Train:								
Descriptive Information :	The recall population was determined based on manufacturing records. The VIN							
	range reflects all possible vehicles that could potentially experience the problem.							
	All 2011-2017 model year Odyssey vehicles are being recalled. Prior and later model							
	year Odyssey vehicles have different second row seat attachment mechanisms.							
Production Dates	JUL 31, 2014 - AUG 06, 2015							
G	Begin: 5FNRL5H49FB001001 End: 5FNRL5H67FB132140 Not sequential							
VIN Range 2:	Begin: 5FNRL5H68FB013156 End: 5FNRL5H46FB120558  Not sequential							
Vohiolo 6	2016 2016 Handa Odyggay							
	2016-2016 Honda Odyssey							
Vehicle Type :								
Body Style :								
Power Train :								
Descriptive Information :	The recall population was determined based on manufacturing records. The VIN							
	range reflects all possible vehicles that could potentially experience the problem.							

	All 2011-2017 model year Odyssey vehicles are being recalled. Prior and later model year Odyssey vehicles have different second row seat attachment mechanisms.  Production Dates: JUL 14, 2015 - DEC 20, 2016							
<b>Production Dates:</b>								
VIN Range 1:	Begin:	5FNRL5H38GB001001	End:	5FNRL5H38GB169835	☐ Not sequential			
VIN Range 2:	Begin:	5FNRL5H6XGB001379	End:	5FNRL5H40GB149426	☐ Not sequential			
Vehicle 7: 2017-2017 Honda Odyssey								
Vehicle Type :								
Body Style :								
Power Train :	NR							
Descriptive Information :	ve Information : The recall population was determined based on manufacturing records. The VIN range reflects all possible vehicles that could potentially experience the problem.							
All 2011-2017 model year Odyssey vehicles are being recalled. Prior and later mode year Odyssey vehicles have different second row seat attachment mechanisms.								
Production Dates:	DEC 20	), 2016 - APR 13, 2017						
VIN Range 1:	Begin:	5FNRL5H69HB000001	End:	5FNRL5H45HB027131	■ Not sequential			
VIN Range 2:	Begin :	5FNRL5H40HB001262	End:	5FNRL5H66HB020769	☐ Not sequential			

## **Description of Defect:**

Description of the Defect: The second row outboard (outer) seats can be placed in two positions,

standard and wide. The rear outboard seat strikers have a collar to define the two set positions. If an outboard seat is positioned over the collar while attaching the seat to the vehicle floor, the seat will not latch properly to the

seat striker.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk : An unlatched second row outboard seat could tip forward during moderate to

heavy braking increasing the risk of injury to an occupant, including a child

seated in a LATCH child seat.

Description of the Cause: NR

Identification of Any Warning NR

that can Occur:

#### **Supplier Identification:**

#### **Component Manufacturer**

Name: NR Address: NR NR Country: NR

### **Chronology:**

Please refer to the attached document titled 'Chronology.pdf'.

### **Description of Remedy:**

Description of Remedy Program: Registered owners of affected vehicles will receive a notification letter in

the mail that will contain detailed instructions for installing/positioning second row outer seats and confirming that they are securely latched. Similar information will be provided via online and social media channels prior to the notification. Once a final remedy is determined and the necessary parts are available, Honda will send a second letter to registered

owners asking them to bring their vehicles to a dealership for a free repair.

How Remedy Component Differs NR

from Recalled Component:

Identify How/When Recall Condition NR

was Corrected in Production:

#### **Recall Schedule:**

Description of Recall Schedule: Owners will be notified by mail on or about December 18, 2017.

Planned Dealer Notification Date: NOV 18, 2017 - NR Planned Owner Notification Date: DEC 18, 2017 - NR

\* NR - Not Reported