

# Part 573 Safety Recall Report

# 17V-764

**Manufacturer Name :** Bugatti  
**Submission Date :** DEC 12, 2017  
**NHTSA Recall No. :** 17V-764  
**Manufacturer Recall No. :** NR

**Manufacturer Information :**

**Manufacturer Name :** Bugatti  
**Address :** 1 Chateau St Jean  
 Dorlisheim, France 00 67120  
**Company phone :** 999

**Population :**

**Number of potentially involved :** 9  
**Estimated percentage with defect :** 1 %

**Vehicle Information :**

**Vehicle 1 :** 2017-2018 Bugatti Chiron  
**Vehicle Type :** LIGHT VEHICLES  
**Body Style :** 2-DOOR  
**Power Train :** GAS

**Descriptive Information :** "Both seat recliner brackets could have a defective weld. The population was determined for all delivered car before the first seat was found defective in production (10.18.2017) After the first seat was found, all other production car in our hand have been completely checked. The seat production process has been optimized to avoid any further issues. The new produced seats have a mark on the welding (implemented by supplier the 10.27.2017)"

**Production Dates :** FEB 02, 2017 - OCT 13, 2017

**VIN Range 1 : Begin :** NR **End :** NR

Not sequential

**Description of Defect :**

**Description of the Defect :** Seat recliner bracket welding is potentially not complete

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** The seat back may potentially not hold properly, which could affect the driving position

**Description of the Cause :** Improper manual positioning of the recliner's parts during the welding process

**Identification of Any Warning that can Occur :** Back of the seat could start to move

**Supplier Identification :****Component Manufacturer**

Name : Sparco S.p.A.  
Address : Via Leini 524  
Volpiano (TO) FOREIGN STATES 10088  
Country : Italy

**Chronology :**

NR

**Description of Remedy :**

Description of Remedy Program : "Vehicles will be recalled and customers will receive a letter. Our Flying Doctors will also inform customers individually by phone/then e-mail to arrange an appointment to have the vehicles fixed.  
Both seats will be checked for proper welding of the recliner.  
If any seat is found to be welded incorrectly, the complete seat assembly will be replaced.  
Official Bugatti partners are able to do the check and the work.  
Bugatti will cover the costs involved for the repair (no time or KM/MI limit)."

How Remedy Component Differs from Recalled Component : "The new seat recliner has 3 dot points on welding assuring the new process by the supplier has been done (also the visual check).  
Partners will be asked to make a mark (paint) on the welding during the check."

Identify How/When Recall Condition was Corrected in Production : "After the first seat was found, all other production car in our hand have been completely checked.  
The seat production process has been optimized to avoid any further issues. The new produced seats have a mark on the welding (implemented by supplier the 10.27.2017)"

**Recall Schedule :**

Description of Recall Schedule : Vehicles will be recalled and customers will receive a letter. Our Flying Doctors will also inform customers individually by phone/then e-mail to arrange an appointment to have the vehicles fixed.

Planned Dealer Notification Date : DEC 08, 2017 - DEC 29, 2017

Planned Owner Notification Date : DEC 11, 2017 - DEC 29, 2017

\* NR - Not Reported