#### uanii io 49 urk 8073

NR

# Part 573 Safety Recall Report

Manufacturer Name :	Ford Motor Company
Submission Date :	FEB 08, 2018
<b>NHTSA Recall No. :</b>	17V-787
Manufacturer Recall No. :	17S42

### **Manufacturer Information :**

Manufacturer Name: Ford Motor Company Address: 330 Town Center Drive Suite 500 Dearborn MI 48126-2738 Company phone : 1-866-436-7332

## **Vehicle Information :**

Vehicle 1:	2004-2006 Ford Ranger	
Vehicle Type :	LIGHT VEHICLES	
Body Style :	ALL	
Power Train :	NR	
Descriptive Information :	: The recall population is all vehicles produced with a Takata single stage, non- desiccated, PSAN based driver frontal airbag inflator.	
	Products not included in the recall do not contain the same gas generate.	
Production Dates :	MAR 24, 2003 - MAY 04, 2006	
VIN Range 1:	Begin :NREnd :NRNot sequential	

**Population :** 

## **Description of Defect :**

Description of the Defect :	The driver frontal airbag inflator could rupture if the vehicle is involved in a crash where the supplemental frontal airbags are designed to deploy. Ford is issuing this recall to administratively transition from 16V036, which provided new replacement parts of the same design as an interim remedy, to this program which will service vehicles with final, non-PSAN based replacement driver airbag inflators.		
FMVSS 1 :	NR		
FMVSS 2 :	NR		
Description of the Safety Risk :	: The driver frontal airbag inflators could rupture if the vehicle is involved in a crash where the supplemental frontal airbags are designed to deploy. If an inflator ruptures, metal fragments could enter the passenger compartment increasing the risk of injury or death to occupants.		
Description of the Cause :	NR		
Identification of Any Warning that can Occur :			
The information contained in this report was submitted pursuant to 49 CFR §573			



Number of potentially involved : 328,213

Estimated percentage with defect :

#### **Supplier Identification :**

#### **Component Manufacturer**

Name :T K HoldingsAddress :888 16th Street NW<br/>Washington DISTRICT OF COLUMBIA 20006Country :United States

#### **Chronology** :

This is an administrative action only and does not add any new or additional vehicles to the population of vehicles included in previous recalls.

Ford previously issued safety recall 16S03/16V036 for these same vehicles and inflators. The recall remedy parts for that recall were new non-desiccated PSAN based inflators as an interim repair.

Ford has final remedy repair parts available that do not contain PSAN as a gas generate and is closing the interim repair safety recall and issuing a new recall to complete the final repairs.

All vehicles included in 16S03/16V036 will be included in this recall and require a final remedy repair.

February 8, 2018 Adjusted vehicle population to reflect vehicles moved to 18V023.

#### **Description of Remedy :**

Description of Remedy Program :	Owners will be notified by mail and instructed to take their vehicle to a Ford or Lincoln dealer to have their driver frontal airbag inflator replaced. There will be no charge for this service.
	Ford is excluding reimbursement for costs because the original warranty program would provide for a free repair for this concern.
	Ford will forward a copy of the notification letters to dealers to the agency when available.
5 I	The part number for the driver inflator kit is 4L5Z-10043B13-D. The inflator in this remedy kit does not contain ammonium nitrate as a gas generate.
Identify How/When Recall Condition was Corrected in Production :	Not applicable.

The information contained in this report was submitted pursuant to 49 CFR §573

## Part 573 Safety Recall Report

#### **Recall Schedule :**

Description of Recall Schedule :	Notification to dealers is expected to occur on December 12, 2017. Mailing of owner notification letters for vehicles identified in Zone A is expected to begin December 26, 2017, and is expected to be completed by December 31, 2017. Mailing of owner notification letters for vehicles identified as non-Zone A will be completed in phases as additional service parts become available and are expected to be complete by March 31, 2108.
Planned Dealer Notification Date :	
Planned Owner Notification Date :	NR - NR

\* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573