

Part 573 Safety Recall Report

17V-805

Manufacturer Name : Honda (American Honda Motor Co.)**Submission Date :** JAN 10, 2018**NHTSA Recall No. :** 17V-805**Manufacturer Recall No. :** KJ0**Manufacturer Information :**

Manufacturer Name : Honda (American Honda Motor Co.)

Address : 1919 Torrance Blvd.

Torrance CA 90501

Company phone : 1-888-234-2138

Population :

Number of potentially involved : 20

Estimated percentage with defect : 15 %

Vehicle Information :

Vehicle 1 : 2010-2010 Honda Fury (VT1300CX)

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined based on service part sales records (replacement part for 2010 and 2016 model years). The VIN range reflects all possible motorcycles that could potentially experience the problem.

Only motorcycles potentially equipped with suspect fuel tanks (either as original equipment or replacement service part) are affected.

Production Dates : APR 28, 2009 - JUN 09, 2009

VIN Range 1 : Begin : JH2SC6157AK000345 End : JH2SC615XAK000517 Not sequential

Vehicle 2 : 2016-2016 Honda Fury (VT1300CX)

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined based on service part sales records (replacement part for 2010 and 2016 model years). The VIN range reflects all possible motorcycles that could potentially experience the problem.

Only motorcycles potentially equipped with suspect fuel tanks (either as original equipment or replacement service part) are affected.

Production Dates : SEP 23, 2015 - MAR 09, 2016

VIN Range 1 : Begin : JH2SC6140GK100013 End : JH2SC6124GK101969 Not sequential

Vehicle 3 : 2017-2017 Honda Fury (VT1300CX)

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined based on manufacturing records (original equipment for 2017 model year). The VIN range reflects all possible motorcycles that could potentially experience the problem.

Only motorcycles potentially equipped with suspect fuel tanks (either as original equipment or replacement service part) are affected.

Production Dates : JAN 24, 2017 - JAN 24, 2017

VIN Range 1 : Begin : JH2SC6122HK200002 **End :** JH2SC6122HK200002 Not sequential

Description of Defect :

Description of the Defect : Due to an improper manufacturing process, certain fuel tanks may not have received the necessary welds around the stay bracket. Without these welds, road and engine vibrations may cause the tack weld on the stay bracket to separate, allowing for fuel leakage.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Fuel leakage in the presence of an ignition source may increase the risk of a fire.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

September 22, 2017

First market occurrence of a fuel leak.

October 24, 2017

Second market occurrence of a fuel leak.

November - December 2017

Honda launched a root cause investigation of the fuel leaks. Production records showed that during a single

day of fuel tank production, a disruption in the manufacturing process allowed some fuel tanks to bypass the final welding stage for the stay bracket. Without final welding, the tack welds used in setting the stay bracket can separate when subjected to road and engine vibrations.

December 12, 2017

Honda made the determination that a defect related to motor vehicle safety exists and decided to conduct a safety recall.

As of December 12, 2017, Honda has received two warranty claims, and no field reports or reports of injuries or fires related to this issue.

Description of Remedy :

Description of Remedy Program : Registered owners of all affected motorcycles will be contacted by phone and mail and asked to take their motorcycle to an authorized Honda motorcycle dealer. The dealer will inspect the fuel tank welds, and if not properly welded, replace the fuel tank for free.

How Remedy Component Differs from Recalled Component : Name: Fuel tank
Description: Fuel tank
Part number: 17520-MFR-740ZD; 17520-MFR-740ZA

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Registered owners of all affected motorcycles will be contacted by phone or mail on or about December 14, 2017.

Planned Dealer Notification Date : DEC 14, 2017 - NR

Planned Owner Notification Date : DEC 14, 2017 - NR

* NR - Not Reported