

TECHNICAL
SERVICE
BULLETIN:

TS A18-1

May 23, 2017

**Model Year
Affected:**
2018

Models Affected:
Ascape

Subject:
LP Gas Tray
Reinforcement

It has come to our attention that Aliner delivered product to your dealership that is currently on a recall list. This recall will require an inspection of the LP gas bottle tray. The possibility exists on certain units that there were incorrect rivets used to fasten the LP tray to the frame. All units that are listed as an addendum to this bulletin will require inspection. If the units are found to have the incorrect fasteners, they must be removed and replaced with new fasteners.

The kit will be sent to your dealership at no charge and CNW will pay warranty labor of one half of an hour for all units requiring the fix. Below is a list of the items included in the kit with instructions for installation.

Urgent! If there are units on the attached list that have been retailed, please contact the retail customers immediately and have them return their unit for inspection. New fasteners must be installed if required. Inspect all stock units and repair if necessary before delivery to end users.

Included in the LP gas pan kit:

1. Tek Screws (4 pc.)




2. Steel Rivets (4 pcs.)



Instructions:

1. If smaller rivets with 3/8" head are found (as seen in picture), they must be removed by using a 3/16" drill bit.

Repeat procedure on the other side of the tray

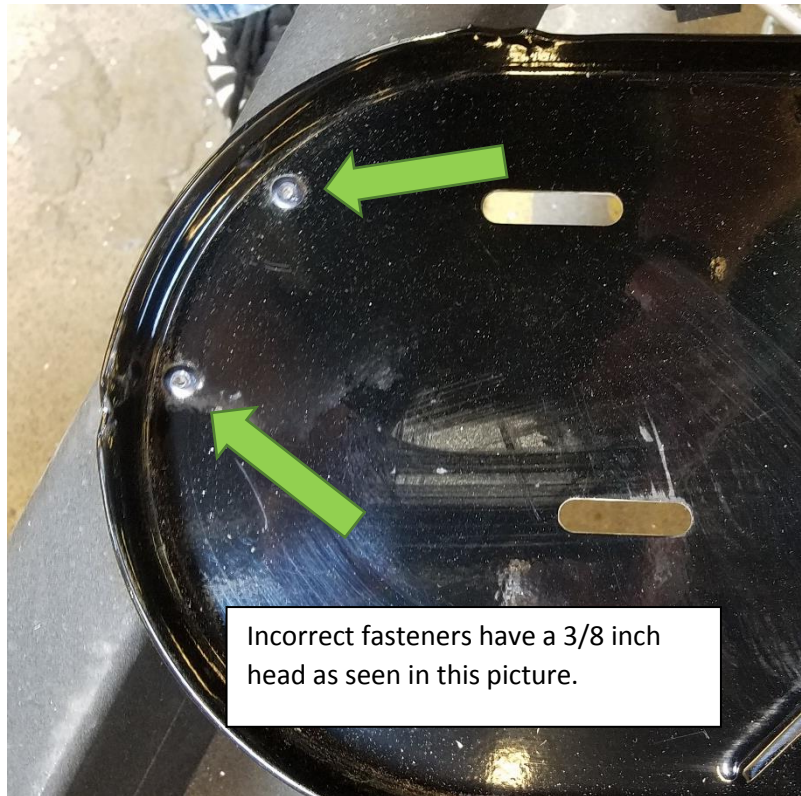

2. Replace two smaller rivets with new 5/8" headed rivets and add two tek screws as seen in picture.

Repeat procedure on the other side of the tray.

