



RECALL CAMPAIGN BULLETIN

Classification:	Reference:	Date:
RS17-045b	NTB17-054b	January 15, 2020

VOLUNTARY SAFETY RECALL CAMPAIGN 2001-2003 MAXIMA; FRONT PASSENGER AIR BAG INFLATOR

This bulletin has been amended. See AMENDMENT HISTORY on page 26. Please discard previous versions of this bulletin.

CAMPAIGN ID #: R1711 and R1712

NHTSA #: 15V-287

APPLIED VEHICLES: 2001-2003 Maxima (A33)

**Check Service COMM or Dealer Business Systems (DBS) National
Service History to confirm campaign eligibility.**

INTRODUCTION

Nissan is conducting this Voluntary Safety Recall Campaign on certain specific 2001-2003 Maxima vehicles to replace the front passenger air bag module and inflator. This service will be performed at no charge to customer for parts or labor.

Takata has issued return packaging, shipping labels, documents, and directions that must be used and followed in order to properly carry out this campaign. Takata's documentation is attached and is part of this bulletin.

IDENTIFICATION NUMBER

Nissan has assigned identification numbers R1711 and R1712 to this campaign. This number must appear on all communications and documentation of any nature dealing with this campaign.


DEALER RESPONSIBILITY

It is the dealer's responsibility to check Service COMM or Dealer Business Systems (DBS) National Service History for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

1/27

REPAIR OVERVIEW

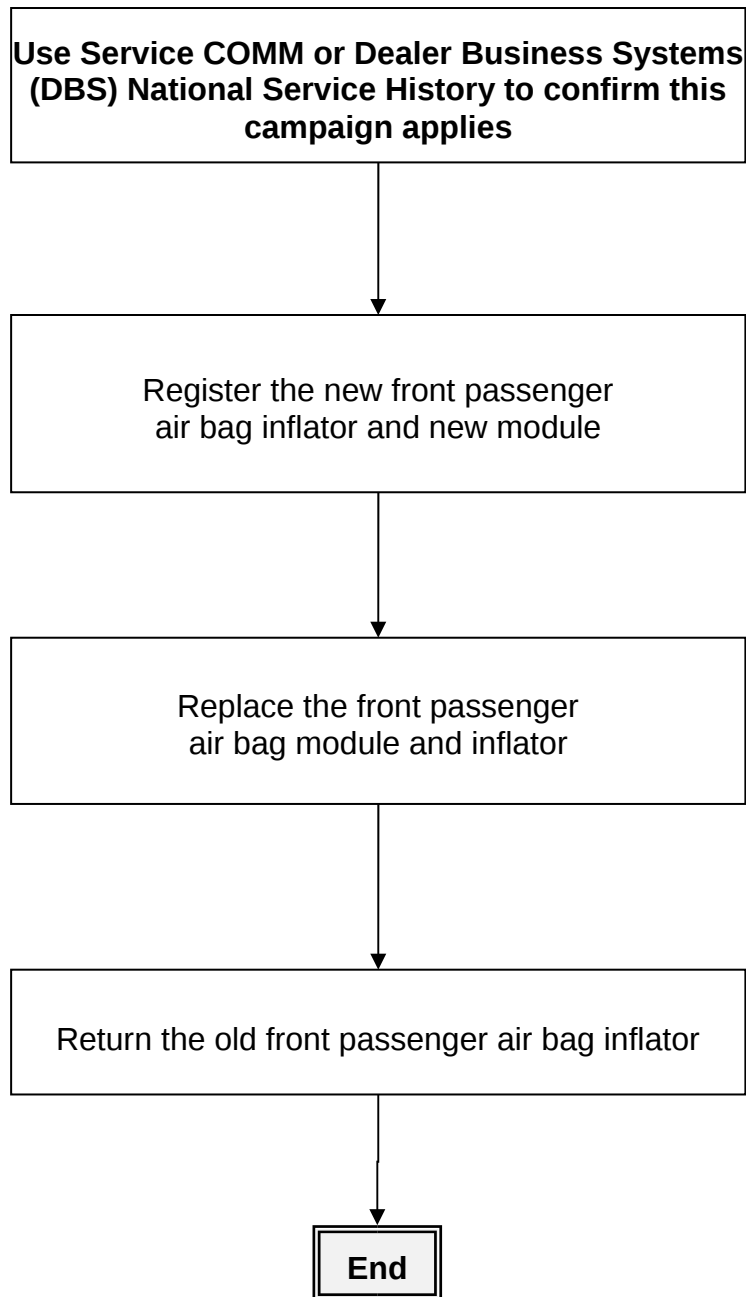

REQUIRED SPECIAL TOOL (J-51315)

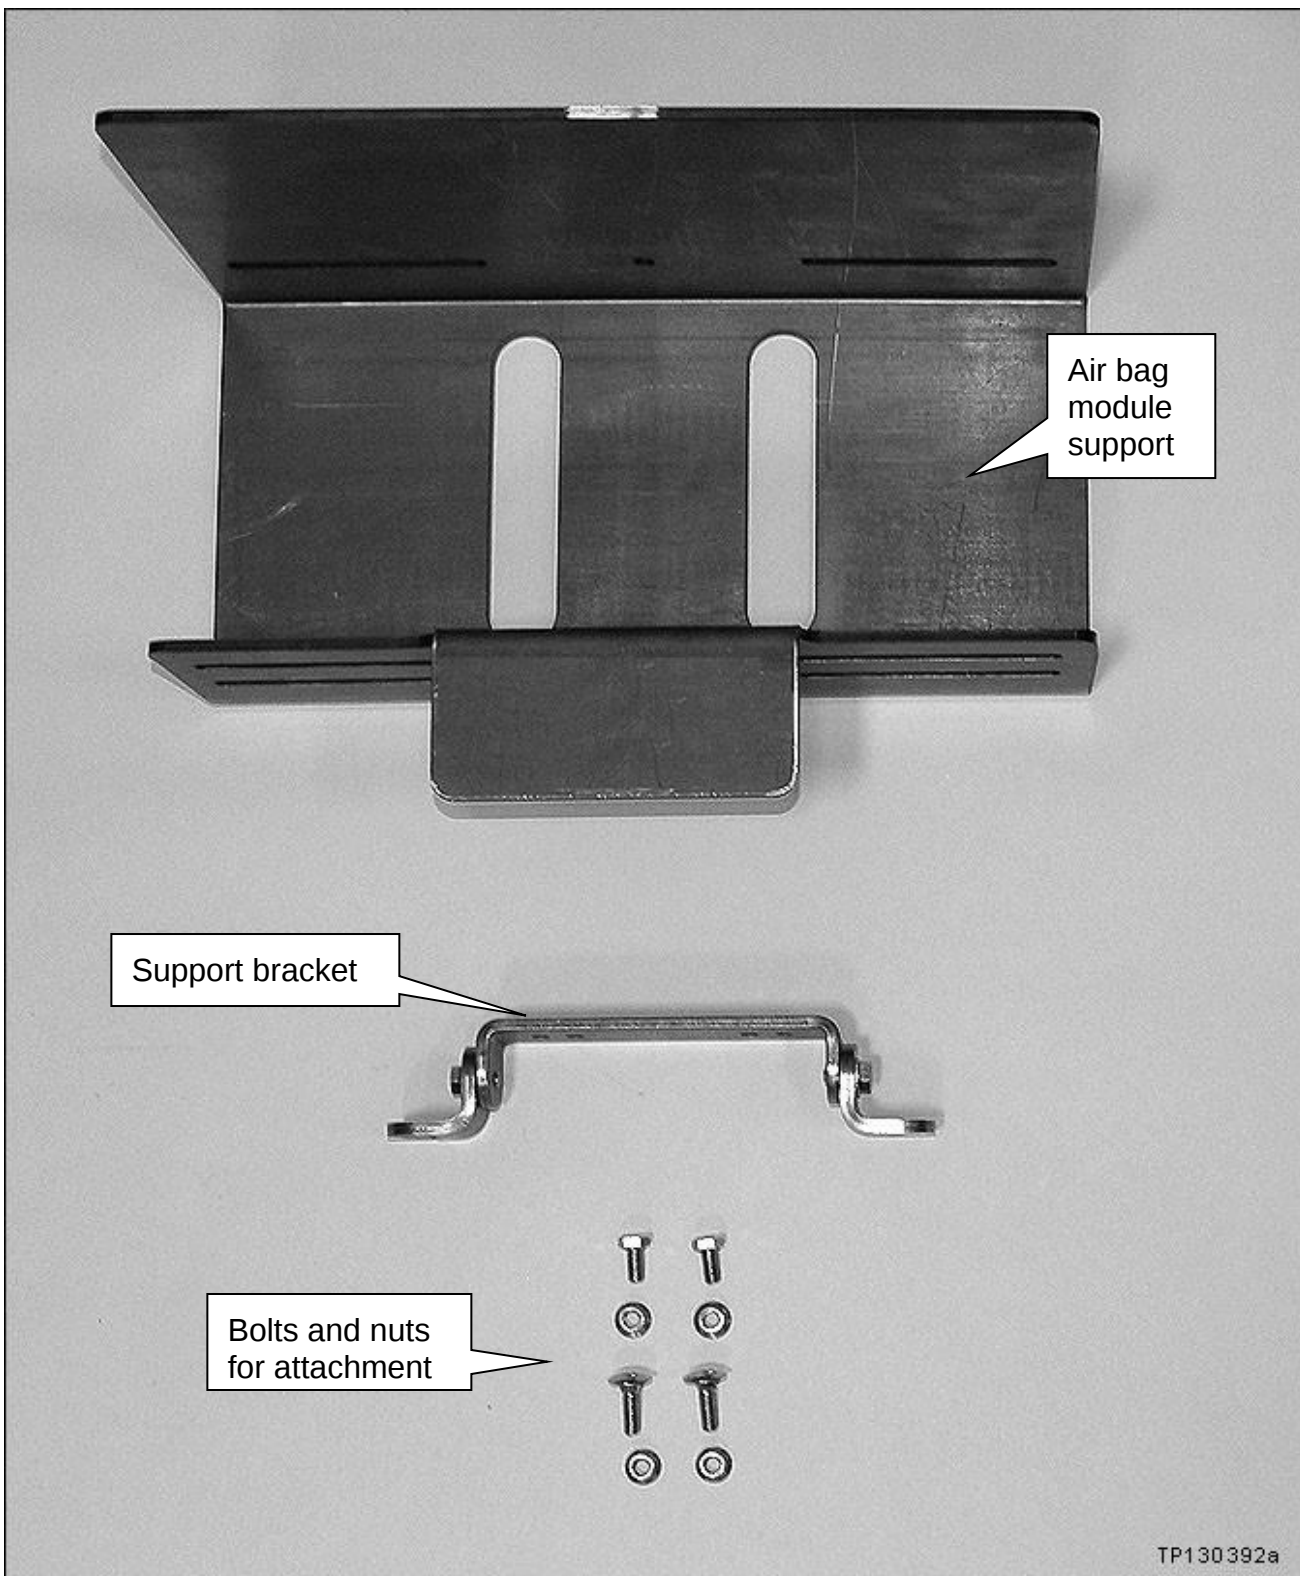


Figure A

REQUIRED SPECIAL TOOL (J-52352)

Quick Scan Tool (J-52352)

□ Each retailer has been shipped one Quick Scan Tool (J-52352).

□ Additional tools can be obtained from Tech•Mate: nissantechmate.com or 1-800-662-2001.



Figure B


SERVICE PROCEDURE

New Inflator and New Module Registration

1. Obtain a new inflator and a new module from your parts department.

□ New inflator and new module are listed in the Parts Information.

2. Attach the quick scan tool (J-52352) to your CONSULT PC USB port.

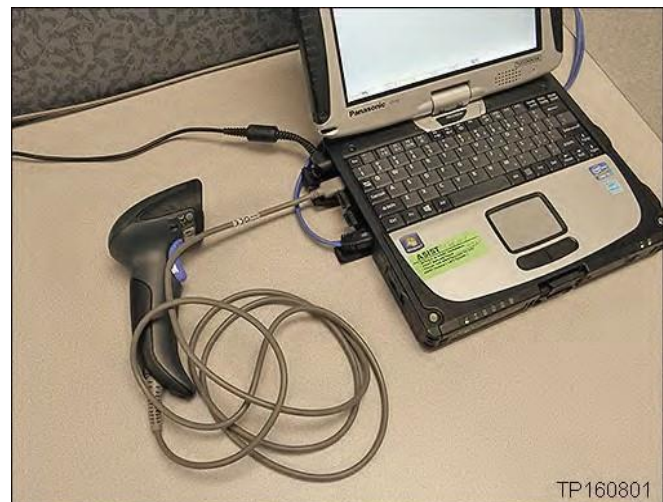

to

Figure 1

3. On the left side of the ASIST main menu, select Tech Support Info, then Inventory Vehicle Actions.

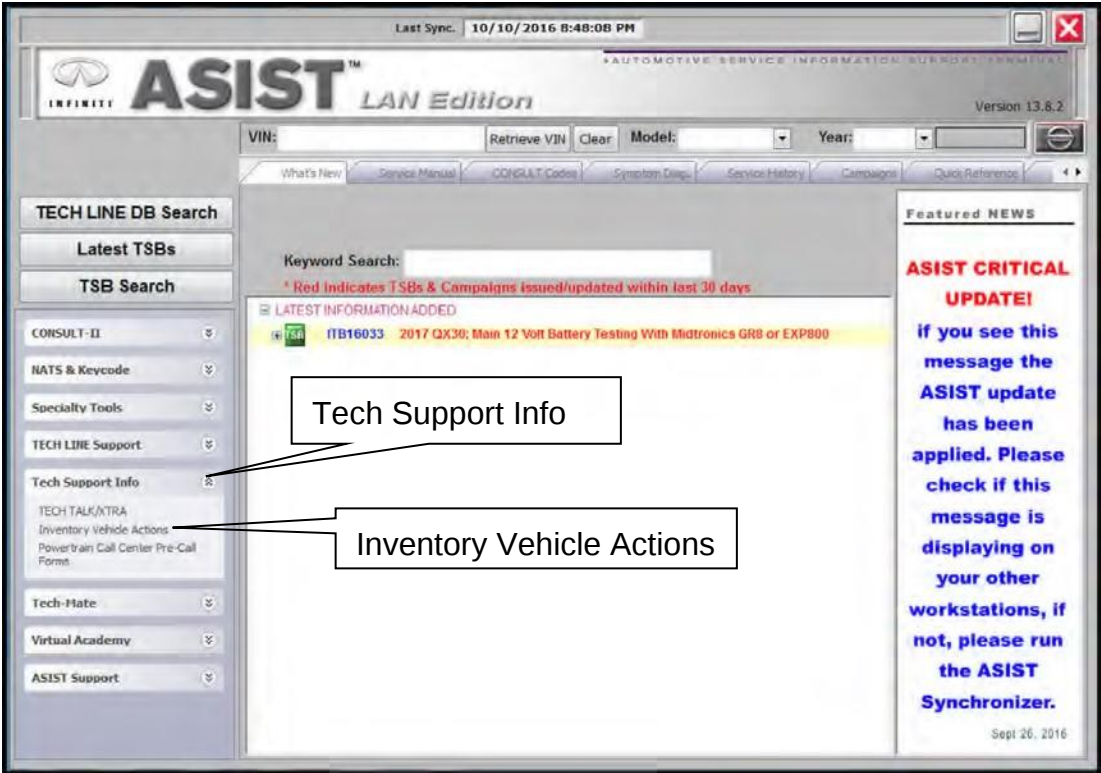


Figure 2

4. Select **CLICK HERE** (Air Bag to VIN Registration).

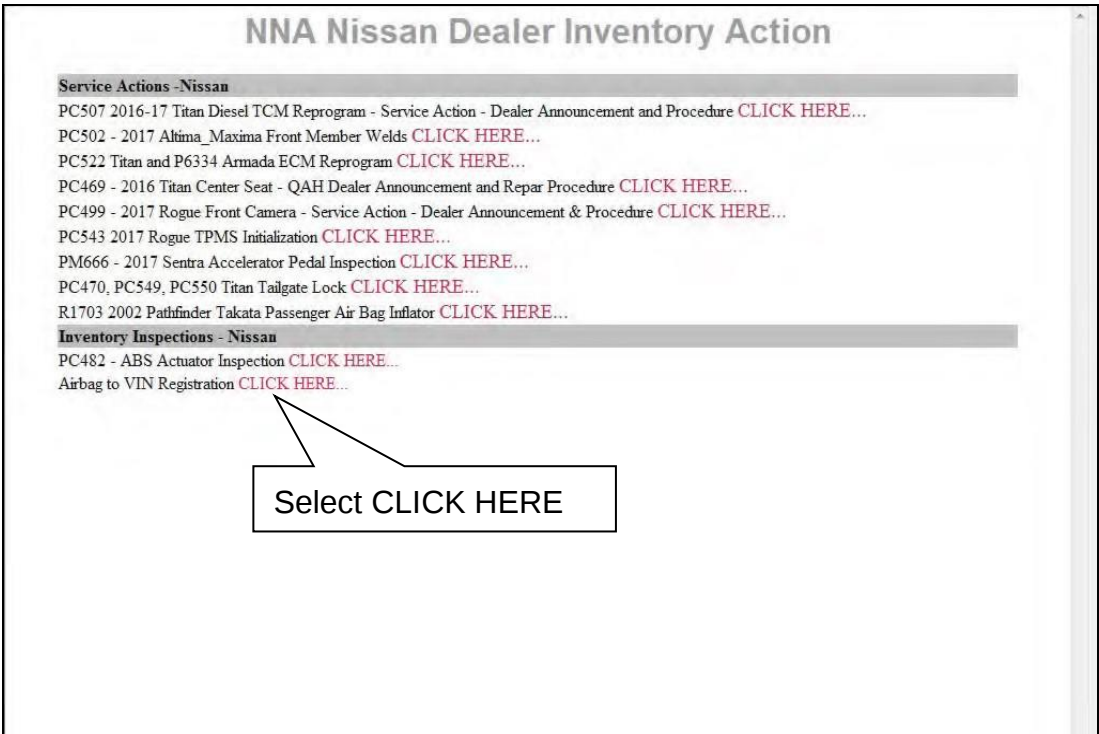


Figure 3

5. Use the quick scan tool to scan the code (VIN) on the B-pillar label.

- NOTE:**

- Hold the scan tool approximately 6 inches away from the label.

- Figure 4

- VIN will

-

bar

code

Airbag to VIN Registration

11/28/2016 1:36:32 PM

Please enter/scan the VIN and Airbag Inflator Serial Number

Dealer Code

Key Number

VIN

Airbag Serial Number

Step 7; see next page.

(Select submit after both fields are populated).

Figure 5

6. Use the quick scan tool to scan the code (serial number) on the new inflator shipping box.

- The serial number will automatically populate (see Figure 5 on previous page).

NOTE: If needed, the serial number can be entered manually.



Figure 6

7. Select **Submit** on the ASIST screen (see Figure 5 on the previous page).

Register the New Module

8. Use the quick scan tool and scan bar code (VIN) on the vehicle B-label a second time.

NOTE:

- Some labels may not scan quickly.
- Hold the scan tool approximately 6 inches away from the label.
- Hold the trigger down until the label is read (this may take several seconds).
- If needed, VIN can be entered manually (Figure 8).



the
pillar

from

Figure 7 several

Airbag to VIN Registration

11/28/2016 1:36:32 PM

Please enter/scan the VIN and Airbag Inflator Serial Number

Dealer Code

Key Number

VIN

Airbag Serial Number

Submit

Step 12; see next page.

(Select submit after both fields are populated).

Figure 8

9. Open the Module shipping container.


- New module is listed in the Parts Information.

10. Locate the bar code sticker on the module.


NOTE: The new module will be left the shipping container until later in procedure.

11. Use the quick scan tool to scan the code (serial number) on the new module (see Figures 9 and 10).

- The serial number will automatically

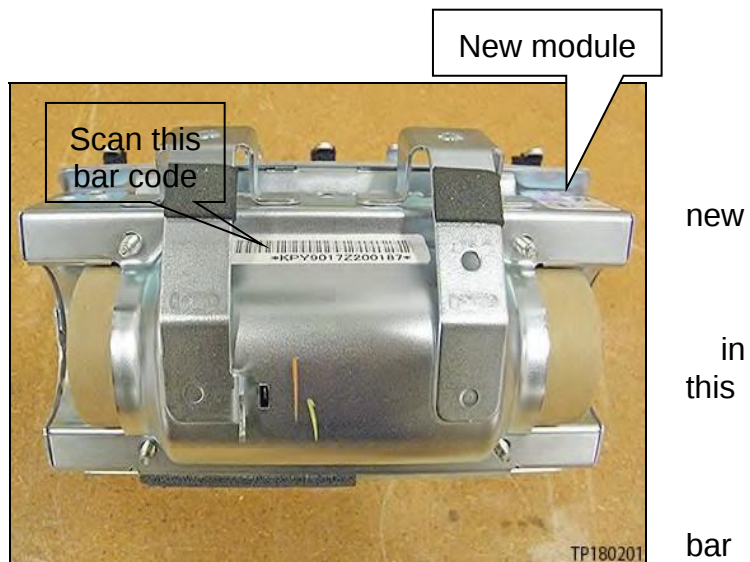

populate (see Figure 8). Figure
NOTE: If needed, the serial
 can be entered manually.

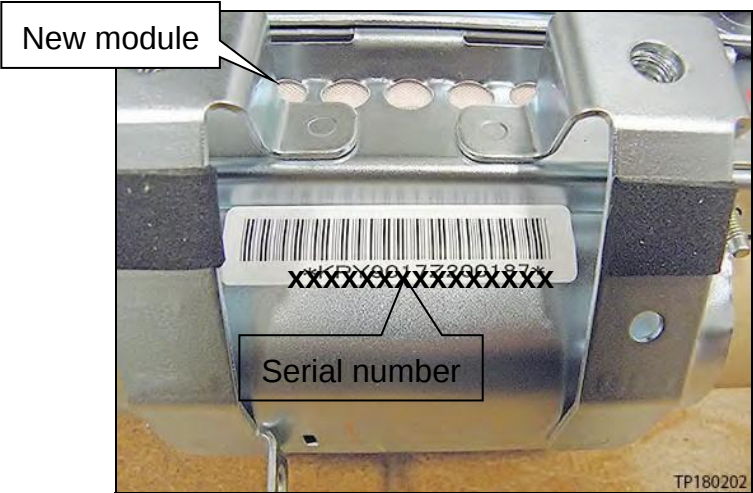

9
 number

 Figure
 10
 ASIST

12. Select **Submit** on the screen (see Figure 8 on the previous page).

Inflator and Module Replacement

IMPORTANT:

- Follow all cautions, warnings, and notes in the Electronic Service Manual (ESM) when working on or near a Supplemental Restraint System (SRS), such as an air bag.
- To help avoid damage, refer to Instrument Panel Removal Tips starting on the next page.

CAUTION: Handle interior trim carefully to avoid damage. Work with clean hands and clean tools to avoid dirt and stains. Use protective covers as needed.

13. Turn the ignition ON.
14. Write down the radio settings.

Presets	1	2	3	4	5	6
AM						
FM 1						
FM 2						
SAT 1						
SAT 2						

Bass	Treble	Balance	Fade	Speed Sen. Vol.
-------------	---------------	----------------	-------------	----------------------------

15. Turn the ignition OFF.
16. Disconnect both battery cables, negative cable first.
17. Wait at least 3 minutes.
18. Remove the passenger air bag module (module) from the vehicle.
 - Refer to the appropriate Electronic Service Manual (ESM) for module removal information.

IMPORTANT: Follow all cautions, warnings, and notes in the Electronic Service Manual (ESM) when working on or near a Supplemental Restraint System (SRS), such as an air bag.

CAUTION: Handle interior trim carefully to avoid damage. Work with clean hands and clean tools to avoid dirt and stains. Use protective covers as needed.

19. Set the module in a clean working area.

NOTE: Do not set the module with cover facing down.

20. Securely mount the air bag module support (support) in a vice (see Figure 11).

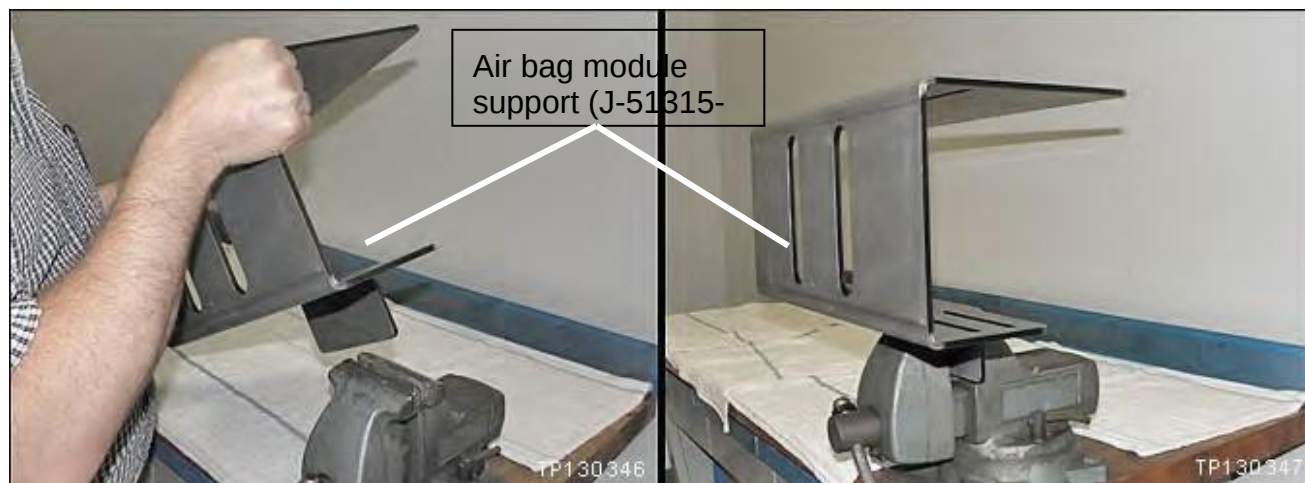


Figure 11

WARNING:

- Work from behind and to the sides of the support.
- Wear safety glasses while performing inflator replacement.

21. Disconnect the harness clip from the module frame.

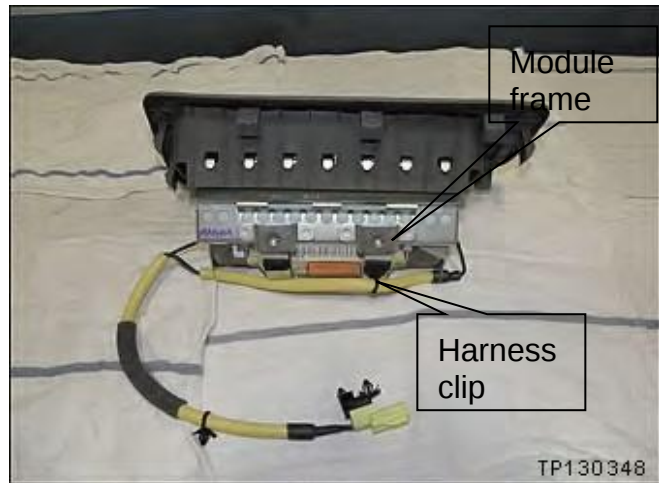


Figure 12



WARNING: Work from behind and to the sides of the support.

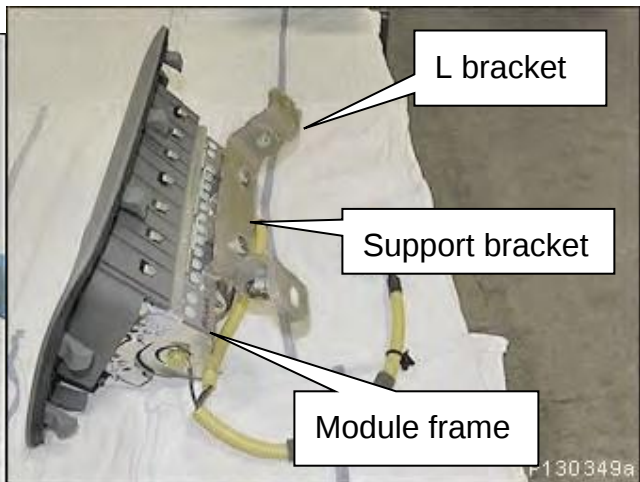


Figure 13 22. Attach the support bracket to the module frame.

- Tighten the bolts holding the bracket to the module frame.
- Use bolts supplied with the support.
- Leave the L brackets on each end slightly loose to allow for positioning of the module in the support.

23. Mount the module in the support.

- Use bolts and nuts supplied with the support.

24. Make sure the module is centered in


the support.

Figure 14

NOTE: Centering the module in the support will allow access to the inflator securing nuts through the slots in the support.

25. Tighten all of the mounting bolts and that hold the module to the support.

Figure 15

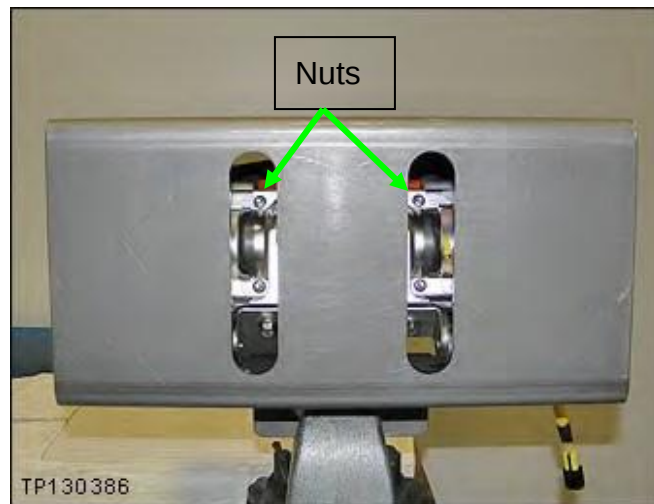

nuts

26. Carefully cut a few inches of the corrugated harness cover in the shown.

- **Do not** cut the wires inside the corrugated cover.



yellow
area

Figure 16 Cut a few inches.

27. Attach 2 shorting pins to the inflator harness as shown.

- Make sure to pair the wires from end of the inflator.

Blue with White Red with

- Use an insulation displacement wire connector as a shorting pin.
- Refer to the Parts Information for additional connector/shorting pin information.

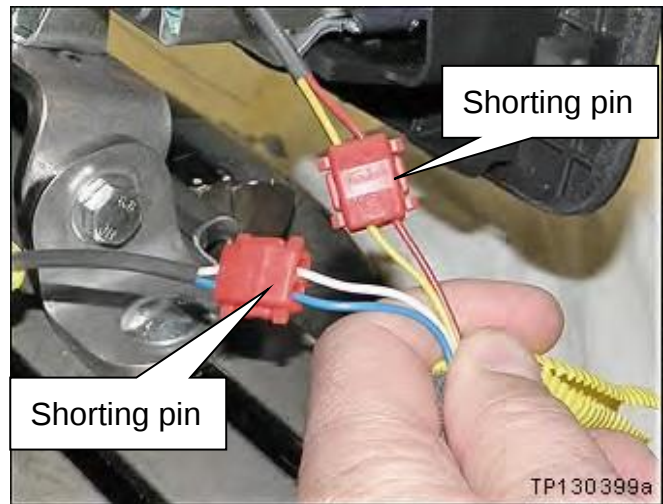


Figure 17

28. Cut off the connector end of the harness.



Figure 18

29. Remove the 4 nuts from the module hold the inflator in place (see Figures and 20).

- Use a ratchet and extension.



Figure 19

each

Yellow

type

that
19

- Remove the 4 nuts.

NOTE: These nuts will not be reused.



Figure 20


30. Remove the inflator stopper.



Figure 21

31. Push the right side of the inflator out module.

- Twist the inflator to a position that allow the connector and harness to through the opening.

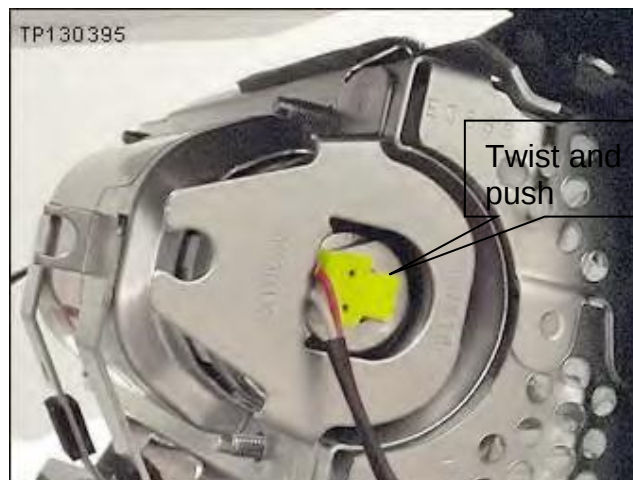

of the
will
fit

Figure 22

32. Pull the old inflator completely out of module from the left side.



the

Figure 23

33. Set the old inflator in the clean working area making sure it does not roll and fall to the floor.

34. Remove the old module from the support and place it on a clean work surface.

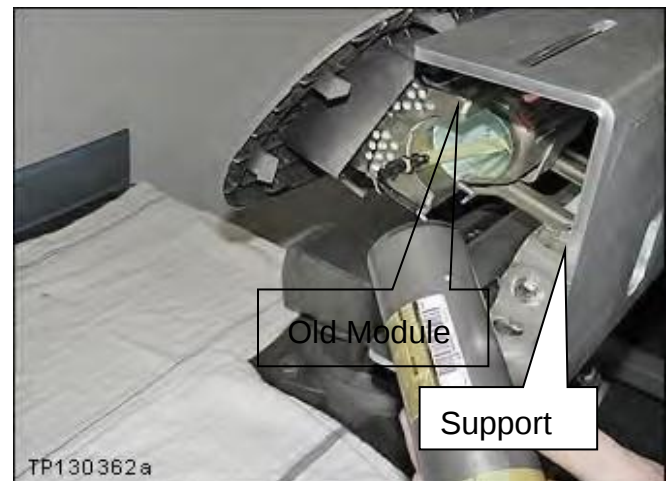


Figure 24

35. Remove the support bracket from the module.

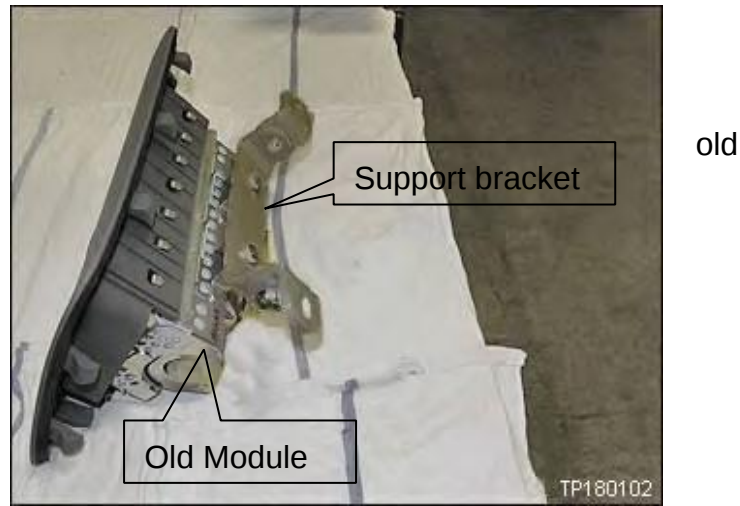


Figure 25

36. Remove the new module from its shipping container.

- New module is listed in the Parts Information.

37. Remove the instrument panel finisher from the old module, and transfer it to the new module as follows.

- a. Set the module on the bench with the mounting holes facing you.

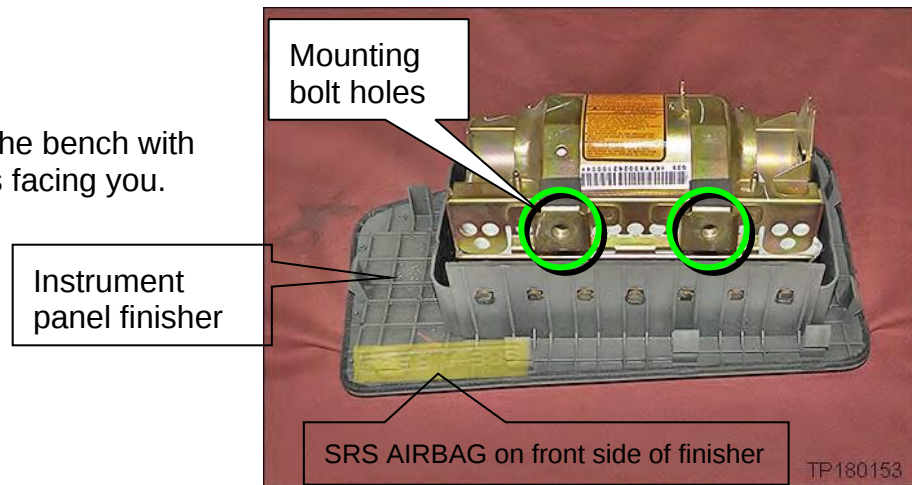


Figure 26

b. Use a plastic trim tool to detach the module hooks on the side facing

- Detach one hook at a time.
- Start at one end and then work towards the opposite end.
- Detach all 7 hooks.

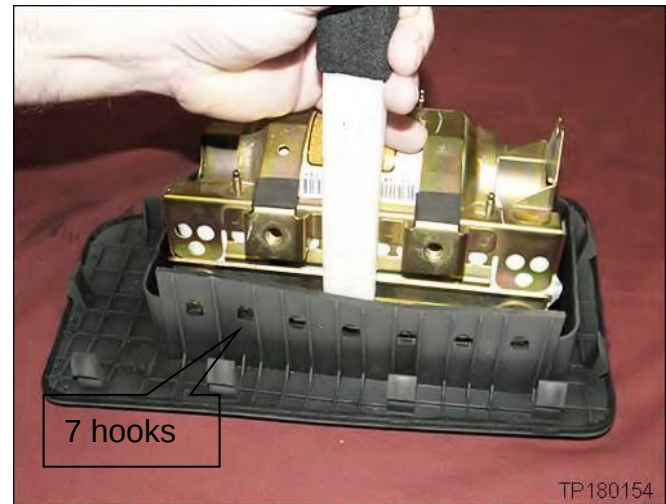


Figure 28
Figure 27

c. Remove the old module from the finisher.

- Lift out the side facing you.
- Use a tilt/twist motion to detach the hooks on the other side.

NOTE: The old module will not be reused.

d. Install the new module to the finisher.

- Make sure the mounting bolt face the side of the finisher with AIRBAG written on it.
- Make sure all of the hooks are attached correctly.

NOTE: SRS AIRBAG is written on front side of the finisher.

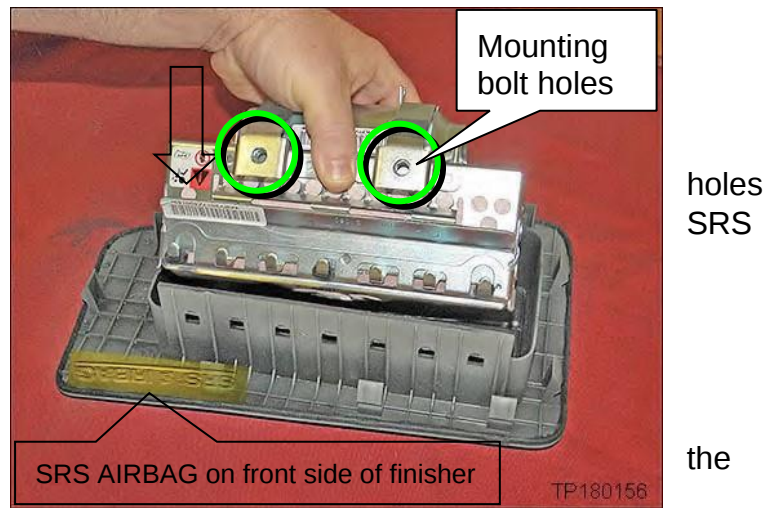


Figure 29

38. Attach the support bracket to the module frame.

- Use bolts supplied with the support.

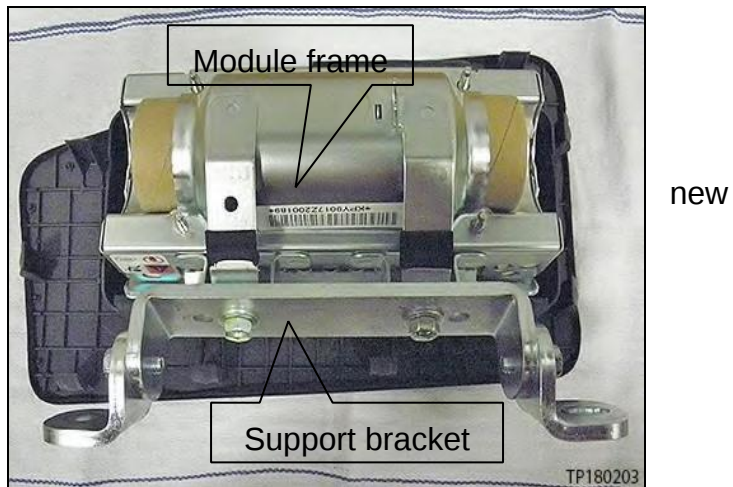


Figure 30

39. Slide the paper tube completely out of the module.

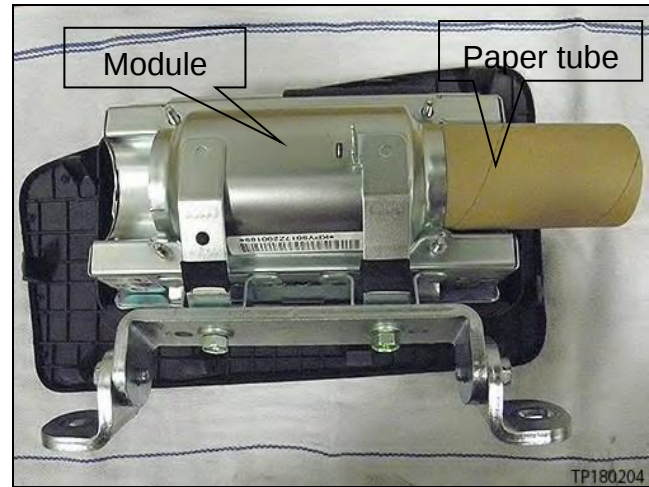


Figure 31

IMPORTANT:

- The new module contains two inflator stopper brackets – one for each side.
- In the following steps, make sure to install the correct stopper bracket on each side of the inflator.

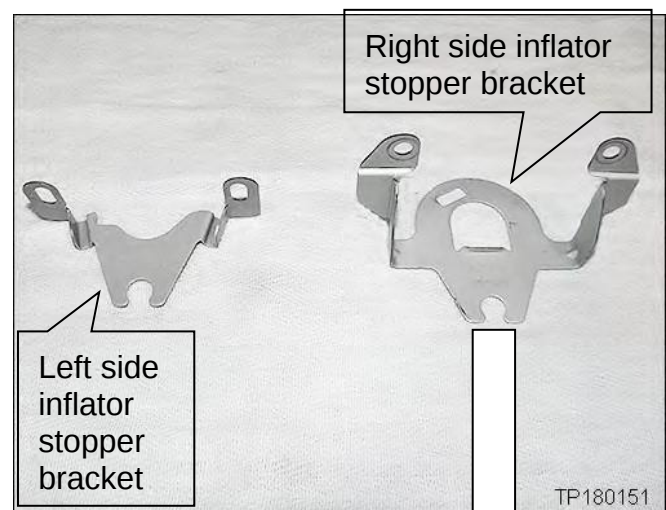


Figure 32

40. Install the **right** side inflator stopper bracket with nuts finger tight (see Figure 33).

- Make sure to **use new nuts**.

NOTE: New nuts and new stopper bracket are included with the new module.

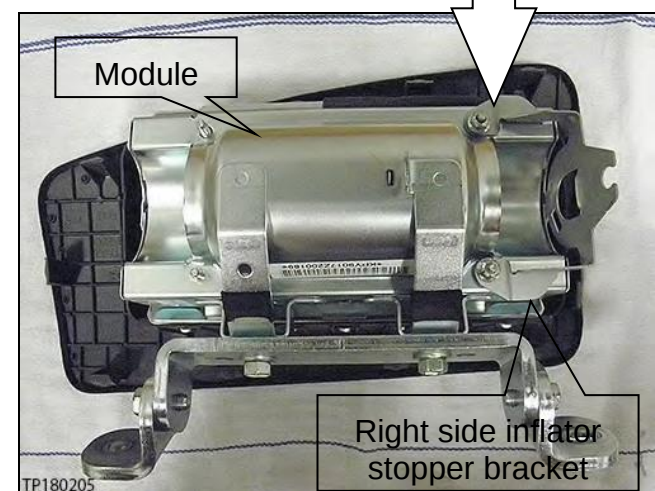


Figure 33

41. Mount the **new** module in the support.
- Use bolts and nuts supplied with the support.

42. Make sure the module is centered in support.

NOTE: Centering the module in the support will allow access to the inflator securing nuts through the slots in the support.

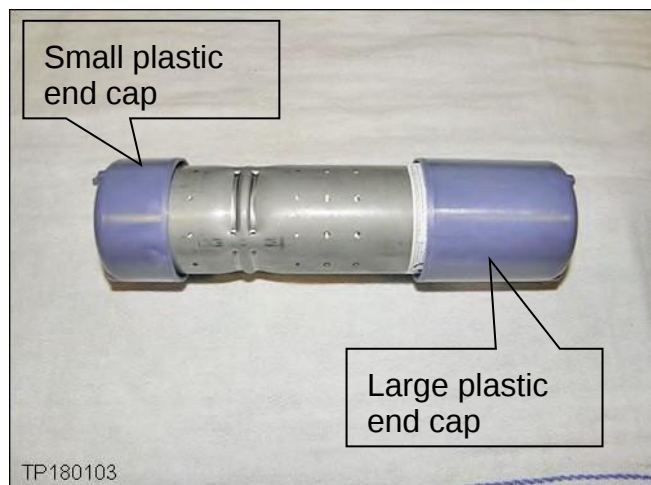


Figure 34

43. Remove the new inflator from the

IMPORTANT:

- The new inflator has a large plastic cap and a small plastic end cap.
- When installing, pay close attention which end is installed first.



box.

end

to

Figure
35

Install the New Inflator into the New Module

44. Slide the new inflator into the module assembly from the left side; large plastic end cap first.


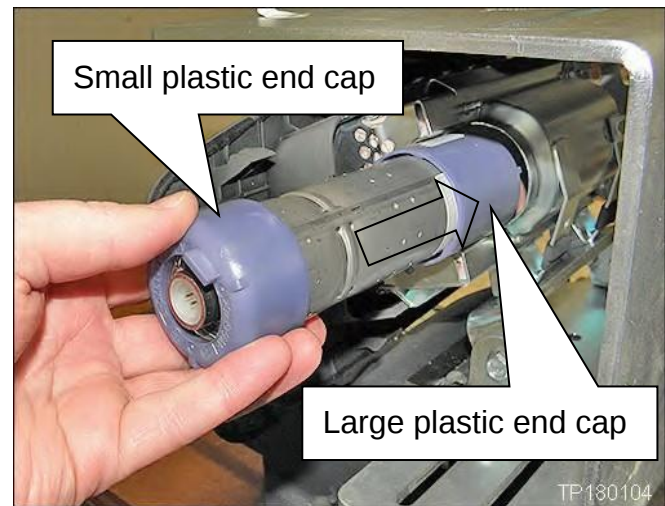


Figure 36

45. On the Right side, make sure the tab end of the inflator fits in the stopper bracket as shown.

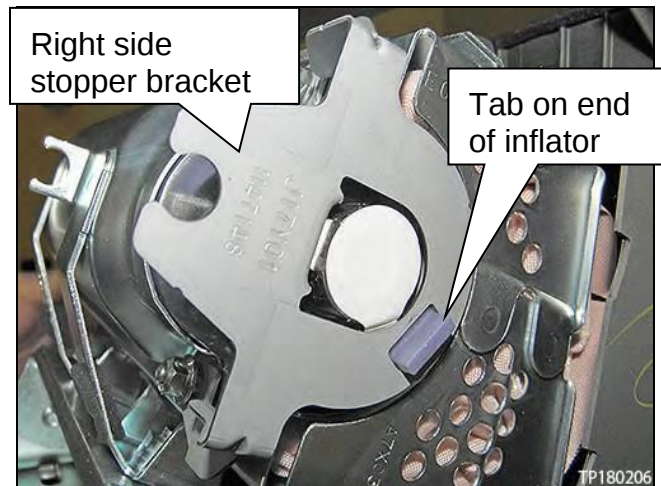


on the

Figure 37

46. Install the **left** side inflator stopper bracket and 2 inflator securing nuts tight (see Figure 38).

□ Make sure to **use new nuts**.

NOTE: Stopper bracket and new are included with the new module.

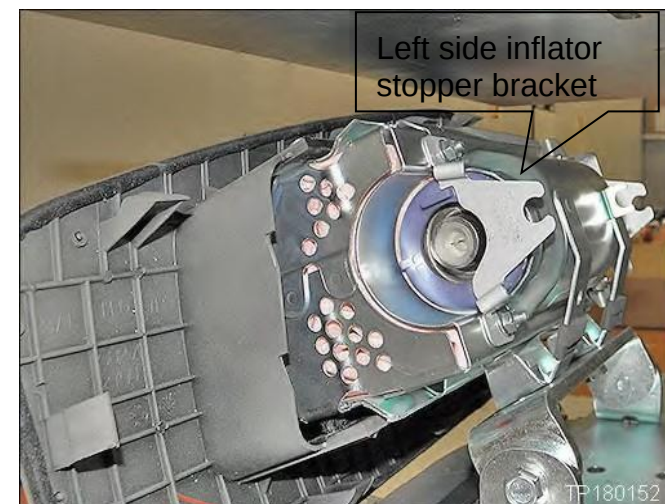

finger

nuts

Figure 38

47. Make sure the inflator is pushed all the way into its housing – no gap on the right side (see Figure 39).
48. Make sure there is no gap between the inflator stopper and the inflator on the left side (see Figure 39).

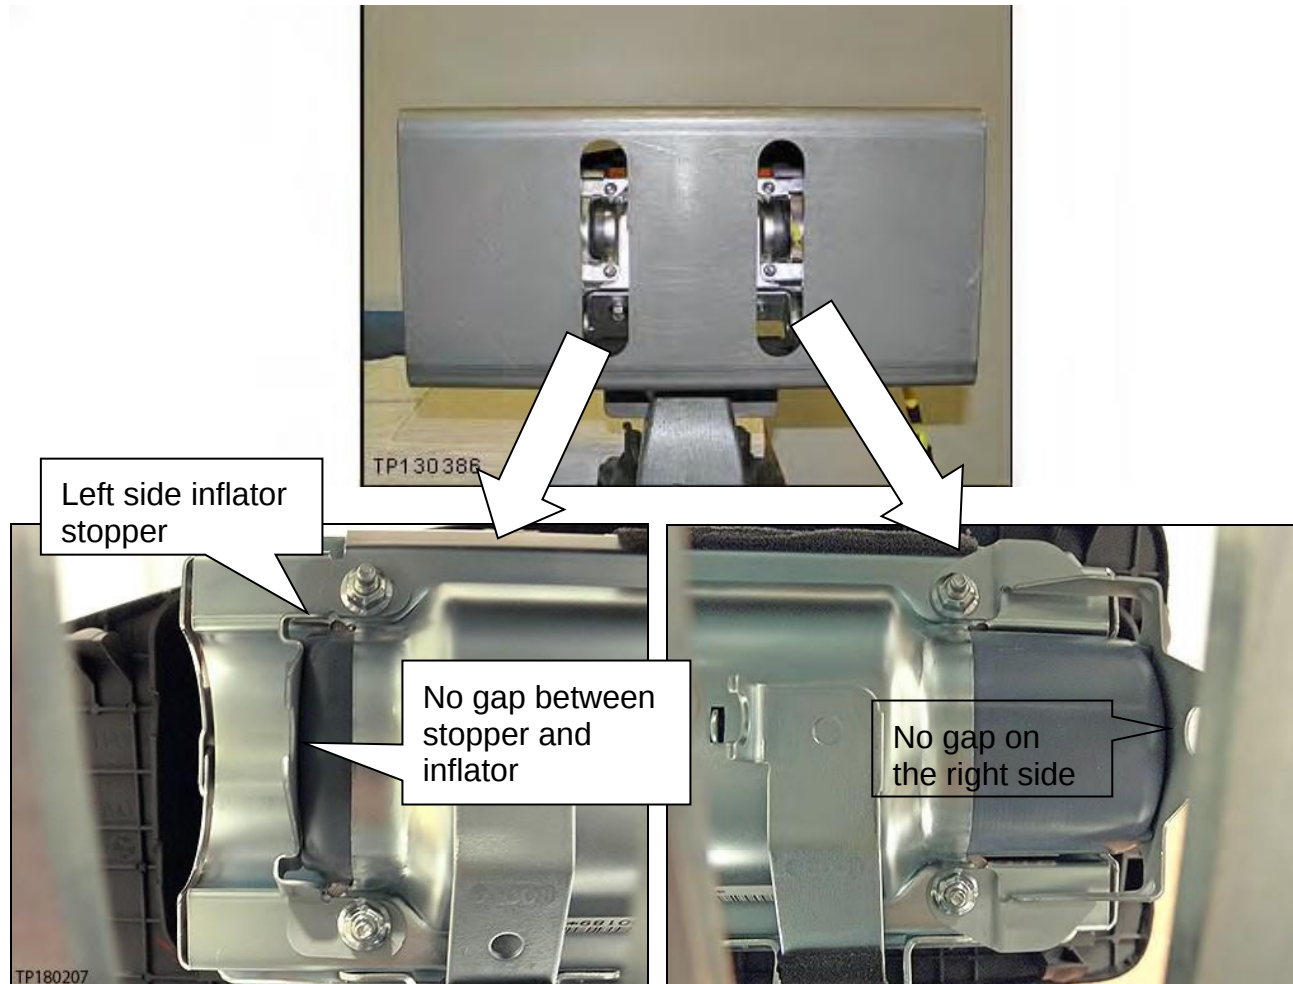


Figure 39

49. Torque the 4 inflator securing nuts.

- Torque nuts to:
3.9 Nm (0.39 kg-m, **34 in-lb**).
- Torque nuts in the order shown.



Figure 40

IMPORTANT:

- In the next step you will be attaching the new harness to the new inflator.
- Once an inflator connector is attached to the inflator, it cannot be disconnected.
- **Make sure to attach the connectors to the correct ends of the inflator (see Figure 41).**
 - Left / Right orientation is as shown in Figure 41.

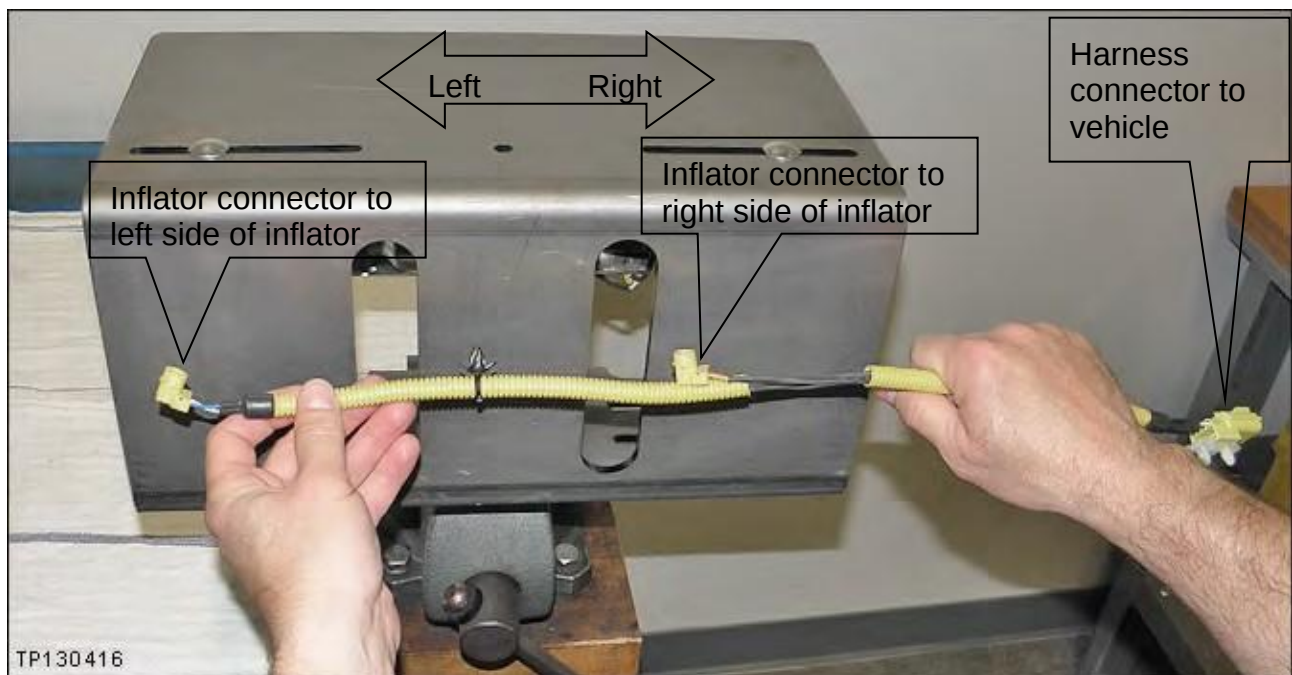


Figure 41

50. Attach the new harness to each end of inflator.


- Remove the dust proof stickers covering the ends of the inflator.
- A new harness is included with the module.
- Make sure to attach the correct ends (see Figure 41 on the previous page).
- Refer to Figures 42, 43, and 44.



Figure 42

the

new

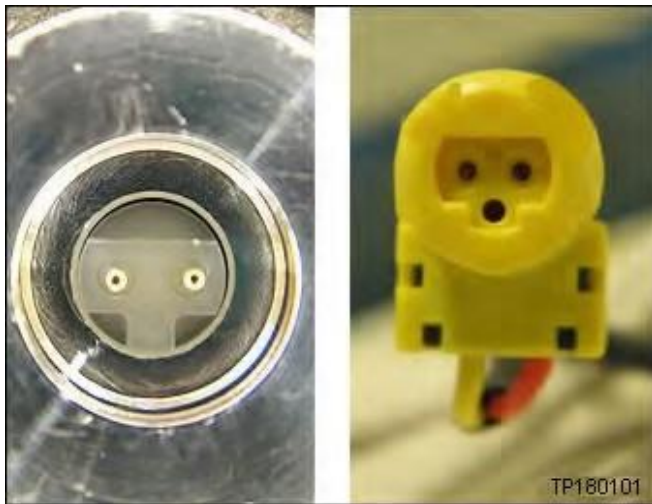

Inflator end

Inflator connector

- Make sure the T shape at the inflator end aligns with the T shape of the connector.

T shape

Figure 43

□ Make sure the inflator connectors are fully engaged / seated (see Figure 44).


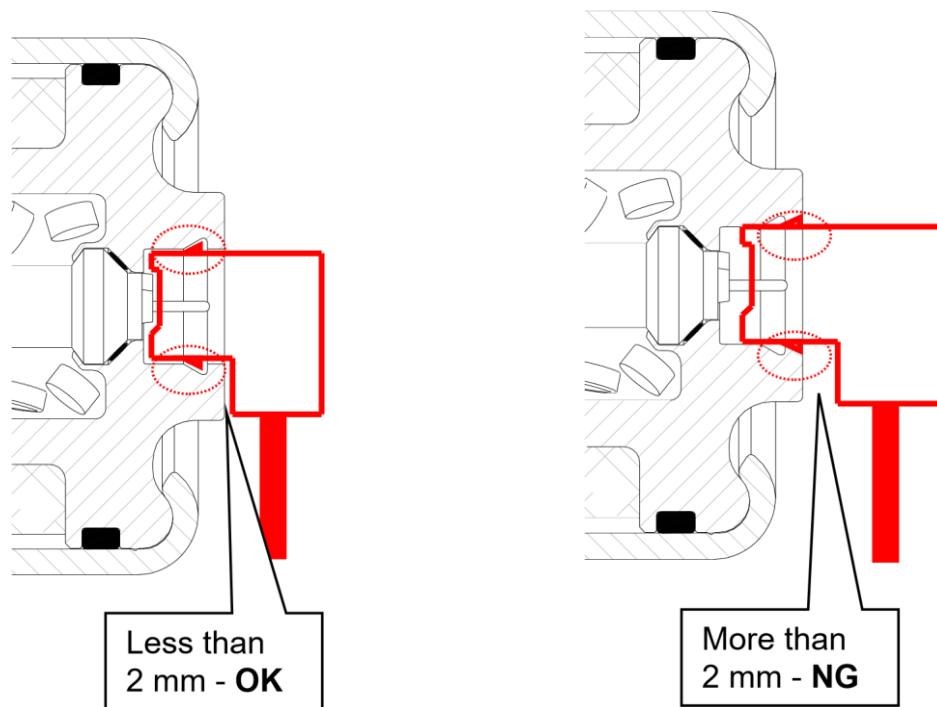


Figure 44

51. Remove the module from the support and set it on the clean working area.

52. Remove the support bracket from module frame.

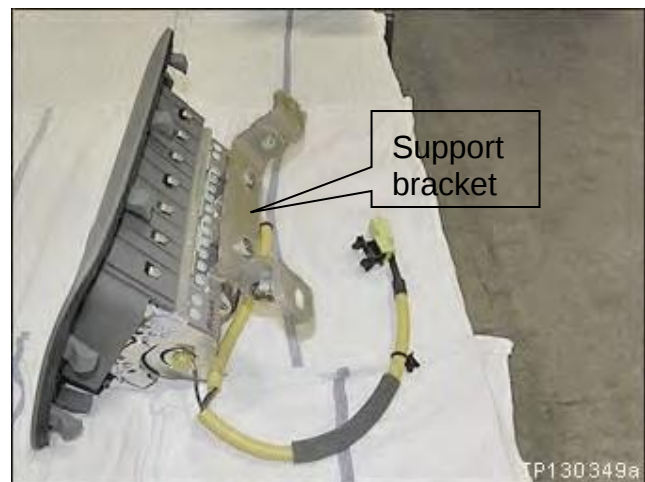

the

Figure 45

53. Attach the harness clip to the module frame.
54. Route/attach the harness to the harness guides.

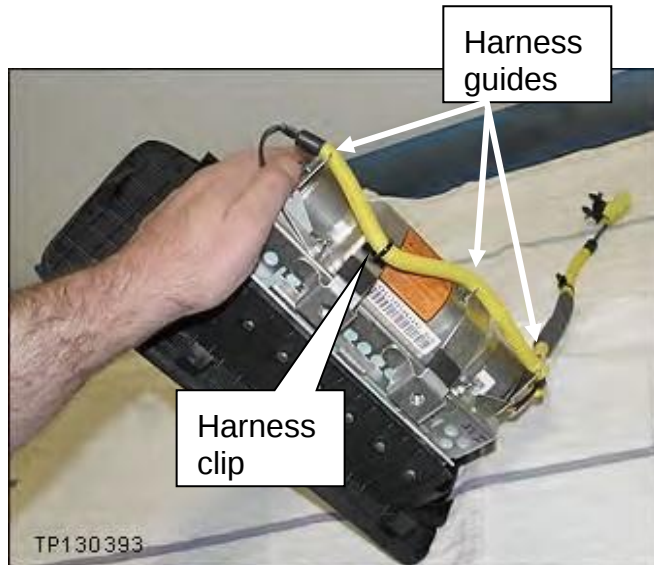


Figure 46

55. Reinstall the module into the vehicle in reverse order of removal.
 - Make sure to use the new “one time use” module mounting bolts included with the new module.
56. Re-connect both battery cables – positive cable first.
57. Reset the clock and the radio settings.
58. Turn the ignition ON and observe the air bag warning light:
 - Light should illuminate for 7 seconds and then go out.

NOTE: If the Air Bag Warning light does not operate as described above there may be an issue not covered by this campaign. Refer to ASIST and the appropriate ESM for additional diagnostic and repair information.

59. Return the removed (old / non-deployed) inflator in the box that the new inflator arrived in.

- Follow the return instructions provided by Takata.
- Return instructions provided by Takata are attached to this bulletin on page 27.

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
INFLATOR-AIR BAG (Inflator)	98561-7999E	1
MODULE KIT-SUB (Includes module mounting bolts, inflator harness, inflator securing nuts, and stopper brackets)	K8525-4Y90C	1
Shorting Pin (Insulation Displacement Connector for 22-18 gauge wire) 	NAPA item # 784566 Grainger Item # 4YT50 or equivalent available from local auto supply	2

NOTE:

- Make sure to return the removed (old / non-deployed) inflator in the box that the new inflator came in.
- ☐ Follow the return instructions provided by Takata.
- Takata supplied return instructions are attached to this bulletin on page 27.

CLAIMS INFORMATION

Submit a “CM” line claim using the following claims coding:

Maxima

CAMPAIGN (“CM”) I.D.	DESCRIPTION	OP CODE	FRT
R1711	Remove and replace front passenger air bag sub-module and inflator	R17112	1.0 hrs.

CAMPAIGN (“CM”) I.D.	DESCRIPTION	OP CODE	FRT
R1712	Remove and replace front passenger air bag sub-module and inflator	R17123	1.0 hrs.

EXPENSE CODE

CODE	DESCRIPTION	MAXIMUM AMOUNT
041	Shorting Pin (Insulation Displacement Connector for 22-18 gauge wire)	\$0.50

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
July 19, 2017	NTB17-054	Original bulletin published
March 27, 2018	NTB17-054a	Changes made throughout

January 15, 2020	NTB17-054b	CLAIMS INFORMATION revised and Campaign ID # added
------------------	------------	--



Takata Document

NOTE

NOTE: International (including Mexico and Canada), Hawaii, Alaska, Puerto Rico, and US Virgin Islands dealers *CANNOT* follow below shipping instructions. Instead, dealerships in these locations *MUST* contact the following Takata/Menlo USA representative directly for shipping instructions: Miguel Prigadaa – Tel #: 210-250-5078 or 210-250-5061 Email: SCTakataRestraints_International@xpo.com

NOTE: For Continental US 48 State dealerships, please follow steps 1-8 below.

- Specific to Step 4 below:
 - Follow step 4a if you receive the updated NON-FedEx label. Proceed to step 5.
 - Follow step 4b if you receive the FedEx label. Proceed to step 5.

1. Shipping Documents

a) Box Label

- Supplied with each Kit
- To be affixed to each box



b) Over-pack Label

- To be supplied by XPO.
- To be affixed to the outside of each pallet



c) Bill of Lading

- To be supplied by XPO.
- Print 2 copies: 1 for Dealer Records, 1 for LTL Driver



d) ERG Document

- To be supplied by XPO.
- To be provided by the Dealer to the LTL Driver for each shipment



2. Packing Instructions

a) Confirm box is in acceptable condition. If a new box is needed, follow the New Box instructions located in Box 8 of this page.

b) Place the un-deployed air bag inflator in the "cradle" of the box insert.



3. Closure Instructions

a) Close the top box flap, per box closure instructions located on front panel of box.



4a. Shipping Instructions - Label each Box

a) New Labels will begin shipping in each kit starting mid June, 2015

1. New Inflator Kit will contain this two-part label:



2. Peel off "Ship To" label.

3. Affix Label to Box. Do not cover up Class 9 Marking.



5. Shipping Instructions – Prepare the Pallet

- a) Accumulate and palletize Kits
- b) Arrange Kits on Pallet as pictured here
 - 20 boxes per row/layer (5x4)
 - 10 rows/layers per pallet (200 boxes)
- c) Shrink-wrap Kits to Pallet
- d) Affix Over-pack Label on (1) side of Pallet (Not on Top)



6. Shipping Instructions – Schedule LTL Pickup

- a) Upon Accumulating 200 kits (1 Over-pack/Pallet) Minimum
 - Call XPO at 1-210-250-5079
 - If 200 Kits have not been accumulated in 30 days, please call XPO for direction
- c) Have the following Information Available
 - Dealer #
 - Quantity of Over-packs/Pallets
 - Quantity of Passenger Inflator Kits on each Pallet
 - Email Address where shipping Documentation can be received

7. Shipping Instructions – Ship

- a) Give 1 Copy of BOL and 1 Copy of ERG to Driver
- b) Retain 1 Copy of BOL for Dealership records and archive for 2 Years

8. Requesting a New Box / Shipping Labels

If a new box or replacement shipping labels are needed, please contact the representative listed below by phone or email to request replacement materials.

Primary Contact: **Armando Gonzalez** - Tel #: 210-250-5079

E-Mail: SCFieldaction.14305@xpo.com

To help expedite your request, please be prepared to provide the following information:

- a) Serial number on the original box
- b) What Type of shipping material needed
 - Replacement Box
 - Two Part Return Label
 - Bill of Lading
 - ERG Form
- c) Dealer Shipping Information
 - Contact name
 - Dealer Address
 - Phone Number

