



**Volvo Car Corporation**  
TIE - Technical Information Exchange

## TIE - Technical Journal

**Title** Recall R89716: Replace 3rd Row Passengers Side Seatbelt Retractor  
**Ref No** US 32813. 1. 1 en-US **Status** Released  
**Issuer** LWERBERG - Leo Werberg **Status Date** 2017-06-08  
**Partner** 3 US 7510 Volvo Car USA **Issue Date** 2017-06-08  
**Func Group** 8800 **Reference**  
**Func Desc** interior equipment

### Attachment

File Name	File Size
QBI-504457-1_1_0_en-US.pdf	3.5869 MB

### Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
256							2017 -2017		-	0 -0

### CSC Customer Symptom Codes

Code	Description	
XW	Service/repair/Service action/Recall	

### VST Operation Number

VST Operation No.	Description
97195	Replace 3rd Row Passenger Side Seatbelt Retractor

### DTC Diagnostic Trouble Codes

Rows beginning with \* are modified  
 Note! If using a printed copy of this Technical Journal, first check for the latest online version.

### Text

#### Description:

Volvo Car USA LLC and Volvo Car Canada LTD (Volvo) on behalf of Volvo Car Group has decided to launch Recall R89716 on certain model year

2017 XC90 vehicles with 7 seats.

The crimping of the tube for the Micro Gas Generator (MGG) in the 3<sup>rd</sup> row passengers side seat belt retractor, was not manufactured to specification. In the event of a crash where the pre-tensioner is activated and in combination with certain conditions, the MGG squib may detach and be propelled out of the tube. If the MGG squib penetrates the inner side trim panel, it will lose most of its kinetic energy before it may enter the 3rd row occupant compartment.

Despite this condition, the seat belt functions properly.

**Service:**

The corrective action is to replace the 3<sup>rd</sup> row passenger's side seatbelt retractor.

**Vehicle Report:**

N/A